



EMDC EASTERN MAINE
DEVELOPMENT CORPORATION

**Phase I Environmental Site Assessment
Belfast Fire Station
273 Main Street
Belfast, Maine 04915**



CEG Project # 0123-427-00/301
BF00A00918

April 6, 2023
Revised May 22, 2023

Prepared for:

Michael Elliott
Eastern Maine Development Corporation
40 Harlow Street
Bangor, ME 04401

CAMPBELL
ENVIRONMENTAL GROUP

CAMPBELL
ENVIRONMENTAL GROUP

May 22, 2023

Mr. Michael Elliott
Eastern Maine Development Corporation
40 Harlow Street
Bangor, ME 04401

Re: Phase I Environmental Site Assessment
Belfast Fire Station
273 Maine Street
Belfast, Maine 04915

Dear Mr. Elliott:

Campbell Environmental Group, Inc. (CEG) is the Qualified Environmental Professional for the Eastern Maine Development Corporation's (EMDC's) U.S. Environmental Protection Agency (EPA) Brownfield Assessment grant. EMDC hired CEG to conduct this Phase I Environmental Site Assessment (ESA) for the City of Belfast's Fire Station located at 273 Main Street, in Belfast, Maine (Subject Property). This assessment and report were completed to fulfill the intent of the American Society of Testing and Materials (ASTM) Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process E 1527-21 guidelines. The purpose of this Phase I ESA was to identify existing and or potential environmental conditions within the Subject Property, including impacts and or potential impacts to the Subject Property from off-site sources. The results of this assessment are detailed in the report.

If you have any questions or comments, please do not hesitate to contact us. CEG appreciates working with you on this project.

Sincerely,



Danica Kay
Senior Geologist



Richard Campbell
Maine Certified Geologist
President

Enclosure

TABLE OF CONTENTS

1.0 INTRODUCTION AND SCOPE OF WORK	1
1.1 Purpose	1
1.2 Scope of Services	1
1.3 Significant Assumptions, Limitations, and Exceptions	1
1.4 Special Terms and Conditions, User Reliance	2
2.0 SITE DESCRIPTION	2
2.1 Site Location and Legal Description	2
2.2 Site and Vicinity Characteristics	2
2.3 Utilities and Other Improvements	3
2.4 Site Geology and Hydrogeology	3
2.5 Current Use of the Property	6
2.6 Historical Use Information on the Property	6
2.7 Historical Topographic Maps & Aerial Photography	7
2.8 Adjacent Property Information and Historical Use	8
2.9 Sanborn Fire Insurance Maps and Town Directories	10
3.0 SITE RECONNAISSANCE	12
3.1 Exterior Observations	12
3.2 Interior Observations	19
4.0 USER PROVIDED INFORMATION	27
4.1 Title Records	27
4.2 Reason for Performing Phase I ESA	28
5.0 TRANSACTION SCREEN QUESTIONNAIRE	28
6.0 RECORDS REVIEW	28
6.1 Orphan Site Summary	29
6.2 State of Maine, Department of Environmental Protection File Review	29
6.2.1 Spill Reports	29
6.2.2 Underground Storage Tanks (USTs)	31
6.2.3 Previous Investigations	33
6.2.4 Other Investigations in the Vicinity	33
6.2.4.1 Sunoco, Texaco, Seacoast Grocery, and Autozone, 281 Main Street ..	33
6.2.4.2 Maritime, 262 Main Street	36
6.2.4.3 CN Brown/Big Apple, 268 Main Street, Tax Map 12, Lot 40	37
6.2.4.4 Merrill's Power Wash, 26 Starrett Drive, Tax Map 12, Lot 40A	37
6.2.4.5 Nickerson's Exxon and Boyton's Bulk Plant, 25 & 29 Belmont Avenue	37
6.2.4.6 Boynton Bulk Plant, 29 Belmont Avenue	38
6.2.4.7 Wale Park, 40 Main Street, Phase I and Phase II ESAs by Ransom	
Consultants, dated November 26, 2012 and March 20, 2013,	
respectively	40
6.3 Vapor Encroachment Screening (VES)	42
6.4 Potential Contaminants of Concern	42
6.4.1 Per- and Polyfluorinated Substances (PFAS)	42
6.4.2 Petroleum Substances from Off-site Sources	43
6.4.3 Hazardous Building Materials	43

6.4.4	Nonpoint Source Pollution	43
7.0	INTERVIEWS	44
7.1	Interviews with Owners, Site Manager, and Occupants	44
7.2	Interviews with Local Government Officials	44
7.3	Considerations Beyond Phase I ESA Scope	44
8.0	SENSITIVE RECEPTOR	45
9.0	FINDINGS, OPINIONS, CONCLUSIONS, and RECOMMENDATIONS	45
9.1	Findings and Opinions	45
9.2	Recognized Environmental Conditions (RECs)	46
9.3	Conclusions & Recommendations	46
10.0	DEVIATIONS AND DATA GAPS	47
11.0	ADDITIONAL SERVICES	47
12.0	REFERENCES	47
13.0	SIGNATURE AND QUALIFICATIONS	47

APPENDICES

Appendix A- Figures

Figure 1 - Locus Topographic Map

Figure 2 - Tax Map

Figure 3 – Google Earth Aerial Photograph with Tax Map Overlay

Figure 4 - MEDEP Database Symbol Map

Appendix B – ASTM Questionnaires

Appendix C – Environmental Data Resource- Sanborn Maps, City Directories, Historic Topographic Maps, and Aerial Photography

Appendix D – Environmental Data Resource Radius Report

Executive Summary

Campbell Environmental Group, Inc. (CEG) conducted a Phase I Environmental Site Assessment (ESA) at the City of Belfast's Fire Station located at 273 Main Street, in Belfast, Maine, hereafter, referred to as the Subject Property. For the purpose of this Phase I ESA, the Subject Property boundary is not the entire 38.5-acre parcel identified by the City of Belfast as Tax Map 12, Lot 50 but an approximate 300 feet portion that is located along the frontage of Main Street and extends 500 feet perpendicular to Main Street (the southwestern portion of the lot). According to tax assessor records, two buildings occupy the Subject Property. The museum building was constructed in 1979 and the Fire Station constructed in 1987. An addition to the west side of the Fire Station was constructed in 2011. Paved parking is located between the buildings and Main Street. Behind the building is cleared and has been used as a location for snow removal and fire practices.

The Subject Property is zoned Residential-2. The topography of the Subject Property is relatively flat with the exception of two 4-6 feet deep drainage swales on the east and west sides of the Fire Station building. The Subject Property is serviced by public sewer and public water from the quasi-municipal Belfast Water District.

The Fire Station building is heated using #2 fuel oil and the generator is powered by an on-site propane aboveground storage tank. The museum building is not heated. Overhead electrical lines run along the north side of Main Street. The neighborhood is a mix of retail, restaurants, businesses, service stations, and a cemetery. The Subject Property is bordered to the north and east by Grove Cemetery; to the south Main Street and across Main Street are a gasoline service station, Walgreens Pharmacy; and to the west is an Autozone parts and service center. Beyond the cemetery to the north is the Belfast High School and to the east is a residence.

Historical and current gasoline service stations within a 0.25-mile radius of the Subject Property include: the former Sunoco/Texaco on the western adjacent property and the former Exxon station further west of the Subject Property; and the former CN Brown/Big Apple and current Maritime stations across Main Street to the south. Although the Maine Department of Environmental Protection (MEDEP) required cleanup at these locations, residual gasoline impacts remained due to site constraints. CEG's findings as a result of research of historical records, site reconnaissance, and interviews include the following:

- It is likely historic storage and usage of Per- and Polyfluorinated Substances (PFAS) containing fire suppression surfactants occurred at the Subject Property prior to the phasing out of PFAS containing substances. Class B aqueous film forming foam (AFFF) containers were observed in the Fire Station during the site reconnaissance. According to the National Environmental Management Academy, Class B AFFF most likely contains or transforms to PFAS.
- The holes drilled through the concrete floor of the garage bay where the vehicles are stored and minor maintenance conducted is a conduit for residue to be discharged to the subsurface. According to Fire Chief Richards, the floor drains discharge to the drainage swale to the west of the fire station building.
- The area behind the Fire Station building has been utilized for snow storage and snow melting for many years as well as fire safety training. The snow stockpiling practice has the potential of importing nonpoint source contaminants to the Subject Property and with the snow melt, could potentially impact soils, subsurface soils, groundwater, and surface water (drainage swales) at the Subject Property. If certain AFFF compounds were used in the fire suppression exercises, residual PFAS may be present on the ground surface.
- The age of the buildings is relatively new (1979 and 1984) compared with known hazardous building materials that were common prior to 1978. However, if the building(s) are slated for demolition, certain hazardous materials should be tested and verified and removed if they exist.

The following recognized environmental conditions (RECs) have been identified by CEG through review of federal, state and local records, observations during the site reconnaissance, and interviews with knowledgeable persons.

- CEG has identified AFFF surfactants present at the facility potentially containing PFAS. Although no evidence of current releases of these AFFFs, the use of these surfactants in and outside the facility historically could pose a risk to human health and the environment.
- Residual petroleum from two former and one current gasoline station could pose a vapor encroachment condition and any future building especially constructed with a basement is susceptible to vapor intrusion without appropriate sampling or confirmatory data.
- The practice of stockpiling snow from nonpoint sources on-site creates a risk that contaminants may leached to the ground surface.
- Although the holes in the concrete slab assist with drainage issues, the holes are providing a conduit for any potential contaminants to discharge to the subsurface below the building's slab. Also, the floor drains discharging to the drainage swale west of the fire station is a pathway for contaminants on the fire station floor to be released to the environment.

CEG recommends a Phase II ESA be conducted to confirm or dismiss the potential of contamination (the RECs listed above) that could impact human health and the environment.

Conditions and information not obtainable through this Phase I ESA process could potentially change this risk assessment and should be re-evaluated in the event other information becomes available.

1.0 INTRODUCTION AND SCOPE OF WORK

1.1 Purpose

Campbell Environmental Group, Inc. (CEG) conducted a Phase I Environmental Site Assessment (ESA) at the City of Belfast's Fire Station located at 273 Main Street, in Belfast, Maine, hereafter, referred to as the Subject Property. For the purpose of this Phase I ESA, the Subject Property boundary is not the entire 38.5-acre parcel identified by the City of Belfast as Tax Map 12, Lot 50 but an approximate 300 feet portion that is located along the frontage of Main Street and extends 500 feet perpendicular to Main Street (the southwestern portion of the lot). Main Street has also been referenced as Belmont Avenue and U.S. Route 3. This Phase I ESA was performed in accordance with the requirements of the American Society for Testing and Materials (ASTM) International Designation: E 1527-21, *Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process*, which meets the requirements of the United States Environmental Protection Agency (USEPA) All Appropriate Inquiry (AAI), 40 CFR Part 312. The purpose of this Phase I ESA was to identify existing and or potential environmental conditions, including potential off-site sources that could impact the Subject Property.

1.2 Scope of Services

The scope of work for the Phase I ESA included the following:

- Reviewed readily available public information regarding current and historical site uses and researched local, state, and federal records and databases;
- Interviewed knowledgeable individuals that consisted of city officials;
- Conducted a site reconnaissance;
- Conducted a visual inspection of abutting properties' exteriors;
- Conducted a Maine Department of Environmental Protection (MEDEP) file review of the site and surrounding vicinity;
- Reviewed aerial photographs, topographic maps, and geologic and hydrogeologic data; and
- Prepared a report summarizing the work completed.

1.3 Significant Assumptions, Limitations, and Exceptions

CEG has reviewed information concerning the potential presence of contamination on the Subject Property and has prepared this report in a professional manner using the degree of skill and care exercised for similar projects under similar conditions by reputable and competent environmental consultants. The information contained in this report, including its conclusions, is based on the information that was made available to CEG during the investigation for the services described. Because this report is based on available information, some of its conclusions could be different if the information upon which it is based is determined to be false, inaccurate, misleading, or contradicted by additional information.

CEG makes no representation concerning the legal significance of its findings or of the value of the property investigated. This report was prepared for the City of Belfast under the EMDC's U.S. Environmental Protection Agency (EPA) Brownfield Assessment grant. No third party is entitled to rely on any information or opinions contained in this report.

1.4 Special Terms and Conditions, User Reliance

No special terms and conditions have been included in this Phase I ESA. According to town records and verified by the Tax Assessor, the owner of the building and property is the City of Belfast.

2.0 SITE DESCRIPTION

2.1 Site Location and Legal Description

According to tax assessor records, two buildings occupy the Subject Property. The Fire Station building is 8,520 square feet (60' by 110') and a second building which is referred to as the museum is 74' by 28'. An addition to the Fire Station consisted of the west garage bay was constructed in 2011. Paved parking is located between the buildings and Main Street. Behind the building is cleared and has been used as a location for snow removal for many years and fire safety training.

Table 1	
Description	Subject Property
Property Address	273 Main Street
Map / Lot Number	Southwest portion of 12/50
Lot Size	3.4-Acres
Zoning	Residential-2
Current Property Use	City Fire Station
Date of Building Constructed	1979 Museum building, 1987 Fire Station building and 2011 for Fire Station addition according to tax assessor records

2.2 Site and Vicinity Characteristics


The neighborhood is a mix of retail, restaurants, businesses, service stations, and a cemetery. The intersection of Route 3 and Route 1 is 300 feet west of the Subject Property. This intersection directs traffic to Downtown Belfast's waterfront or bypasses downtown and provides a commuter route (Route-1) south to Camden and north to Searsport.

The Subject Property is zoned Residential-2. The topography of the Subject Property is relatively flat with two 4-6 feet deep drainage swales on the east and west sides of the fire Station building.

2.3 Utilities and Other Improvements

The Subject Property is serviced by public water from the Belfast Water District. The Belfast Water District has operated for 116-years. The Belfast Water District uses ground water as its water source. There are two gravel packed wells located in the Goose River Aquifer in Swanville and Belfast. These wells have been in production since the 1950's. In the 1950s, two wells were drilled into a sand and gravel aquifer on the east side of Belfast for additional water supply and in 1980, when the Water District discontinued using the Little River Reservoirs, these wells became the sole supply of pure, high-quality water for the district's 1,800+ customers. The Subject Property is serviced by public sewer. Although when CEG contacted the Belfast Wastewater Treatment Department, their staff was unable to verify the date of available public sewer to this portion of Main Street.

The Fire Station building is heated by #2 fuel oil. A propane aboveground storage tank fuels the outside generator. The museum building is not heated. Overhead electrical lines run along the north side of Main Street.

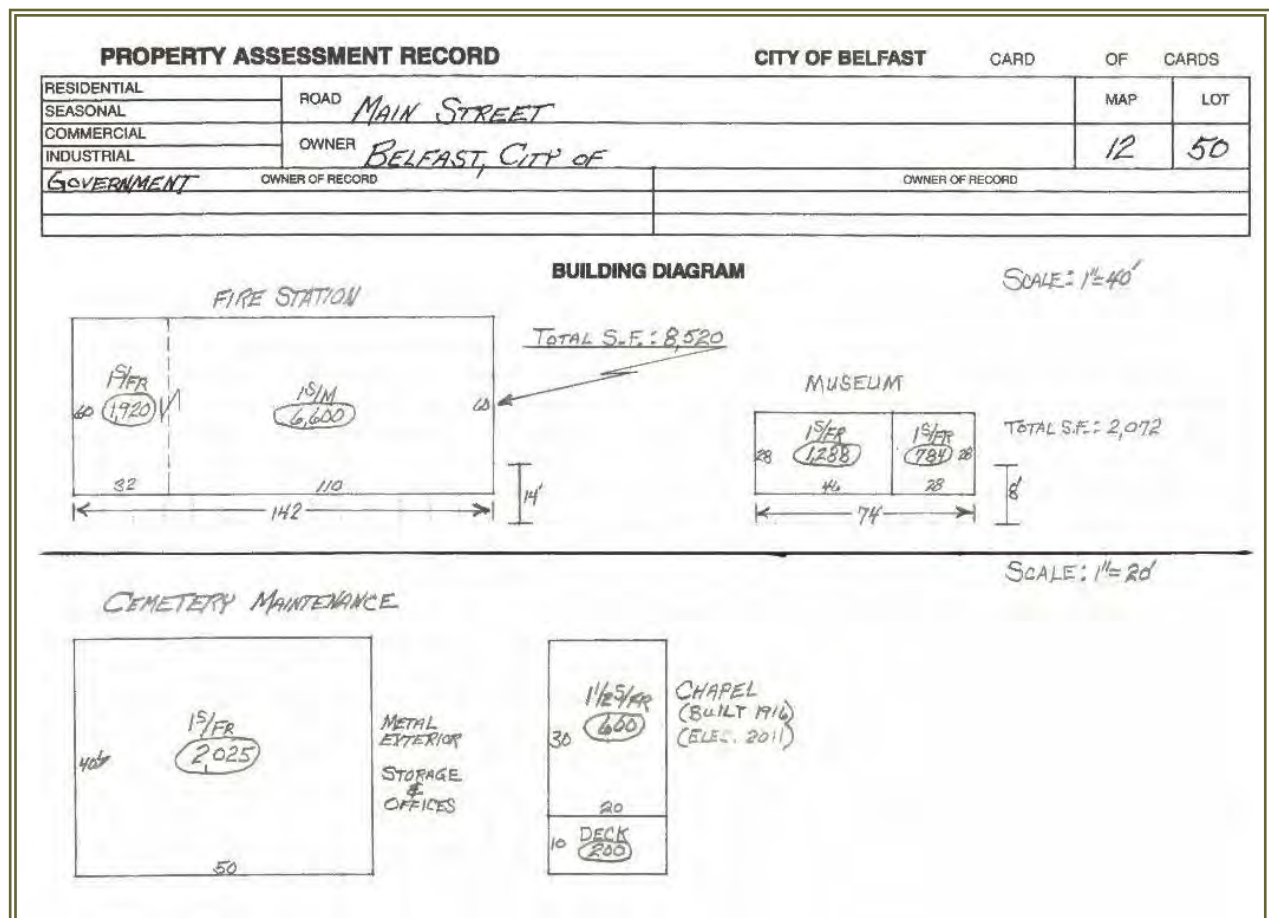


Sketches of the building footprints filed with the Belfast Tax Assessor


2.4 Site Geology and Hydrogeology

Geological sensitivity maps prepared by the Maine Geological Survey including Bedrock Geology, Surficial Geology, Significant Sand and Gravel Aquifers, Fresh-Water Wetlands, and Groundwater Resource Maps were reviewed. **Table 2** summarizes the review of these maps.

Table 2 Site Geology and Hydrogeology		
Feature	Source	Description
Nearest Water Body	Maine DOT 08-1997	An unnamed stream flows south to north approximately 80 feet east of the Fire Station building, Belfast Bay is 0.85 mile west of Subject Property
Surficial Geology	Surficial Geology of the Belfast Quadrangle Maine, Open File 14-13, 2014, Maine Geological Survey	Till comprised of poorly sorted clay, silt, sand, and gravel
Bedrock Geology	According to the Bedrock Geology of the Belfast Quadrangle Maine, Open File 12-37, 2012, Maine Geological Survey	Ordovician to Precambrian aged fine-grained intermediate to felsic metatuff of the Penobscot Formation, Gushee member.
Wetlands	National Wetland Inventory (NWI)	Nearest mapped wetland is approximately 500 feet south, southeast of Subject Property described as 5.45 acres of freshwater palustrine forested, broad-leaved deciduous, seasonally flooded/saturated wetland
Flood Zone	FEMA Flood Panel 23011C0526D	No flood zone within Subject Property boundaries
Public Drinking Water Source	MEDEP EGAD Database	1.5 miles southwest of Subject Property
Sand & Gravel Aquifer	MEDEP EGAD Database	1.36 miles southwest of Subject Property
FEMA-Federal Emergency Management Agency, FIRM-flood insurance rate map, GPM-gallons per minute		

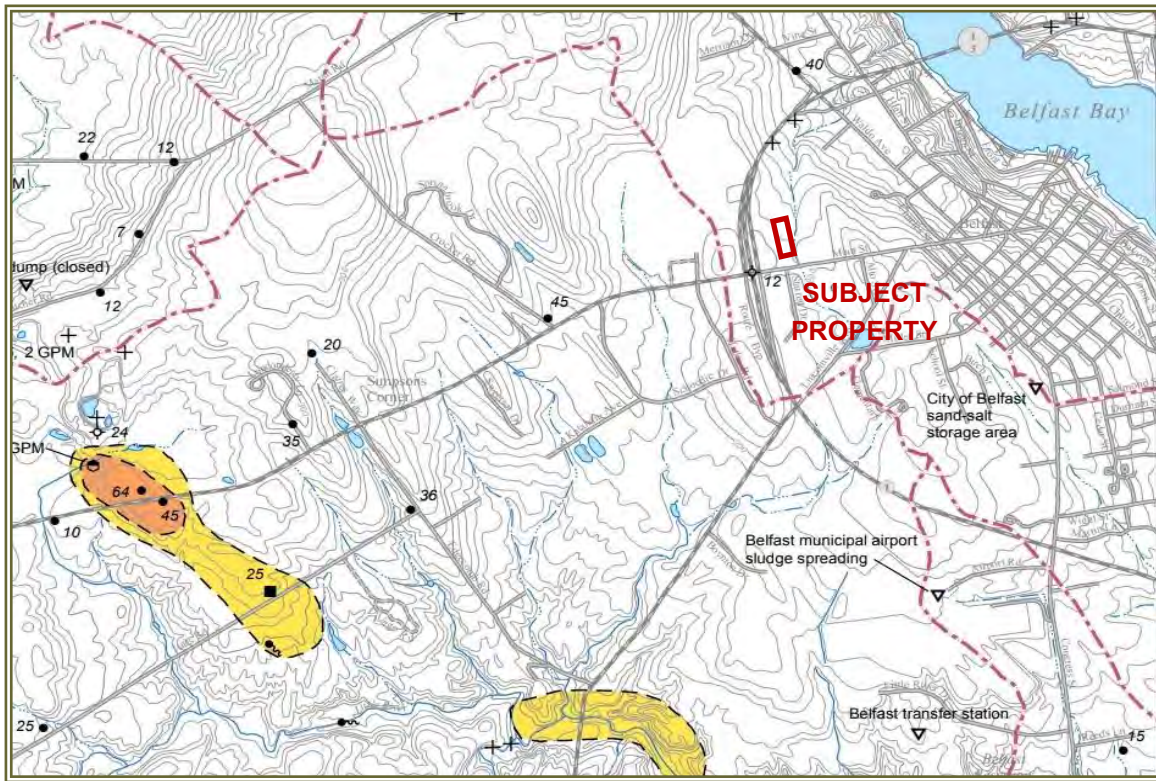

Sand & Gravel Aquifer map with Subject Property location for reference

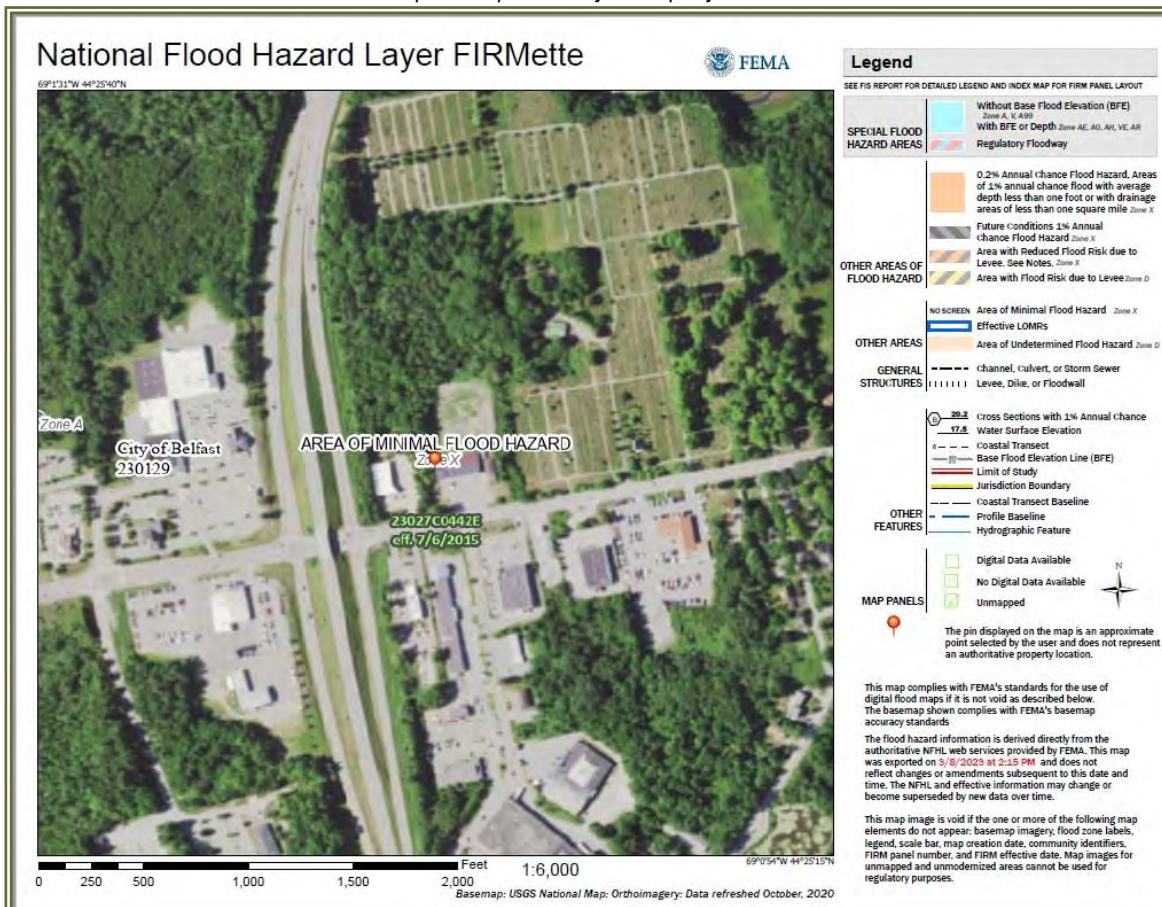

Federal Emergency Management Agency Flood Insurance Rate Map



Excerpt from the National Wetland Inventory Mapper. See Table 2 for description of PFO1E

2.5 Current Use of the Property


The Subject Property is currently operating as the City Fire Station. The museum building is used for storage and is not open to the public.

2.6 Historical Use Information on the Property

Megan Pinette, of the Belfast Historical Society, provided CEG with photographs and limited historical information. The City of Belfast acquired the property in 1973 for the purpose of constructing the fire station. According to tax assessor records, the museum building was constructed in 1979 and the Fire Station building in 1987. Ms. Pinette provided CEG with photographs of the Route 1 and Route 3 intersection prior to the construction of the Fire Station as shown below.



*Photograph of former Viking Lumber prior to the construction of the overpass
dated August 7, 1967 provided by the Belfast Historical Society*

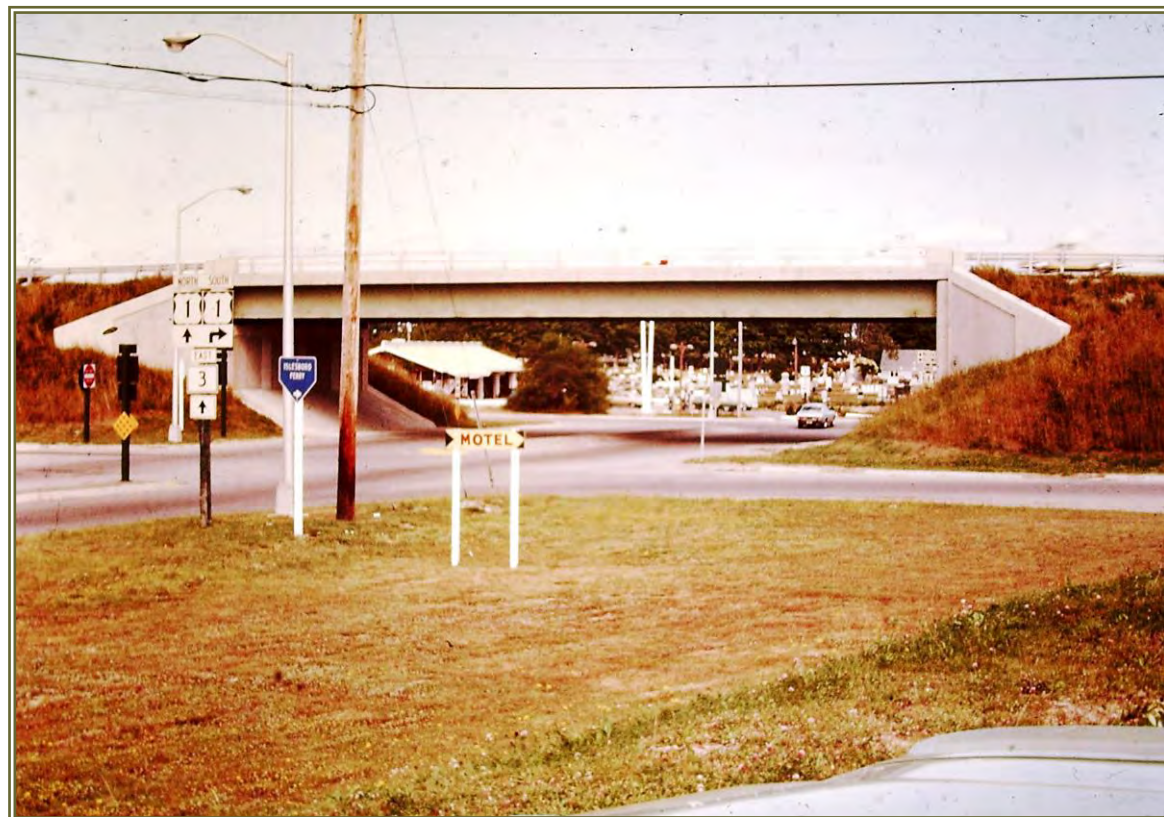

*Photograph of Route 1 and Route 3 intersection after overpass constructed
dated August 26, 1974 provided by the Belfast Historical Society*

2.7 Historical Topographic Maps & Aerial Photography

EDR provided historical topographic maps for the years 1915, 1917, 1941, 1950, 1960, 1973, 1979, 2014, and 2018. The topographic maps dated 2014 and 2018 did not have much detail; however, the fire station and cemetery were depicted on both. The nearby school was not shown on the 1960 topographic map or any other earlier topographic maps. The earlier maps had some depictions of structures along Main Street but was difficult to distinguish if they were on or adjacent to the Subject Property.

EDR included aerial photography for the years 1956, 1960, 1970, 1973, 1984, 1996, 2007, 2011, and 2018 (**Appendix C**). The Subject Property building is apparent from 1996 to most recent, 2018. The 1984 aerial shows a smaller building in the vicinity but not the size or orientation of the existing building. Neither the museum or the fire station appears on the earlier aerial photographs (1956-1973).


Ms. Pinette identified the brown building in the 1967 photograph as the former Viking Lumber location. This corresponds to the long narrow building immediately east of the former Sunoco/Texaco service station seen on aerial photographs dated 1960 and 1956. Clusters along the perimeter of this parcel appear to be lumber storage.

2.8 Adjacent Property Information and Historical Use

The Subject Property is bordered to the north and east by Grove Cemetery; to the south Main Street and across Main Street are a gasoline service station, Walgreens Pharmacy; and to the west is an Autozone parts and service center. Beyond the cemetery to the north is the Belfast High School and to the east is a residence. CEG has attempted to include any pertinent historical information obtained through the review of tax accessor records and code enforcement files. CEG did not encounter any reference to Viking Lumber; however, Fire Chief Richards indicated it occupied this location from 1949-1969.

Table 3 Adjacent Properties			
Map/Lot	Address	Owner	Use & Tax Card Information
005/116 012/44	281 Main Street	Autozone	1970 Built 1975 Webber Oil Co. 1990 Facility upgrades 11/1994 "Defunct" Seacoast Grocer 1997 Fuel tanks removed 2010 CN Brown Building demolished 2001 Autozone constructed
012/042 Split	15 Starrett Dr	Kliner Industries	Shopping Center: Sherwin-Williams Paint, Goodwill, China One Restaurant
012/042A	35 Starrett Drive	Atlantic Purchase, LLC	VIP Auto Parts
012/042B	23 Starrett Drive	RYFF1, LLC	Dunkin Donuts
012/040 Split	268 Main Street	B. Jaffe Belfast LLC	1989 CN Brown/Big Apple 2010 Big Apple demolished 2011 Walgreens Pharmacy

Table 3 Adjacent Properties			
Map/Lot	Address	Owner	Use & Tax Card Information
012/040A	26 Starrett Drive	Wicked Clean	1989 5 bay car wash
012/046	215 Main Street Formerly 5 Belmont Street	Barry Hanstein	1977 Residence w/ full basement 1990 Remodeled 2005 Leachfield replacement
012/039	262 Main Street	John Ware c/o Maritime	1962 Structure 1994 Gasoline Station (Maritime) 2002 Old structure demolished
013/012	25 Lions Way	Regional School Unit	High School
012/050	273 Main Street	City of Belfast	Cemetery

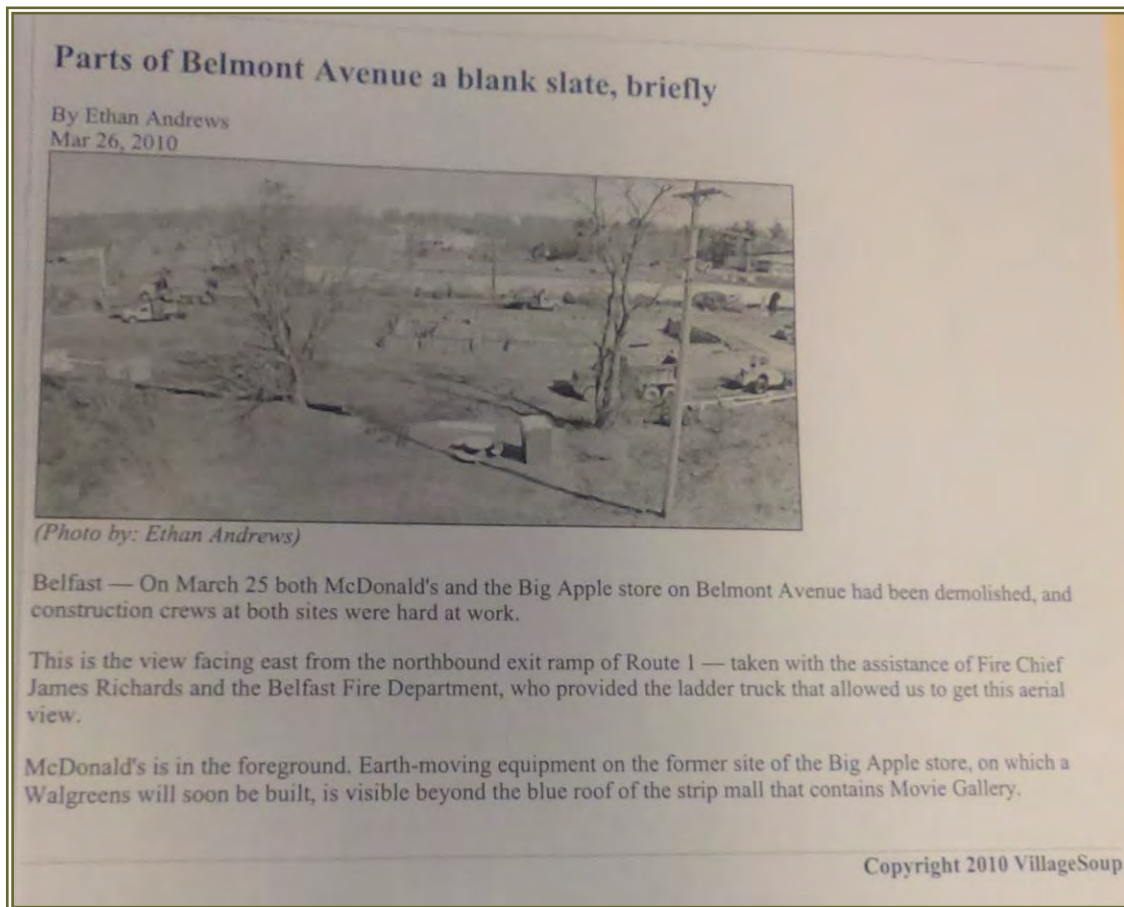

Photograph and article on the demolition along main Street in the Village Soup, 2010



Former CN Brown, Big Apple service station at 268 Main Street, Map 012, Lot 40, photograph source tax assessor

2.9 Sanborn Fire Insurance Maps and Town Directories

EDR reported Sanborn Fire Insurance Maps for a small portion east of the Subject Property that includes the Grove cemetery chapel and dwellings on the south side of Belmont Avenue for the years 1948, 1931, and 1923. In the 1965 Sanborn map the former dwellings are replaced with labeling as a filling station. This location correlates with the current Maritime service station.

Town directories were provided by EDR for the years 1992, 1995, 2005, 2010, 2014, 2017, and 2020. For the years 1992 and 1995, the directories did not list any Main Street numbers higher than 161 Main Street. The change in distinction between Belmont and Main Street occurred sometime in the late 1990's. CEG has created **Table 4** to demonstrate the listings of interest for the years EDR provided. It should also be noted that the Fire Station was listed only twice, once in 2020 at the current address and the other in 2005 under street address 281 which was also listed as Autozone.

TABLE 4 City Directory Listings								
Address	Directory Year							
	2020	2017	2014	2010	2005	2000	1995	1992
6 Belmont	Dutch Chevrolet	Dutch Chevrolet	Dutch Chevrolet	Dutch Chevrolet	Dutch Chevrolet	NL	Randall Associates	Lawrence & Judith Cole
21 Belmont	Grove Cemetery	NL	NL	Grove Cemetery	NL	Grove Cemetery	Grove Cemetery	NL
22 Belmont	Circle K	Circle K/ Shell	Circle K/ Shell	Dead River	NL	NL		NL
32 Belmont	NL	NL	NL	NL	NL	NL	Maritime	NL
273 Main St	Fire Dept	NL	NL	NL	NL	NL	NL	NL
281 Main St	Autozone & Fire Dept	Autozone	Autozone	Autozone	Fire Dept	NL	NL	NL
262 Main St	Maritime	Maritime	Maritime	Maritime	Maritime	NL	NL	NL
254 Main St	NL	NL	Rite Aid	Rite Aid	Rite Aid	NL	NL	NL
244 Main St	NL	NL	NL	Quirk Chrysler	Kallis Ford	Kallis Ford	NL	NL
Notes: NL-Not Listed								

23 Belmont Avenue, located west of the Route -1 overpass, was formerly a 300-car capacity Drive-In from the 1950's to the 1980's. Its current use is a shopping center with a street address of 1 Belmont Avenue.

3.0 SITE RECONNAISSANCE

On March 30, 2023, Danica Kay, of CEG, conducted a site reconnaissance of the Subject Property. Fire Chief Richards accompanied Ms. Kay during the site visit. Observations of significance are outlined below.

3.1 Exterior Observations

Some ground surfaces were obstructed by snow piles, snow banks, and parked vehicles. **Table 4** outlines pertinent exterior observations made during the site reconnaissance.

Table 4 CEG's Exterior Observations During Site Reconnaissance	
Checklist Items	CEG Observations
Storage Tanks	Near the northwest corner of the building is a generator assumed to contain diesel fuel for emergency use. North of the building is an approximate 60-gallon metal tank for holding water for safety training exercises, and an approximately 500-gallon propane tank.
Odors	None noted
Pools of Liquid	None noted other than snow melt
Drums	None noted
Unidentified Substance Containers	None noted
Poly-chlorinated Biphenyls (PCBs)	Pole mounted transformer on pole along Main Street beyond Subject Property
Pits, Ponds, or Lagoons	None noted
Stained Soil or Pavement	None noted; however, some snow cover obstructed some visibility
Stressed Vegetation	Not applicable, dormant season
Solid Waste	A few items observed between the eastern ditch and east side of the building.
Waste Water/Septic System	None known to have existed
Wells	None known to have existed
Discharge Pipes	None observed
NA-Not applicable due to limitations, g-gallons	

At the time of the site reconnaissance, snow banks were adjacent to both the east and west drainage swales of the front parking area. Numerous snow piles were located in a semi-circle around the northern portion of the clearing north of the Fire Station building.

According to Fire Chief Richards, some fire training does occur behind the fire station building with the use of the water tank located near the back north wall the fire station building.



Front south side of Fire Station building looking northwest



Front southwest side of Fire Station building with white sided addition looking north with parking on ground surface near drainage ditch



West side of Museum building located east of Fire Station building looking northeast



South and east side of Museum building looking northwest



Snow piles located north of Fire Station building looking northwest



Propane tank north of Fire Station building with snow piles in the background looking northeast



Drainage swale on east side of building near snow piles looking north



Drainage swale on west side of building with snow bank from plowed parking lot looking south



Miscellaneous debris along east side of Fire Station Building looking south



North wall of Fire Station building with water tank near center



Generator and propane tank near northwest corner of Fire Station Building looking northeast

3.2 Interior Observations

Table 5 outlines pertinent interior observations during the site reconnaissance. Some flooring was not visible due to vehicles, equipment, and other items stored within the buildings.

Table 5 Interior Observations During Site Reconnaissance	
ASTM Checklist Item	CEG Interior Observations
Hazardous Substances and Petroleum Products	Hydraulic oil, motor oil, WD-40, gas generator, paint, detergents, and aqueous film forming foam (AFFF) surfactants in the Fire Station and fire extinguishers in the museum building
Storage Tanks	A 275-gallon #2 fuel oil AST in the fire station building
Odors	None noted
Pools of Liquid	None noted
Drums	CEG observed drums being used for temporary solid waste storage in the fire station building
Unidentified Substance Containers	None noted
PCBs	None known
Stains or Corrosion	Some floor staining in the fire station building near the hydraulic oil pails
Drains and Sumps	Floor trench in original portion and round floor drain in the west side addition of the fire station building.
Heating/Cooling	Suspended heaters fueled by #2 fuel oil. Museum is not heated
Notes: AST-aboveground storage tank	

CEG noticed drilled holes in the concrete foundation within the first garage bay east of the office space. CEG questioned Fire Chief Richards about the holes and was informed that the slab elevation is below the existing exterior grade creating drainage problems. CEG also observed the concrete inside the garage bays was scarified. This was also created to assist with the drainage issues from storm water migrating from outside the garage bays into the structure. Initially CEG and Fire Chief Richards assumed the floor drain and floor drain trench discharged to the public sewer based on the age of the construction; however, post site reconnaissance, Fire Chief Richards communicated to CEG that *"I did find out that the floor drains are linked to the perimeter drain for the footings and drains to the ditch at the west end of the building"*.

A large quantity of cylinders are stored in the Fire Station and Museum. They range from water-based fire extinguishers, dry powder-based fire extinguishers, oxygen tanks for emergency medical services, (EMS), and self-containing breathing apparatus (SCBA) tanks. The museum building was filled with vehicles, fire extinguishers, snow mobiles, and other fire station artifacts resulting in limited access throughout the building. The entire floor was not visible.

According to Fire Chief Richards, the snow piles north the Fire Station are from off-site snow removal dumping which has been practiced for many years, possibly since the City acquired the property.


Fire Chief Richards indicated some minor maintenance of vehicles occur at the station; however, anything of significance is conducted at the off-site Public Works location.



Vehicles and materials inside the museum building



An assortment of fire extinguishers inside the museum building

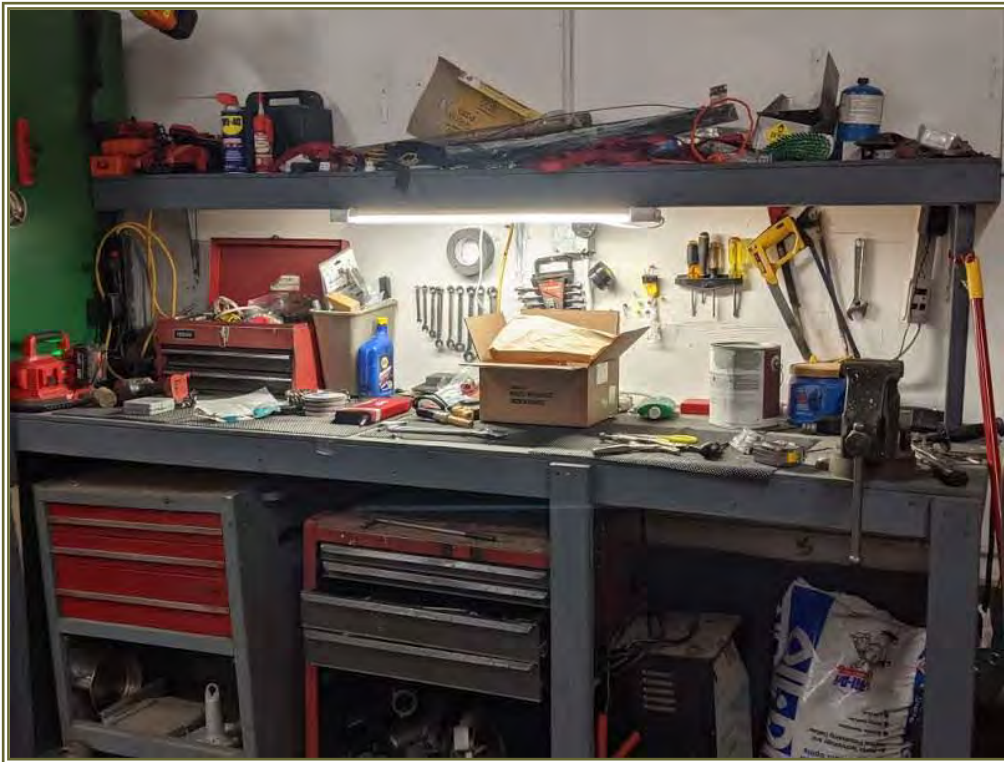

Work bench for minor maintenance of vehicles in the Fire Station building



Laundry equipment used by the fire fighters



*Scarified trough inside garage bays
for deterring outside stormwater*



*Holes drilled through the concrete floor
to assist with drainage issues*



*Floor trench that runs east-west
through the original fire station building*



Floor staining from hydraulic oil



Flammable cabinet in the newer western portion of the Fire Station



Gasoline and oil stored inside the flammable cabinet



*275-gallon #2 fuel oil above ground storage tank near back of
fire station building*



Two compressors next to oil tank



Class A Fire-fighting foam containers located in the fire station building



Fire-fighting AFFF Class B foam containers located in the fire station building

4.0 USER PROVIDED INFORMATION

A “user” is defined by ASTM Practice E 1527-21 as the party seeking to use Practice E 1527 to complete an ESA of the Subject Property and may include a potential purchaser of Subject Property, a potential tenant of the Subject Property, an owner of Subject Property, a lender, or a Subject Property manager.

Thomas Kittridge provided information pursuant to Appendix X3, of the ASTM E 1527-21 guidelines as stated below in bold text:

Are you aware of any environmental cleanup liens against the property that are filed or recorded under federal, tribal, state, or local law? **No**

Are you aware of any activity use limitations (AULs) such as engineering controls, land use restrictions, or institutional controls that are in place at the site and/or have been filed or recorded in a registry under federal, tribal, state or local law? **No**

As the user of this ESA do you have any specialized knowledge or experience related to the property or nearby properties? **No** For example, are you involved in the same line of business as the current or former occupant of the property or an adjoining property so that you would have specialized knowledge of the chemicals and processes used by this type of business?

Does the purchase price being paid for this property reasonably reflect the fair market value of the property? **Unknown** If you conclude that there is a difference, have you considered whether the lower purchase price is because contamination is known or believed to be present at the property?

Do you know the past uses of the property? **No**

Do you know of specific chemicals that are present or once were present on the property? **No**

Do you know of spills or other chemical releases that have taken place at the property? **No**

Do you know of any environmental clean-ups that have taken place at the property? **No**

As the user of this ESA, based on your knowledge and experience related to the property are there any obvious indicators that point to the presence or likely presence of contamination at the property? **No**

4.1 Title Records

Environmental consultants are not responsible for conducting the title search unless specifically requested by the user to engage the title search on their behalf. Revisions to the ASTM E-1527-21 standard provide more robust guidance about the extent of research needed. A title search was not requested as part of this Phase I ESA and CEG assumes that the User has completed a title search. The purpose of CEG's review of deeds is for possible descriptions of uses and structures, ownership by well-known named industry leaders, easements, or other information that would provide pertinent historical data. CEG attempted to access the Waldo County Registry of Deeds via the internet however, the deeds listed on the archived tax cards were not accessible. Personnel at the registry confirmed early documents are not available on-line. The deeds referenced on the tax assessor cards include books/pages: 20/353; 133/140; 133/141; 223/1; 355/238; and 412/45.

4.2 Reason for Performing Phase I ESA

This Phase I ESA was completed at the request of City of Belfast for due diligence in the redevelopment of the former Fire Station to a newly constructed Fire Station. The intent of the Phase I ESA is to identify any existing environmental concerns that could potentially impact the Subject Property.

5.0 TRANSACTION SCREEN QUESTIONNAIRE

The questions outlined in the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process E-1528-22 Part A, were addressed by Fire Chief Patrick Richards. Danica Kay, of CEG, has completed ASTM E-1528 Part B. Both ASTM questionnaires are included in **Appendix B**.

6.0 RECORDS REVIEW

In addition to the information provided in the EDR reports, CEG personnel reviewed spill reports generated by the MEDEP as well as tank registrations for the Subject Property and surrounding properties. A figure (**Figure 4, Appendix A**), depicts symbols identifying spills, tanks, remedial sites, and other issues that prompt some type of MEDEP record keeping for the Subject Property and proximity as of March 1, 2023.

EDR was utilized to search the state and federal databases. The reports contain the total number of sites or occurrences identified by the database search. The EDR search area ranged from the Subject Property to an approximate 1-mile radius around the Subject Property. The following sections include a summary of the federal database and State of Maine database records. For more information regarding the EDR identified sites, please refer to the reports attached in **Appendix D**. The following table (**Table 7**) summarizes the combined state and federal database research.

Table 7 Database Record Search by Environmental Database Research, Inc. (EDR)							
Database	Subject Property	Search Distance (miles)	< 1/8	1/8 – 1/4	1/4 - 1/2	1/2 - 1	Total Plotted
State & Local Records							
SEMS-Archive		0.50	0	0	1	NR	1
RCRA VSQG		0.25	3	0	NR	NR	3
ME SHWS		1.0	0	0	0	3	3
ME LAST		0.5	4	2	9	NR	15
ME LUST		0.5	6	1	13	NR	20
ME AST		0.25	6	4	NR	NR	10
ME UST		0.5	11	4	NR	NR	15
Institutional Control		0.5	1	0	2	NR	3
VCP		0.5	1	0	3	NR	4
Brownfield		0.5	0	0	3	NR	3
ALLSITES		0.5	2	1	3	NR	6

Table 7 Database Record Search by Environmental Database Research, Inc. (EDR)							
Database	Subject Property	Search Distance (miles)	< 1/8	1/8 – 1/4	1/4 - 1/2	1/2 - 1	Total Plotted
RCRA NonGen/NLR		0.25	2	0	NR	NR	2
ME Manifest		0.25	0	1	NR	NR	1
RI Manifest		0.25	2	0	NR	NR	2
EDR MGP		1.0	0	0	0	1	1
Historical Auto	X	SP	2	NR	NR	NR	2

SP – Subject Property

RCRA-Resource Conservation Recovery Act

UST-Underground Storage tank

LAST - Leaking aboveground storage tank

NLR-No Longer Regulated

VCP-Voluntary Cleanup Priority List

MGP-manufactured gas plant

NR - Not Reported

LUST - Leaking underground storage tank

VSQG-Very Small Quantity Generator

AST-Aboveground storage tank

ALLSITES-Remediation Sites List

SEMS- Superfund Enterprise Management System

SHWS-Sites removed from uncontrolled sites list

6.1 Orphan Site Summary

Orphan sites are properties that have been identified by EDR within the radius search but do not have adequate addresses for mapping. Four orphan sites were encountered by EDR.

Table 8 Orphan Sites			
Name	Address	Distance from SP	Database
Christies Service Station	Route 1	NA	LUST
Belfast Armory	Route 1	NA	LAST
Sampsons Supermarket	Main Street	NA	LUST
Maritime #51	Main Street	Across Main Street from Subject Property	LUST

LUST - Leaking underground storage tank

LAST - Leaking aboveground storage tank

6.2 State of Maine, Department of Environmental Protection File Review

6.2.1 Spill Reports

The Subject Property has no documented MEDEP spill reports. Other sites in the vicinity have the following spill reports summarized to generally provide an estimated quantity, type of product, and mitigation, if applicable.

Table 9 MEDEP Spill Report Summary		
Site	Spill #	Summary
Former Texaco, 281 Main Street	A-253-1995	Gasoline contamination encountered during removal of 3 USTs (reg# 6151) under bottom of middle tank and under dispenser. Most soil with VOCs > 1,000 ppm removed; however, some remained on-site due to site constraints. A total of 1,037.53 tons of petroleum-impacted soil removed off-site
Former Texaco, 281 Main Street	A-293-2000	During redevelopment of the site by Autozone, residual contamination from the 1995 release was encountered as well as an impacted dry well. 49 tons of material from the dry well was transported to Commercial Paving for disposal and an unspecified quantity of residual contamination was transported off site to Thibodeau & Sons for disposal.
CN Brown, 268 Main St	A-88-2010	Contamination was encountered during the removal of 3 USTs (Reg#15227). VOCs detected using PID and headspace technique exceeded 2,000 ppm. Cleanup criteria was 500 ppm. Some soil exceeding 500 ppm remained due to site constraints. A total of 250 CY of petroleum-impacted soil disposed off-site at Thibodeau & Sons.
CN Brown Bulk Plant, 268 Main St	A-97-2003	Approximately 1-gallon kerosene released as a result of a frozen valve. CN Brown employee cleaned up spill. No further action.
CN Brown Bulk Plant, 268 Main St	A-139-2001	Approximately 0.2-g fuel oil released as a result of a dropped nozzle. CN Brown employee cleaned up. No further action.
CN Brown, 268 Main St	A-507-1992	Approximately 100-g #2 fuel oil released from an AST as a result of an overfill. All oil was contained within the secondary containment and removed using sorbent pads. No further action required.
CN Brown, 268 Main St	A-437-1994	The facility was vandalized and as a result 30-g oil was released. CN Brown used sorbent material to clean-up oil and excavated 36.36 tons of petroleum-impacted soil for disposal at Dragon Cement.
CN Brown, 268 Main St	A-357-1995	10-g fuel oil released from delivery truck onto paved surface. Sorbent material used for clean-up. No further action was required.
CN Brown, 268 Main St	A-499-2006	Delivery driver overfilled the tank by 100-g as the fuel exceeded the overfill bucket and was running down the pavement. MEDEP referred the site to Technical Services for further involvement.
Big Apple, 268 Main St	A-708-2009	Unspecified quantity and type of petroleum released. No records available.
CN Brown, 268 Main St	A-347-2009	An abandoned 5-gallon pail of waste oil was accidentally overturned near the dumpster. Environmental Projects Inc., was contracted to conduct the cleanup. Two 55-gallon drums of waste oil impacted soil were disposed off-site. No further action.
Maritime, 262 Main St	A-485-2006	Due to improper backfill material in pipe trenches, leaks occurred. An unspecified quantity of petroleum was released. As a result of cleanup efforts, 279 CY of petroleum-impacted soil was disposed off-site and 83,422-gallons of petroleum-impacted groundwater was disposed off-site. (Reg# 3764)
Maritime, 262 Main St	A-798-2011	Approximately 8 gallons unleaded gasoline released to the pavement as a result of a customer overfill. Employees cleaned up using sorbent material.
Maritime, 262 Main St	A-586-1993	A discrepancy in the inventory records prompted MEDEP to request Maritime take the tank out of service unless it passed a precision test. The tank passed the test. No further action was required.
Maritime, 262 Main St	A-11-1994	MEDEP was notified of a tank taking on water. Maritime requested a 5-week delay in removing the tank. Upon the UST removal, a hole was observed and a cleanup goal of 500 ppm was established. 100 CY of petroleum-impacted soil was removed and disposed off-site. Some soil > 500 ppm remained due to site constraints.

Table 9 MEDEP Spill Report Summary		
Site	Spill #	Summary
Maritime, 262 Main St	A-95-2003	MEDEP notified of water in the gasoline. MEDEP conducted an investigation and found some issues with the system that would need repairs.
CN Brown, Searsport Street	A-116-1997	MEDEP was contacted during the removal of USTs (Reg# 15262) as a result of encountering contaminated soil. Approximately 24 CY of petroleum-impacted soil transported to Thibidoeau for disposal.
CN Brown Bulk Plant	A-18-2000	CN Brown contacted MEDEP regarding pavement staining. CN Brown personnel cleaned up what they could with sorbent material. Source of staining unknown but assumed to be from an overfill.
Car Wash Belmont Ave	A-434-1990	MEDEP contacted to obtain waiver for pulling 4,000-g UST that was taking on water. UST removed and observed to have hole but no contamination was observed.
CN Brown Bulk Plant	A-470-1996	Approximately 100-gallons oil released to the dike area as a result of an overfill caused by a faulty gauge tape. Oil was pumped from the dike area and surface spill cleaned up with sorbent material.
Xpress Lube, 35 Starrett Dr	A-585-2001	An anonymous message was left with MEDEP regarding Xpress Lube. MEDEP investigated and found no issues.
Charles Boynton, 11 Belmont Ave	A-260-2003	An apparent 10-g release of #2 fuel oil was reported to MEDEP. Upon their investigation the residence was in such poor condition that the Town condemned the property and the AST was pumped free of product to reduce any future release.
Dutch Chevrolet, Belmont Ave	B-59-1980	A neighbor of Dutch Chevrolet complained about petroleum contamination in his water supply well. MEDEP investigated and presumed the source was from Dutch Chevrolet.
Cronin, 216 Main St	A-523-2017	A leaking #2 fuel oil AST was encountered during a routine maintenance visit. The release was cleaned up with sorbent material. Home owner reported no vapors.
Nickerson's Exxon, Route 3	A-232-1998	Notification to MEDEP was made following the completion of the UST Assessment Report documenting petroleum concentrations exceeding notification concentrations. A project file contains more detailed information.
Notes: CY-cubic yards, ppm-parts per million, g-gallons, UST-underground storage tank, PID-photoionization detector, MEDEP-Department of Environmental Protection, VOC-volatile organic compound, AST-aboveground storage tank		

6.2.2 Underground Storage Tanks (USTs)

Registered USTs are regulated under Subtitle I of Resource Conservation and Recovery Act (RCRA) and by the MEDEP. Owners have been required to register their USTs since the late 1980s. Prior to the 1980's, there was no state record keeping requirements and consequently, the state's current system does not always account for USTs installed or removed prior to the 1980s. Although ASTs are typically registered with the State Fire Marshall, in some cases, data is also filed with the MEDEP records. **Table 10** below lists active and removed registered USTs located within less than 1 mile from the Subject Property as of March 1, 2023.

The UST registration #15227 file for CN Brown, 268 Main Street was not ascertainable to be included in the table below.

Table 10 UST and AST Registrations with the MEDEP				
Reg. #	Name	Address	Installed - Removed	Volume (gal.) / Product
21109	Maritime	262 Main Street	10/21/2005-Active	500-g/kerosene
3764	Maritime	262 Main Street	1/1/1980-8/1/1990	4,000-g/leaded gasoline
			1/1/1984-4/1/1994	4,000-g/unleaded gasoline
			1/1/1984-4/1/1994	4,000-g/unleaded gasoline
			1/1/1975-4/1/1994	2,000-g/unleaded gasoline
			5/1/1975-11/27/2006	6,000-g/unleaded gasoline
			5/1/1994-11/27/2006	4,000-g/unleaded gasoline
			5/1/1994-11/27/2006	4,000-g/unleaded gasoline
			12/1/2006-Active	4,000-g/unleaded gasoline
			12/1/2006-Active	2,000-g/unleaded gasoline
			3/23/2006-Active	500-g/kerosene
15227	Big Apple	38 Searsport Ave	5/1/1989-2/12/2010	10,000-g/unleaded gasoline
			5/1/1989-2/12/2010	10,000-g/unleaded gasoline
			5/1/1989-2-12/2010	10,000-g/unleaded gasoline
16043	Poultry Barns	Belmont Ave	10/1/1969-8/19/1989	1,000-g/#2 fuel oil
			10/1/1969-8/19/1989	1,000-g/#2 fuel oil
6252	Merle Grass	Belmont Ave	10/1/1969-6/1/1980	2,000-g/#2 fuel oil
			10/1/1969-6/1/1980	2,000-g/#2 fuel oil
623	Kallis Ford	244 Main Street	12/1/1967-9/1/1989	1,000-g/waste oil
			12/1/1967-9/1/1989	500-g/waste oil
			12/1/1967-9/1/1989	1,000-g/#2 fuel oil
			9/1/1980-8/1/1991	1,000-g/#2 fuel oil
6151	Sunoco/Texaco	281 Main Street	7/1/1971-6/12/1985	6,000-g/diesel fuel
			7/1/1971-6/12/1985	6,000-g/unleaded gasoline
			7/1/1971-6/12/1985	6,000-g/unleaded gasoline
			7/1/1971-8/1/1984	1,000-g/#2 fuel oil
			7/1/1971-8/1/1984	1,000-g/waste oil
1914	Mollisons' Inc.	Belmont Ave	10/1/1969-10/1/1989	3,000-g/diesel fuel
			10/1/1969-10/1/1989	3,000-g/diesel fuel
			10/1/1969-6/1/1989	2,000-g/leaded gasoline
			10/1/1969-6/1/1986	4,000-g/leaded gasoline
			10/1/1969-16/1/1986	3,000-g/leaded gasoline
11020	Doris Mawhinney	Belmont Ave	7/1/1976-10/1/1980	275-g/#2 fuel oil
1513	Dutch Chevy	6 Belmont Ave	1/1/1980-6/1/1990	500-g/waste oil
			1/1/1975-6/1/1990	1,000-g/#2 fuel oil
			1/1/1961-6/1/1990	1,000-g/#2 fuel oil
			1/1/1961-6/1/1990	1,000-g/#2 fuel oil

Table 10				
UST and AST Registrations with the MEDEP				
Reg. #	Name	Address	Installed - Removed	Volume (gal.) / Product
20961	Athena Health	3 Hatley Rd	2/1/1996-Active	10,000-g/diesel fuel
2053	Nickerson's Exxon	25 Belmont Ave	9/1/1984-9/20/2002	6,000-g/unleaded gasoline
			9/1/1984-9/20/2002	4,000-g/unleaded gasoline
			9/1/1984-9/20/2002	4,000-g/unleaded gasoline
20132	Circle K/Shell	22 Belmont Ave	2/2/2000-11/17/2017	15,000-g/unleaded gasoline
			2/2/2000-11/17/2017	10,000-g/unleaded gasoline
			9/19/2014-Active	15,000-g unleaded gasoline
			12/8/2017-Active	10,000-g/diesel fuel
			12/8/2017-Active	5,000-g/unleaded gasoline
Notes: NL-Not listed, g-gallon				

6.2.3 Previous Investigations

No prior investigations at the Subject Property were known to have been conducted or available for CEG to review.

6.2.4 Other Investigations in the Vicinity

6.2.4.1 Sunoco, Texaco, Seacoast Grocery, and Autozone, 281 Main Street

The site is listed with the MEDEP as an injection site as a result of the former Sunoco Service station having had floor drains that discharged to the historic on-site leachfield.

UST Removal Assessment, Belfast Texaco, September 14, 1994, prepared by CES

The report documented the removal of one 1,000-gallon #2 fuel oil UST and one 1,000-gallon waste oil UST. The report indicated the site had operated as a gasoline service station since 1971. In 1975 Sun Oil Company sold the property and business to Webber Oil Co. Screening soils for volatile organic compounds (VOCs) using a photoionization detector (PID) had concentrations up to 2.1 part per million (ppm). A duplicate sample of the 2.1 ppm soil was collected for laboratory analysis of total petroleum hydrocarbons (TPH). The laboratory results indicated a TPH concentration of 11,000 ppm. The concentration did not correlate with the screening and CES concluded the laboratory sample must have inadvertently contained some of the tar from the tank coating. CES concluded there was no evidence of a release and no further action was necessary.

UST Site Assessment, Belfast Texaco, July 17, 1995 prepared by Acadia Environmental Technology

The report documented the removal of three USTs: two 6,000-gallon gasoline USTs and one 6,000-gallon diesel fuel UST. Soil screening for VOCs ranged from below the detection limit to greater than 2,500 ppm in several locations. MEDEP established a cleanup goal of 1,000 ppm. A total of 1,032 tons of petroleum-impacted soil was transported to an unspecified off-site location. The report stated that due to site constraints, some soils exhibiting VOCs greater than 1,000 ppm remained on-site. No further action was required.


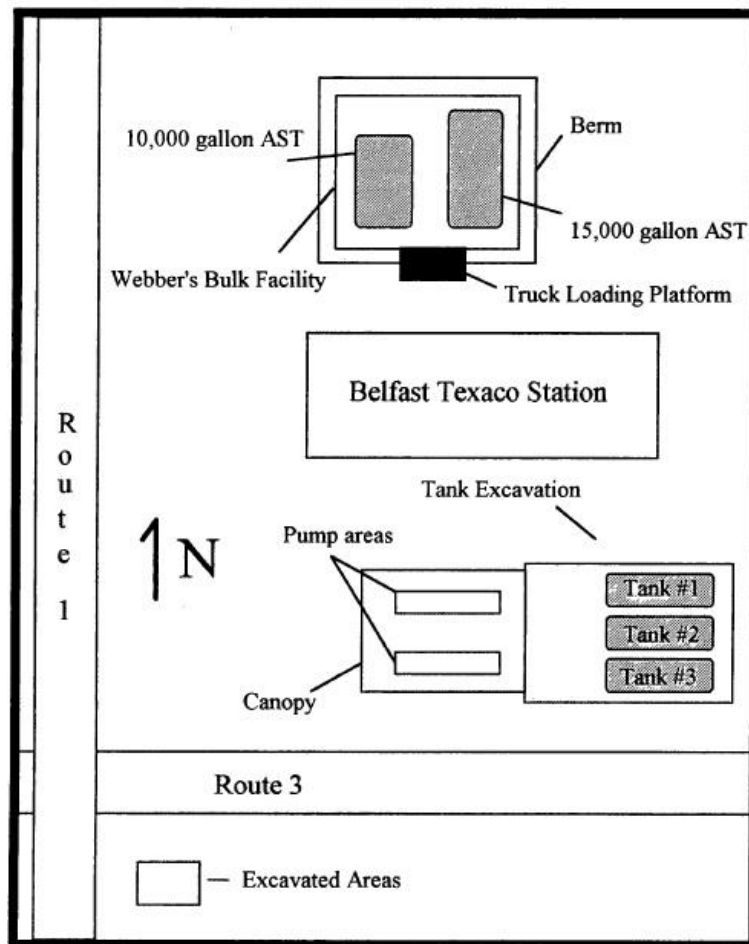


Figure 2 - Site Plan
 Belfast Texaco, Belfast, Maine
 Acadia Environmental Technology
 (not to scale)

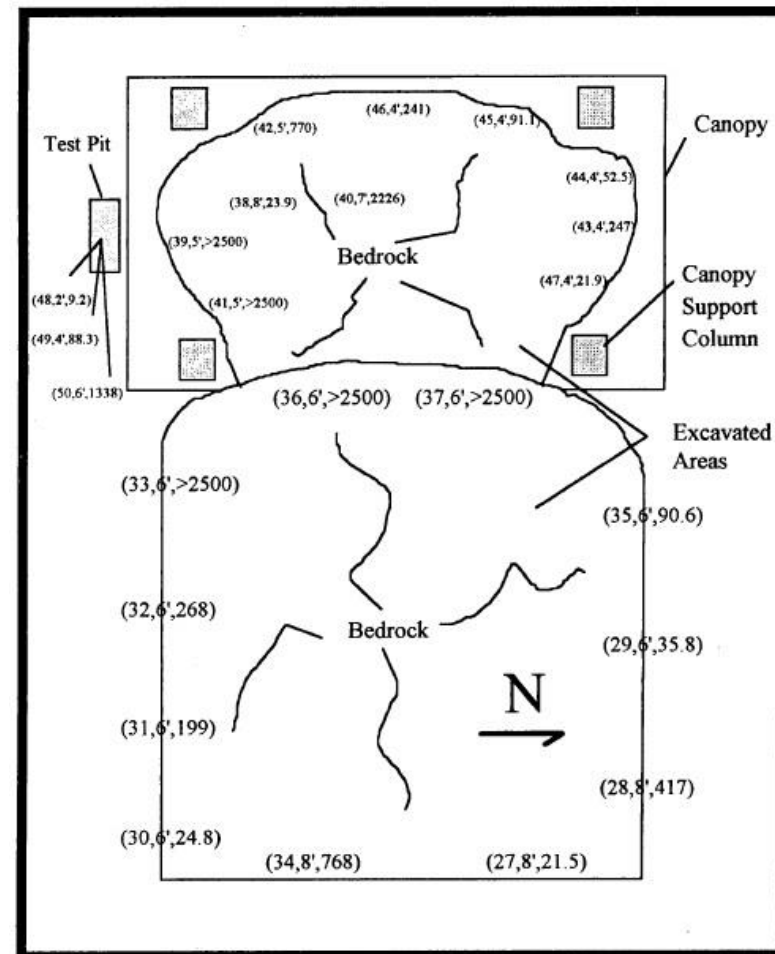


(Sample #, Depth (ft), PID Result (ppm))

Figure 4 - Sample Location Diagram (sides and bottom of final excavated area)
 Belfast Texaco, Belfast, Maine
 Acadia Environmental Technology
 (not to scale)

6.2.4.2 Maritime, 262 Main Street

UST Site Assessment, March 16, 2007, prepared by EnviroInvestigation & Remediation, Inc.

The report documents the soil and tank conditions during the removal of a three USTs: one 6,000-gallon regular unleaded gasoline; 6,000-gallon plus unleaded gasoline; and a 4,000-gallon premium unleaded gasoline. During the UST removal, a variety of issues including but not limited to poor installation practices, were uncovered that constituted evidence of a release. Free phase petroleum was encountered on the groundwater table and 21 soil samples screened for VOCs using a PID exceeded the cleanup goal of 1,000 ppm. Approximately 350 tons of petroleum-impacted soil was transported to Thibodeau's batch plant and 83,422 gallons of petroleum-impacted groundwater was pumped into a tank for treatment.

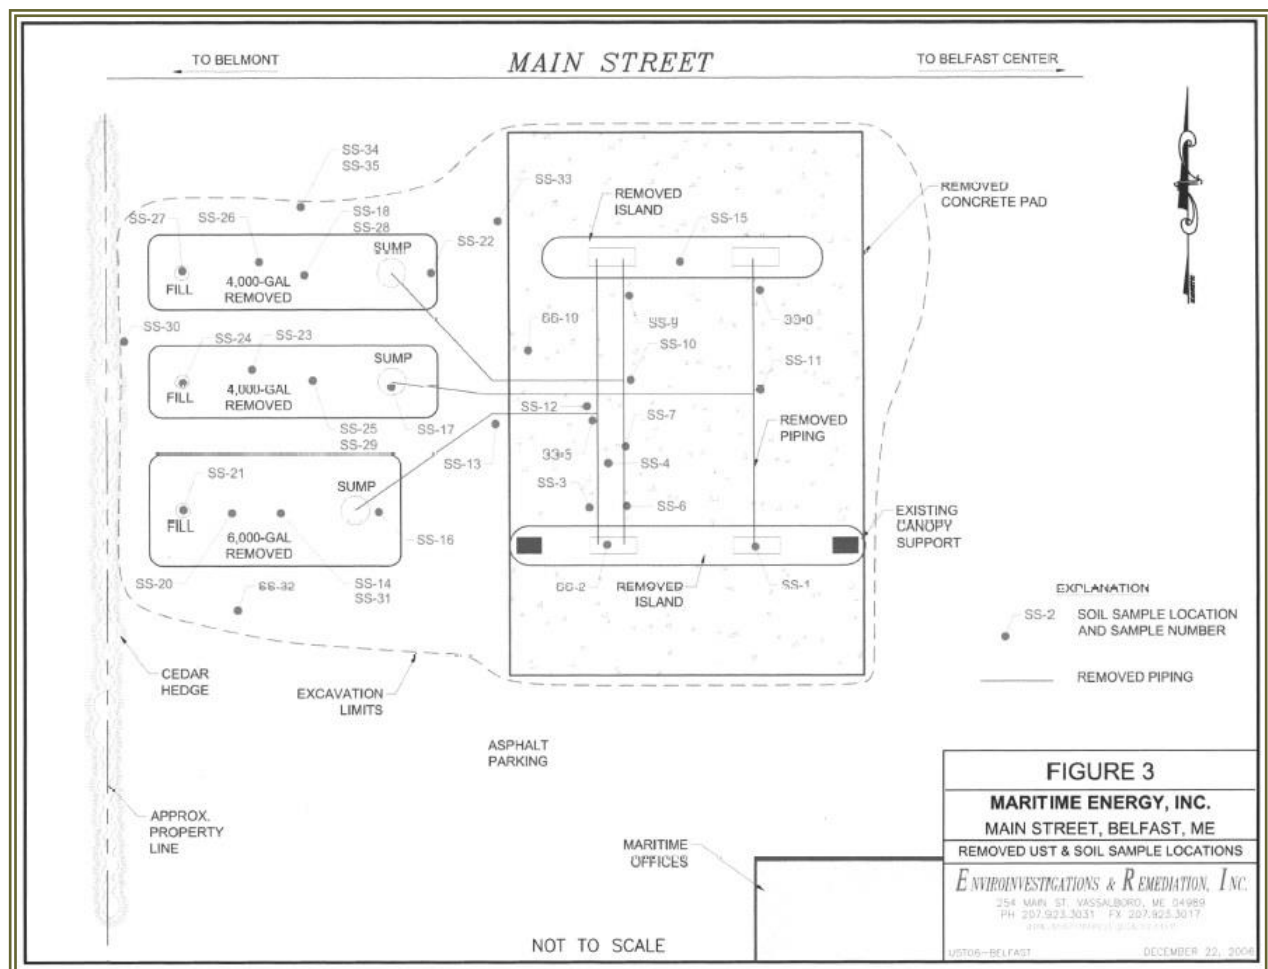

6.2.4.3 CN Brown/Big Apple, 268 Main Street, Tax Map 12, Lot 40

Several spill reports were generated during the operation of the CN Brown/Big Apple service station during its operations. CEG was not able to readily obtain the UST registration #15227 file for this site. Conversations with Christopher Smith, of the MEDEP file room, indicated the file was not readily ascertainable.

6.2.4.4 Merrill's Power Wash, 26 Starrett Drive, Tax Map 12, Lot 40A

Ransom Phase I ESA, by Ransom Consulting, dated September 30, 2013

Based on the information obtained through the Phase I ESA, Ransom identified one recognized environmental condition (REC) in connection with the Site; soil and/or groundwater conditions on the northeastern portion of the site may have historically been impacted by low-level petroleum contamination associated with the bulk fuel ASTs formerly located on the adjoining C.N. Brown property. However, considering the remediation efforts implemented at the former C.N. Brown property, and that no additional remediation was required, it was Ransom's opinion that low-level residual contamination on the site property, which may be present as a result of this adjacent property, would not be the subject of local, State, or Federal regulatory enforcement action. Therefore, no further assessment or investigation relative to the REC was recommended.

6.2.4.5 Nickerson's Exxon and Boyton's Bulk Plant, 25 & 29 Belmont Avenue

Former Nickerson's Exxon is approximately 0.33 mile west of the Subject Property and the Boynton Bulk Plant is adjacent to the former Exxon's northern boundary.

The following are select excerpts of the Ransom Consulting, Inc. Phase I ESA, dated June 27, 2018:

The Exxon site was identified under UST Registration Number 2053 and previously operated three registered USTs, which were removed from the site in 2002. The USTs included one 6,000-gallon unleaded gasoline tank, one 4,000-gallon unleaded gasoline tank, and one 4,000-gallon premium unleaded gasoline tank. According to EDR LUST database listing, spill numbers A-576-2002 and A-232-1998 are associated with the former USTs at the site.

Spill Report A-232-1998 was issued in response to a site assessment conducted by Timson & Peters, Inc. in April 1998, which identified gasoline and diesel fuel contamination in soils at the site. The MEDEP Spill Report concluded that the on-site USTs were not actively leaking, and that diesel fuel contamination may be attributable to releases from the neighboring Boynton Bulk Fuel Facility. A Baseline-2 cleanup standard was assigned by the MEDEP, and although one of the soil samples collected exceeded the cleanup standard, the MEDEP indicated no remediation was necessary.

A Spill Report A-576-2002 was issued in response to petroleum contamination that was identified at the site at the time of the UST removal in 2002. The UST removal and site assessment activities were documented in a report prepared by Michael J. White, C.G., dated October 15, 2002. The MEDEP did not require soil removal or other remediation activities; however, the MEDEP informed the new property

owner that any new building construction should avoid the construction of a full basement to reduce the potential for vapor intrusion issues.



6.2.4.6 Boynton Bulk Plant, 29 Belmont Avenue

Several hazardous and oil spills were identified in connection with the northern adjoining former Boynton Oil Company/Bulk Fuel Facility. The following paragraphs summarize the associated MEDEP Spill Reports. A Spill Report A-471-1990 documents a fuel release and response activities associated with an above-ground bulk fuel tank at the Boynton property. On September 18, 1990, an estimated 3,200 gallons of No. 2 fuel oil was released to the ground surface of the property, due to a corroded valve that broke-off of the AST system. The ASTs were not equipped with secondary containment at the time. The fuel saturated the ground to the east of the ASTs and entered the wetland area bordering this property to the east. At the time that the MEDEP responded, a $\frac{3}{4}$ -inch layer of petroleum product had spread across the entire water body. Sorbent booms were used to confine the petroleum product to a small area of the water body and a vacuum truck was used to recover liquid-phase product. A total of 2,340 gallons of product was reportedly recovered using the vacuum truck and sorbent pads. On September 26, 1990, 140 cubic yards of petroleum-contaminated soil was excavated from the property and transported off-site for disposal. The MEDEP recommended that Boynton Oil develop a spill control plan and provide secondary containment for their bulk product tanks.

In October 2002, MEDEP response personnel stopped by the Boynton Bulk Fuel Facility, as they were passing through town. During the visit, the MEDEP responder noted that fuel was leaking from several of the valves associated with the AST system(s). The MEDEP issued Spill Number A-615-2002. The facility operator, Mr. John Boynton, was notified, and responded to the property to tighten the leaking valves. The leaking fuel product was contained within the secondary containment structure and was not anticipated to have impacted soil conditions. A soil quality investigation of the Boynton Bulk Fuel Facility was performed by Acadia Environmental Technology (Acadia), at the request of the property owner, Mr. John Boynton. Evidence of petroleum contamination in soil prompted notification to the MEDEP, who issued Spill Number A-352-2006. The MEDEP responded and set a cleanup goal of 400 ppm in soil by field screening techniques. Although several areas were identified where contaminant concentrations in soil exceeded the cleanup goal, soil removal was not required by the MEDEP based on local topography and expected future land use. The MEDEP specified that contaminated soils would need to be removed if disturbed by future construction activities.

Findings from the previous Phase II ESA (Ransom 2012) suggested minimal impacts to the environmental condition of the site as a result of operations and/or releases associated with the former Boynton Oil bulk fuel plant. The Boynton Oil property has been vacant and unused since the time of the Phase II ESA, and, therefore, is not expected to have contributed any additional contaminants to the site, beyond what was detected during the previous Phase II ESA.

The site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the site was vacated in 1998. The former site building was located on the northwestern portion of the site, and included two vehicle bays used for automobile repair. Previous environmental reports reviewed during this assessment identified a hydraulic automobile hoist and a floor drain in the vehicle bays of the former site building. The floor drain was reportedly sealed when the site transitioned from a private, on-site septic system to the municipal sewer system in the mid-1970s.

According to previous property owners interviewed during the assessment, the site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon UST installed in 1956, which were used for the storage of gasoline. The USTs were located to the southeast of the former site building.

The original USTs were replaced in 1984 with three registered USTs (Registration # 2053), which were also used for the storage of gasoline. The registered USTs were reportedly installed in the same area as the original generation of USTs and consisted of one 6,000-gallon UST and two 4,000-gallon USTs. According to the previous property owners and State records, diesel fuel was never stored or dispensed at the site. Waste oil generated during automotive repair activities was reportedly stored in an AST on the northern side of the former building, and was periodically collected for off-site disposal. The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003.

Based on the findings of the assessment, Ransom concluded that historic site operations had adversely impacted soil conditions at the site.

6.2.4.7 Wale Park, 40 Main Street, Phase I and Phase II ESAs by Ransom Consultants, dated November 26, 2012 and March 20, 2013, respectively

The approximately 0.15-acre Brownfield site is approximately 0.31 miles east of the Subject Property. The Site was developed from circa 1917 to circa 1931 for unspecified commercial/retail use. The property was redeveloped circa 1931 as a gasoline filling station and automobile repair facility, with the former Site building located in the northeast portion of the Site, along Cross Street. The facility operated continuously as a filling station and auto repair facility until 1980, at which time three petroleum USTs were removed from the Site. The property continued to operate as a small engine repair shop until 2005, at which time the property was sold. The Site building was operated as a café/coffee shop from 2005 to 2007 and was demolished in 2008; the Site is currently vacant and is utilized as a park and miscellaneous temporary outdoor events.

According to the available information, the 1980 tank removal included the excavation of one 2,000-gallon, and two 550-gallon petroleum USTs. These tanks were not registered with MEDEP, and Ransom did not identify documentation of environmental conditions in connection with their removal. The respective contents of the three former tanks are not known; however, it is presumed that the 2,000-gallon UST contained gasoline, and the two smaller tanks also contained petroleum, perhaps gasoline or waste oil that was generated during automotive repair activities. Reportedly, the former repair facility also had two in-ground hydraulic lifts; one located inside the building, and one outside, off the southerly corner of the former building.

A previous soil and groundwater investigation was performed in 1995 by others in support of a potential property transaction. Based on both field screening and laboratory analytical results, the highest concentrations of residual petroleum contamination appeared to be in soil samples collected from the area of the two former 550-gallon petroleum USTs, located along the front (northwest) side of the former Site building. Residual petroleum contamination was also detected at lower concentrations in soil samples collected from the area of the former 2,000-gallon petroleum UST, located along the rear side of the Site building and the areas of two in-ground hydraulic lifts.

In addition to petroleum constituents, laboratory analysis of soil samples collected in 1995 also detected low levels of acetone, and 1,2-DCE, both common automotive solvents/degreasers. A single groundwater sample was collected from the area of the tank excavation along the rear of the building, which also exhibited low concentrations of dissolved petroleum, acetone, and 1,2-DCE. The investigation did not include testing for PCBs, potentially associated with the in-ground lifts, nor metals, which are another common environmental contaminant at automotive facilities. The Site was determined to be a Baseline-2 site under the MEDEP Decision Tree, and based on the prevailing environmental standards, did not require MEDEP notification or remediation at that time. The 1990 subsurface investigation also noted that bedrock is shallow at the Site, ranging from at or near surface grade at the westerly property corner, sloping down to approximately 10 feet below grade near the easterly property corner.

A Phase I ESA was also prepared for the Site in 2003, on behalf of a prospective purchaser. The ESA concluded that there was evidence that petroleum products and hazardous substances had been released into the subsurface soils at the Site, and recommended that the contamination be reported to MEDEP. Much of the findings, recommendations, and conclusions of the 2003 Phase I ESA report were based on the 1995 subsurface investigation.

In 2013, Ransom completed Phase I and II ESAs at the Site on behalf of the owner under the City of Belfast's Brownfields assessment program. Findings from these investigations identified contaminants associated with historical petroleum storage and automotive repair operations at the property. Various petroleum-related compounds, PAHs, and metals (specifically arsenic and lead) were detected in the soil and groundwater at the Site. Based on a comparison to current MEDEP guidelines, Ransom concluded that lead and arsenic (metals) were detected in soils at concentrations that exceeded their current MEDEP RAGs for "Park User", "Outdoor Commercial Worker" and/or "Excavation/Construction Worker" exposure scenarios. These detections were observed in background soil samples, which were collected from an area not anticipated to be impacted by historic Site operations. The presence of these elevated concentrations of lead and arsenic do not appear to represent naturally occurring but are likely representative of anthropogenic fill-impacted soils observed at the Site.

During the 2013 investigations, petroleum-related compounds were also identified in groundwater at the Site at concentrations that exceeded their respective MEDEP RAGs for "Construction Worker" exposure. Petroleum-related and chlorinated VOCs were also detected in the soil vapor samples collected from the Site. The concentrations of soil vapor contaminants present at the eastern portion of the Site exceeded their current and proposed Soil Gas Targets for residential use but did not exceed their current or proposed Soil Gas Target for commercial use.

Furthermore, properties identified on federal and state environmental databases in the Site vicinity are not anticipated to have impacted environmental conditions at the Site. This conclusion is based upon information provided by the MEDEP and results of Brownfields-funded assessments conducted at the Site and vicinity, which indicated that OHS releases at these properties have been properly investigated and/or remediated with prior U.S. EPA and MEDEP oversight/guidance or reported OHS releases at the properties are located at distances that are unlikely to have adversely impacted the Site.

The assessment has revealed no evidence of RECs in connection with the Site, except for the known and previously identified soil, groundwater, and soil vapor contamination at the Site at concentrations above their respective MEDEP exposure guidelines. Based on the findings of this assessment, it is Ransom's opinion that historical Site operations have adversely impacted environmental conditions at the Site. It is also Ransom's opinion that environmental remediation and/or mitigation activities are warranted during Belfast Gardens, LLC's proposed redevelopment to address the above-stated REC (please refer to the following section for our recommendations).

6.3 Vapor Encroachment Screening (VES)

CEG conducted a modified VES in general accordance with the ASTM E2600-22 *Standard Guide for Vapor Encroachment Screening (VES) on Property Involved in Real Estate Transactions*. The objective of the VES is to conduct an initial screening to determine whether current or historical practices associated with the site or nearby properties have the potential to have created a Vapor Encroachment Condition (VEC). CEG implemented Tier 1 screening of the Subject Property utilizing EDRs VEC App™ tool which integrates site data with various federal and state records and geological data. CEG input site data and presumed data such as groundwater flow direction and soil type. CEG used professional opinions to determine what sites were to be incorporated in the screening. CEG believes the historic and current service stations in the vicinity of the Subject Property warrants VEC likely exists. Potential gasoline in the groundwater migrating from other sites could pose a risk for vapor intrusion at the Subject Property.

6.4 Potential Contaminants of Concern

6.4.1 Per- and Polyfluorinated Substances (PFAS)

Sources of PFAS include, but are not limited to, aqueous film forming foam (AFFF) used in fire suppression and in the manufacturing of fire fighter clothing transforming to PFAS compounds. AFFFs have been incorporated into the fire suppression industry since the 1960's. CEG observed Universal Plus 3/6 AR-AFFF, which according to data reviewed, is considered a Class B AFFF. Class B AFFF are considered sources of PFAS. Other similar products may have been used prior to the current phase out of PFAS containing products.

The following is per the Interstate Technology Regulatory Council's (ITRC) *PFAS Technical & Regulatory Guidance Document*, dated June 2022: Class B firefighting foams are commercial surfactant solutions that are designed and used to combat flammable fuel fires. Class B AFFF have been (and continue to be) stored and used for fire suppression, fire training, and flammable vapor suppression at military installations and civilian facilities and airports, as well as at petroleum refineries and bulk storage facilities and chemical manufacturing plants. Additionally, local community fire departments have used and may maintain quantities of firefighting foam in their inventories for use in training and emergency response.

In terms of current usage and environmental considerations AFFF products can be divided into three categories: 1) legacy Perfluorooctane sulfonic acid (PFOS) AFFF; 2) legacy fluorotelomer AFFF; and 3) modern fluorotelomer AFFF.

- Legacy PFOS AFFF was manufactured in the United States from the late 1960s until 2002 exclusively by 3M and sold under the brand name "Light Water". Legacy PFOS AFFFs contain PFOS and perfluoroalkane sulfonates (PFSAs) such as perfluorohexane sulfonate (PFHxS). Although phased out of production in 2002, legacy PFOS AFFFs are the dominant source of PFAS at AFFF-impacted sites. Furthermore, because of its long shelf life, stock of legacy PFOS AFFF could exist at any given fire department today.

- Legacy fluorotelomer AFFF were manufactured and sold in the United States from the 1970s until 2016 and encompass all other brands of AFFF besides 3M Light Water or their licensed products. Although they are not made with Perfluorooctanoic Acid (PFOA), they contain polyfluorinated precursors that are known to degrade to PFCAs, including PFOA.
- Most foam manufacturers transitioned to short-chain (C6) fluorotelomer-based fluorosurfactants with the idea that these AFFFs would be less toxic.

Since the publication of the ITRC document, recent data does not support the hypothesis that short chain fluorosurfactants are less toxic. Actually, these mixtures have been determined to be equally toxic and commercial mixtures such as Gen-X (aka HFPO-DA) and ANSUL, are currently being regulated by EPA in drinking water using a hazard index.

6.4.2 Petroleum Substances from Off-site Sources

With the exception of the current outside propane aboveground storage tank and the inside 275-#2 fuel oil AST, the Subject Property has no history of having any other petroleum related product storage or dispensing. Other properties adjacent and across Main Street were historically service stations with documented releases. Petroleum, such as gasoline, is volatile and typically infiltrates vertically to the groundwater table and migrates laterally with the groundwater flow. Most petroleum substances are lighter than water and therefore remain in the vadose zone or the water table fluctuating with the seasonal rise and fall of the water table. Vapors from the volatile gasoline traverse through preferential pathways such as utility corridors usually comprised of more porous backfill material. These conditions could potentially become a source for vapor intrusion to a habitable building, particularly if a basement exists.

6.4.3 Hazardous Building Materials

The age of the museum building (1979) may result in the presence of hazardous building materials such as asbestos. On July 12, 1989, EPA issued a final rule banning most asbestos-containing products. Tax assessor information indicates the Fire Station was constructed in 1987. Fewer building materials are anticipated to be hazardous based on this construction date.

6.4.4 Nonpoint Source Pollution

The transfer of snow removal from various Belfast locations to the Subject Property is indicative of relocating nonpoint source pollution. Contaminants could potentially be associated with road salt, vehicle fluids, herbicides/pesticides, fertilizer, or other sources. Once the snow melts, these contaminants are deposited on the surface soil. Once on the ground surface, the contaminants are likely to migrate laterally topographically with stormwater runoff toward the east and west drainage swales. Some contaminants may also infiltrate to the subsurface and intersect the groundwater table. Contaminants that are less dense than water and those that dissolve more easily in water will migrate with the groundwater gradient. The parking lot in front of the Fire Station building may also contribute to nonpoint source pollution with potential impacts to the western drainage swale.

7.0 INTERVIEWS

7.1 Interviews with Owners, Site Manager, and Occupants

Information obtained during interviews with Fire Chief Richards, are referenced throughout the text of this report.

7.2 Interviews with Local Government Officials

Town officials contacted by CEG included: Steve Wilson, Code Enforcement Officer and Belfast Fire Chief Patrick Richards.

CEG contacted Megan Pinette, of the Belfast Historical Society, and Sharon Pietryka of the Belfast Library.

7.3 Considerations Beyond Phase I ESA Scope

ASTM defines a *business environmental risk (BER)* as a risk which can have a material environmental or environmentally-driven impact on the business associated with the current or planned use of *commercial real estate*, and is not necessarily an issue required to be investigated under ASTM 1527-21. A *BER* may include one or more of the non-scope items listed in **Table 11** below. Evaluation of non-scope items, are not required nor relevant for compliance with the AAI Rule or Practice E1527. Inclusion of the following non-scope items is entirely within the discretion of the *user* based on its own risk tolerance, and the particular requirements of a specific transaction.

Table 11 ASTM Out-of-Scope Items	
Out-of-scope Item	Data and mitigation, if any
Asbestos Containing Material (ACM)	No testing known
Radon	No testing known, buildings on slab
Lead-based Paint	No testing known
Wetlands	No NWI mapped wetlands on Subject Property
Endangered Species	None mapped by the IF &W Beginning with Habitat Map Viewer
Indoor Air Quality	No testing known
Mold	No testing known
Substances Not Defined as Hazardous	Storage of AFFF observed
Regulatory Compliance	Tank compliance not verified
NWI-National Wetlands Inventory, IF & W-Inland fisheries & Wildlife	

8.0 SENSITIVE RECEPTOR

Humans have the potential to be impacted by contaminants in the soil, sediments, groundwater, and air through dermal contact, ingestion, and inhalation. Soil and sediment contact may occur as a result of tracking surface contaminants, and handling excavated soils. There is also an ingestion pathway through eating with residual soils from hand to mouth transfer. Inhalation of contaminants could be the result of volatilization during soil disturbances and impacts to indoor air quality through vapor intrusion. Groundwater exposure may also occur through its use as a drinking water supply which is not known to be restricted at the Subject Property. Public water is currently servicing the Subject Property and there are no known plans to use groundwater for any purpose.

9.0 FINDINGS, OPINIONS, CONCLUSIONS, and RECOMMENDATIONS

9.1 Findings and Opinions

- Historical and current gasoline service stations within a 0.25-mile radius of the Subject Property include: the former Sunoco/Texaco on the western adjacent property and the former Exxon station further west of the Subject Property; and the former CN Brown/Big Apple and current Maritime station across Main Street to the south. Although MEDEP required cleanup at these locations residual gasoline impacts remained due to site constraints.
- It is likely historic storage and usage of PFAS containing fire surfactants occurred at the Subject Property prior to the phasing out of PFAS containing substances. At least one container of Class B AFFF was observed in the Fire Station. According to the National Environmental Management Academy, Class B AFFF most likely contains or transforms to PFAS. Knockdown, a Class A AFFF was also observed at the Belfast Fire Station, but Class A AFFFs are not considered to be precursors for PFAS contamination.
- The holes drilled through the concrete floor of the garage bay where the vehicles are stored and minor maintenance conducted is a conduit for residue to be discharged to the subsurface. According to Fire Chief Richards, the floor trench and floor drain discharge to the drainage ditch on the western side of the fire station.
- The area behind the Fire Station building has been utilized for snow storage and melt for many years. This practice has the potential of importing nonpoint source contaminants to the Subject Property and with the snow melt, could potentially impact soils, subsurface soils, groundwater, and surface water (drainage swales) at the Subject Property.
- The age of the buildings is relatively new (1979 and 1984) compared with known hazardous building materials that were common prior to 1978. However, if the building(s) are slated for demolition, certain hazardous materials should be tested and verified and removed if they exist.

9.2 Recognized Environmental Conditions (RECs)

We have performed a Phase I ESA in conformance with the scope and limitations of ASTM Practice E1527-21 on the Subject Property. Any exceptions to, or deletions from, this practice are described in Section 10 of this report. A recognized environmental condition (REC) is defined by ASTM as, *“the presence or likely presence of any hazardous substances or petroleum products in, on, or at a property: (1) due to release to the environment; (2) under conditions indicative of a release to the environment; or (3) under conditions that pose a material threat of a future release to the environment.”*

The following RECs have been identified by CEG through review of federal, state and local records, observations during the site reconnaissance, and interviews with knowledgeable persons.

- CEG has identified AFFF surfactants present at the facility potentially containing PFAS. Although no evidence of current releases of these AFFFs, the use of these surfactants in and outside the facility historically could pose a risk to human health and the environment.
- Residual petroleum from two former and one current gasoline station could pose a vapor encroachment condition and any future building especially constructed with a basement is susceptible to vapor intrusion without appropriate sampling or confirmatory data.
- The practice of stockpiling snow from nonpoint sources on-site creates a risk that contaminants may leached to the ground surface.
- Although the holes in the concrete slab assist with drainage issues, the holes are providing a conduit for any potential contaminants to discharge to the subsurface below the building's slab. Also, the floor drains discharging to the western drainage swale is a potential pathway for any contaminants on the floor to be released to the environment.

9.3 Conclusions & Recommendations

CEG recommends a Phase II ESA be conducted to confirm or dismiss the potential of contamination (the RECs listed above) that could impact human health and the environment.

Conditions and information not obtainable through this Phase I ESA process could potentially change this risk assessment and should be re-evaluated in the event other information becomes available.

10.0 DEVIATIONS AND DATA GAPS

Data failure occurs when all of the *standard historical sources* that are *reasonably ascertainable* and likely to be useful have been reviewed and yet the objectives have not been met. According to MEDEP the file for UST registration #15227 for the former Sunoco/Texaco service station at 281 Main Street was not available; however, spill reports A-253-1995 and A-293-2000 described the UST removal and clean up in 1995 and additional cleanup during the site redevelopment in 2000. CEG does not believe this data gap is significant enough to result in a REC.

11.0 ADDITIONAL SERVICES

No additional services related to this project have been contracted for between CEG and EMDC.

12.0 REFERENCES

Published referenced sources relied upon in the production of this Phase I ESA have been appropriately annotated within the text of this report. Additionally, the majority of referenced material has been included in the appendices of this report.

13.0 SIGNATURE AND QUALIFICATIONS

We declare that, to the best of our professional knowledge and belief, we meet the definition of Environmental Professional as defined in §312.10 of 40 CFR 312. We have the specific qualifications based on education, training, and experience to assess the nature, history, and setting of the Subject Properties. See the following resumes. CEG has performed the all-appropriate inquiries in conformance with the standards and practices set forth in 40 CFR Part 312.



Danica Kay
Senior Geologist



Richard Campbell
Maine Licensed Geologist
President

EDUCATION

MS, Geology, University of Idaho, 1987
BS, Geology, State University of New York at Stony Brook, 1982

PROFESSIONAL PROFILE

As a Maine and New Hampshire Certified Geologist and President of Campbell Environmental Group, Inc. (CEG), Richard Campbell supervises the CEG staff and aspects of work performed in Maine and New Hampshire. In particular, he is responsible for developing work scopes, schedules and budgets, and supervises fieldwork and document production. He interfaces with customers, legal representatives, and the regulatory community. Mr. Campbell also serves as a remediation specialist.

Working in the environmental industry since 1988, Mr. Campbell has professional experience in the fields of applied geology, hydrogeology, and computer applications. He has worked on projects that include environmental assessments, hydrogeologic investigations of hazardous waste and coal tar sites, and site remediations. His remediation experience includes a variety of *in-situ* and *ex-situ* techniques, which include pump and treat, liquid-phase product recovery, soil vapor extraction, air sparging, dual-phase extraction, and *in-situ* reductant metals treatment systems.

PROJECT EXPERIENCE

Androscoggin Valley Council of Governments Brownfield Program

Mr. Campbell is currently serving as the Project Manager for the Androscoggin Valley Council of Governments (AVCOG) Brownfield Program. As Project Manager, his responsibilities include supervision of fiscal requirements, ensuring the appropriateness of scientific and engineering services provided for each task, participating in public meetings, and community outreach. Mr. Campbell is instrumental in completing the Phase II work plans, directing the work, participating in key field activities, and reviewing all reports.

Maine Department of Environmental Protection Brownfields Grant Program

Mr. Campbell was the Program Manager for CEG's Maine Department of Environmental Protection (MEDEP) Brownfields contract. CEG conducted investigations or feasibility studies at seven MEDEP Brownfields sites. As Program Manager, Mr. Campbell's responsibilities included: supervision of fiscal requirements; supervision of three project managers; ensuring appropriateness and adequacy of the scientific and engineering services provided for each task; and providing day to day communications, both within the CEG project team and with the MEDEP relative to task matters, including status reporting, schedules, budgets, staffing, and technical issues.

City of Westbrook Petroleum Brownfields Program

Mr. Campbell managed Westbrook's Community Wide Petroleum Brownfields project which concluded in 2009. As Project Manager, he communicated with all stakeholders and was responsible for all aspects of the program. In particular he was responsible for managing the scope, schedule, and budget. He also served as the Maine Certified Geologist and was involved in all Phase II ESAs and reviewed all documents.

Investigation and Closure of a Textile Mill

Mr. Campbell is currently managing the investigation and RCRA closure of a multi-building former textile mill that had operated in southern Maine since the 1870's. The primary building is approximately 450,000 square feet in area and is located adjacent to the Mousam River. The buildings housed multiple transformers, mercury-filled equipment, numerous above-ground storage tanks, and hundreds of drums and other containers storing potentially hazardous materials. Wastes associated with this facility historically were discarded in floor drains and trenches that led to the environment. As a result, the site is impacted by a variety of contaminants including metals, volatile organics compounds, and semi-volatile organic compounds. The metals of concern are arsenic, chromium, and lead. CEG has recently completed the site characterization and is negotiating future tasks with the MEDEP.

Site Investigation and Remediation to Drinking Water Standards

Mr. Campbell managed projects at the only two known sites in Maine where the groundwater has been remediated to Maine Exposure Guidelines (MEGs) for drinking water using *in-situ* methods. One site involved the successful remediation of groundwater threatening the Oxford town water supply. The remedial methods employed at this site consisted of groundwater extraction and treatment and soil vapor extraction. In approximately three years, concentrations of gasoline in the groundwater were reduced from over 10,000 micrograms per liter ($\mu\text{g/L}$) to within the MEGs for drinking water. The site was closed from further regulatory involvement by the MEDEP and removed from their Top 10 priority list.

The second site involved the successful remediation of soil and groundwater threatening the Town of Standish southern Sebago Lake intake water supply. At this site, groundwater pump and treat, soil vapor extraction, and air sparging combined to eliminate liquid-phase petroleum from the site and remediate the groundwater to within the MEGs in less than two years. This site was also closed from further regulatory involvement and removed from the MEDEP's Top 10 priority list.

MEDEP-Site Closure Project

Since this project began in 1999, CEG has closed over 120 petroleum sites for the MEDEP. This project involves conducting interviews with MEDEP project managers, reviewing and organizing MEDEP files, evaluating site data to determine if closure criteria have been achieved, completing tasks to comply with the MEDEP's closure criteria, preparing reports and documents for each site, insuring the MEDEP's site database is accurate, and evaluating the MEDEP's closure process. The completion of this project, in June 2004, will result in closing approximately 50 additional petroleum sites and may result in potential changes to the MEDEP's petroleum closure policy. As part of this project, Mr. Campbell has supervised the preparation of a manual that details the closure procedures that CEG has implemented. CEG has participated in training MEDEP staff on implementing these closure procedures and the CEG manual has been distributed to MEDEP staff as a guideline for closing their own sites.

SPECIAL

QUALIFICATIONS

Health and Safety Training

OSHA 40-Hour Safety Training for Hazardous Waste Activities
OSHA 8-Hour Supervisor Training
OSHA 8-Hour Refresher Training (annual)
OSHA Confined Space Entry
US DOT Hazmat Transportation Training
American Red Cross First Aid and CPR
Lockout Tagout Training

Registrations and Certifications

Certified Geologist, Maine and New Hampshire
Certified Contractors Quality Control Manager, US Army Corps of Engineers

Publications

Conditions Affecting Soil Vapor Extraction Pilot Testing; Richard B. Campbell, Natalie Hudon, David Bass; proceedings and presentation for Third Conference of Lessons Learned in the Remediation of Petroleum-Contaminated Sites in Maine; Maine MEDEP; April 21, 1995.

Effects of Seasonal and Well Construction Variables on Soil Vapor Extraction Pilot Tests; Richard B. Campbell, Natalie Hudon, David Bass; proceedings for Superfund XVI Conference and Exhibition; November 6-8, 1995.

Combining Remedial Technologies for Rapid Containment Source Reduction; Richard B. Campbell, Stephen B. Schuchert, and Patricia O. Seaward; proceedings for Second Conference of Lessons Learned in the Remediation of Petroleum-Contaminated Sites in Maine; MEDEP; April 28, 1994.

Source Area Reduction and Downgradient Attenuation Approach to Bedrock Remediation; Patricia O. Seaward, Richard B. Campbell, Thomas E. Schwarm; proceedings for First Conference of Lessons Learned in the Remediation of Petroleum-Contaminated Sites in Maine; MEDEP; June 23, 1993.

Guidance Manual for Aboveground Soil Vapor Extraction of Gasoline Contaminated Soil; MEDEP; March 1992.

EDUCATION BS, Geology, Florida State University, 1987

**PROFESSIONAL
PROFILE**

As a senior geologist for Campbell Environmental Group, Inc., Ms. Kay manages projects that include preparing work plans, coordinating and supervising subcontractors, scheduling and performing field activities, evaluating data, and preparing budgets, invoices, graphics, and reports. Ms. Kay has professional experience in the fields of applied geology and hydrogeology. She has participated in various projects including Phase I and Phase II environmental site assessments, hydrogeologic investigations, and site remediation.

Ms. Kay has served as the site manager for the City of Westbrook Petroleum Community Wide Assessment Grant and Androscoggin valley council of governments (AVCOGs) Hazardous Substance Community Wide Assessment Grants. She has also supported the Hancock County Planning Commission (HCPC) Hazardous Substance Community Wide Assessment Grant, the Passamaquoddy Hazardous Substance Community Wide Assessment Grant, the 2008-2013 Passamaquoddy 128(a) Brownfields Grants, the 2010- 2013 Penobscot Indian Nation 128(a) Brownfields Grants, and the Southern Maine Planning and Development Commission's 2013 RLF Brownfield Grant. Ms. Kay was site manager for two sites under the 2004 MEDEP 128(a) State Assessment Grant, Rolnick property in Brewer and Industrial Box and Lumber in Parsonsfield. Her participation in these Brownfields programs ranged from preparing Phase I and Phase II ESA reports, SSQAPPs, HASPs, and Quarterly Report, conducting Phase II ESA field programs, preparing VRAP applications.

Ms. Kay began her career as an engineer technician for Sebago Technics, Inc. She acquired experience in various aspects of land development. Her responsibilities included the preparation of storm water management plans, Sediment and Erosion Control plans, and preliminary site plan designs. The projects ranged from small scale site plans to large scale subdivision plans. Ms. Kay is a former Licensed Site Evaluator with experience in the design of private and engineered community septic systems.

**PROJECT
EXPERIENCE**

Androscoggin Valley Council of Government (AVCOG) Hazardous Substance Assessment Brownfields Program

Ms. Kay was Project Manager for the 2007 AVCOG Brownfield Assessment grant. Responsibilities included preparing Phase I ESAs, preparation of workplans, site specific quality assurance project plans (SSQAPP), coordinating and scheduling Phase II ESA field activities, Phase II report preparation, invoicing, and budget tracking. The sites selected for investigation included a former shoe factory, former tannery, former printing press, and a burned down paint supply business. The assessments emphasized the identification of contamination sources and potential impacts to public health and the environment. Ms. Kay also prepared visual aid materials for public presentation of the Phase I results.

City of Westbrook Petroleum Brownfields Program

Ms. Kay served as the Project Manager for the City of Westbrook's Petroleum Brownfields Program. As Project Manager, her responsibilities include assisting in the preparation of federal reporting requirements, soliciting potential participants, supervising the completion of Phase I and Phase II ESAs, and tracking the budget of the project.

Industrial Box & Lumber, Parsonsfield (MEDEP Brownfields Program)

Responsibilities included: reviewing historical data, preparing a work plan to meet the site's objective, Quality Assurance Plan (QAPP), and Health & Safety Plan (HASP); implementing the work plan by using multiple subsurface techniques; conducting a potential hazardous waste inventory; evaluating the data; communicating with all parties involved, and preparing the final report summarizing the methods, results, conclusions, and recommendations.

Rolnick Property, Brewer (MEDEP Brownfields Program)

Responsibilities included: preparing a Phase I ESA, a work plan for a Phase II ESA, QAPP, HASP; coordinating and conducting field work associated with the subsurface investigation, evaluating the data, and preparing a final report that emphasized areas of concern and potential remedial alternatives.

**SPECIAL
QUALIFICATIONS**

Certifications

State of Maine Licensed Site Evaluator; No. S282, 1988-1992
OSHA 29 CFR 1910.120 40-Hour Safety Training
OSHA 8-Hour Supervisor Training
OSHA 8-Hour Refresher Training (annual)
US DOT Hazmat Transportation Training
Lockout Tagout Training
American Red Cross First Aid and CPR

Continuing Education

Seminar, Principles of Subsurface Contamination, Fate and Transport Modeling
National Water Well Association, 1992
University of Southern Maine, Groundwater Modeling, 1992
University of Southern Maine, Hydrology, 1991
Solutions Computer Center, Autocad Training, 1991
Cumberland County Soil & Water Conservation District, Soils, Sediment and Erosion
Control, Certification of Completion, 1989
Cumberland County Soil & Water Conservation District, TR-55, Certificate of Completion,
1989
University of Southern Maine, Soil Formation and Classification, 1988
Florida State University Graduate Course, Direct Individual Study in Hydrology, 1986

Conferences/Seminars

Regional Information Session: FY2006, 2008, 2012, and 2013 Grant Guidance for
Brownfields Assessment, Clean-up, and Revolving Load Fund Proposals
EPA National Brownfields Conference, Denver, CO, 2005
EPA National Brownfields Conference, St. Louis, MO, 2004

APPENDIX A
Figures

FIGURE 1
Topographic Locus Map
Belfast Fire Station
273 Main Street, Belfast, Maine


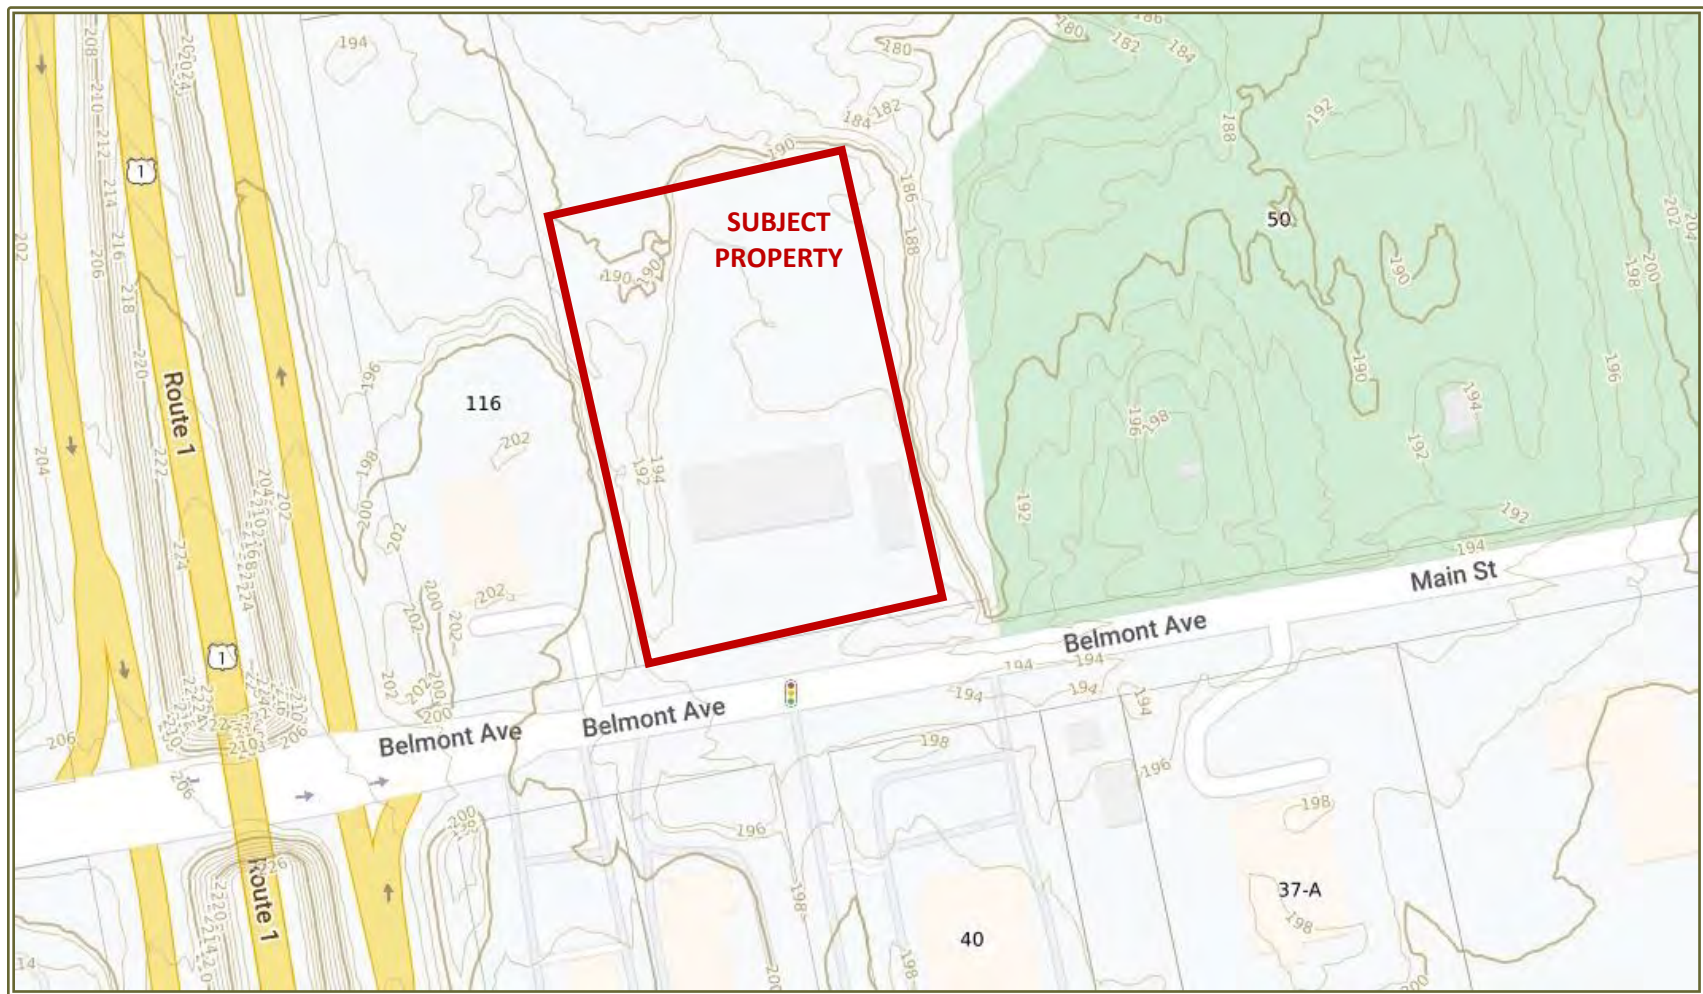


FIGURE 2
City of Belfast Tax Map 12
Belfast Fire Station
273 Main Street



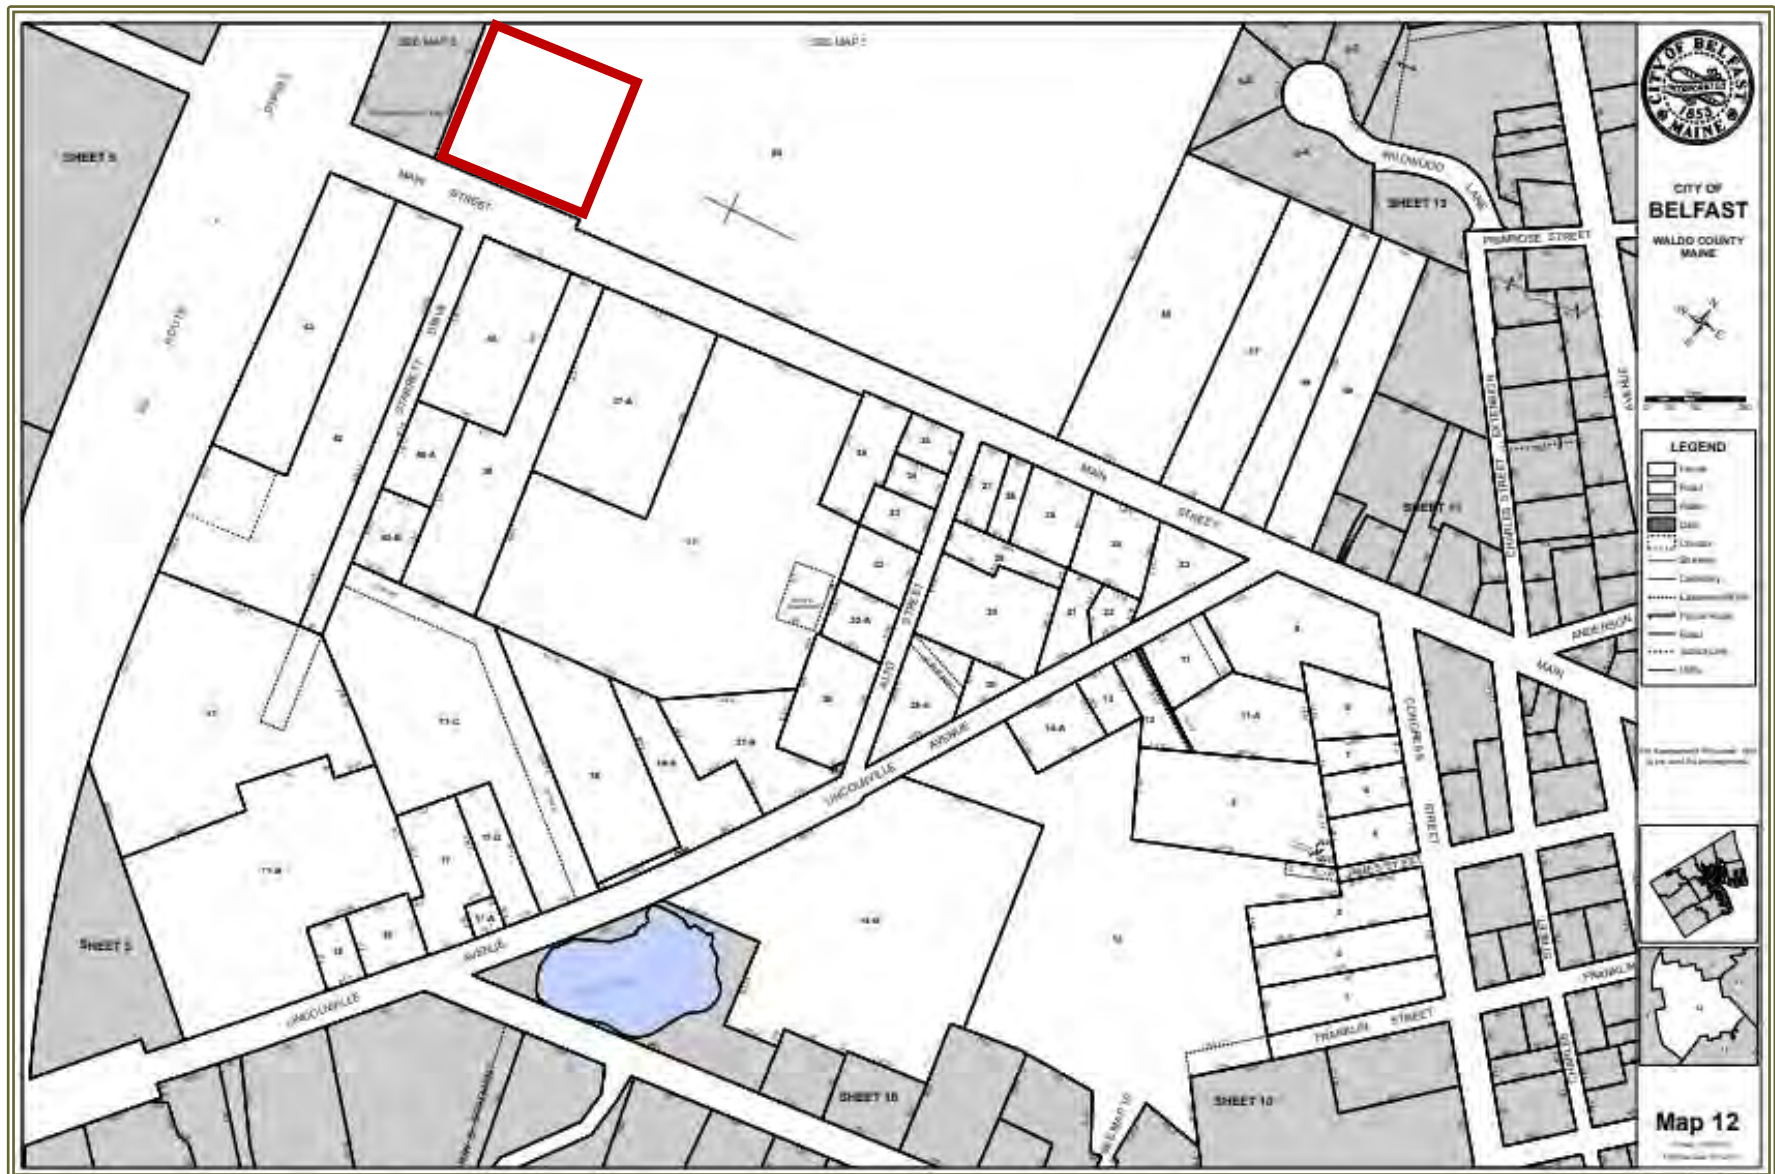

MEDEP Database

273 Main Street
Belfast, Maine



**Campbell
Environmental
Group**

173 Gray Road Falmouth, Maine 04105
(207) 253-1990

FIGURE 3

RCRA MQG	Spill Report	Air Emission Stack	Dry Cleaners
RCRA SQG	Underground Storage Tank	Ash Spreading	Public Drinking Water Supply Well
RCRA LQG	Aboveground Storage Tank	Sludge Spreading	EFIS Stormwater
VRAP Site	Industrial Facility	Pesticide Data	POTW Outfall
Remediation Site	M/S Landfill	Overboard Discharge	Pit/Mine
Uncontrolled Site	Transfer Station	Sand/Salt Storage	Bulk Fuel Storage

APPENDIX B
Questionnaires

Part A: Transaction Screen Questionnaire for Owner and Occupant (A separate questionnaire must be completed by the owner and each responding occupant of the subject property.)									
1	Description of the Subject Property and Adjoining Properties								
Description of Subject Property: Fire Station									
Subject Property Owner: City of Belfast									
Subject Property Address: 273 main st.									
Subject Property Parcel ID Number or Other Location Description:									
Subject Property Occupants, Percent Occupied, and Use: Fire Department. Fire / EMS apparatus and Personell									
Description of Adjoining Properties (provide observable address, occupant name, and use):									
North: Cemetery									
East: Cemetery									
South: —									
West: Auto zone									
2	Business Activities								
Have you observed or are you aware of any of the following business activities currently or in the past on either the subject property or an adjoining property:			On the Subject Property		On an Adjoining Property		Comment/Explain all "Yes" responses (Use a separate sheet for additional comment space. Include the Question # you are commenting on.)		
			Currently	In the Past	Currently	In the Past			
2.1	Gasoline/Diesel/Other Fuel Dispensing	Yes No	Yes No	Yes No	Yes No	Fuel station 25 yrs ago			
2.2	Vehicle, Motor/Engine, Fleet Repair, or Paint/Body Services	Yes No	Yes No	Yes No	Yes No				
2.3	Dry Cleaning (solvent-based or green cleaners)	Yes No	Yes No	Yes No	Yes No				
2.4	Printed Circuit Board/Semiconductor Manufacturing	Yes No	Yes No	Yes No	Yes No				
2.5	Metal Plating/Finishing	Yes No	Yes No	Yes No	Yes No				
2.6	Machine Shop	Yes No	Yes No	Yes No	Yes No				
2.7	Commercial Printing	Yes No	Yes No	Yes No	Yes No				
2.8	Manufacturing Activities	Yes No	Yes No	Yes No	Yes No				
2.9	Distribution/Transportation/Shipping	Yes No	Yes No	Yes No	Yes No				
2.10	Warehouse/Storage	Yes No	Yes No	Yes No	Yes No				
2.11	Photograph or X-ray Developing using wet methods (i.e., not digital)	Yes No	Yes No	Yes No	Yes No				
2.12	Junkyard, Salvage, or Metal/Electronics Recycling	Yes No	Yes No	Yes No	Yes No				
2.13	Landfill/Trash Dump	Yes No	Yes No	Yes No	Yes No				
2.14	Other Industrial and Commercial Activities	Yes No	Yes No	Yes No	Yes No	Fire station Auto parts sales Adjoining			
2.15	Agricultural Activities	Yes No	Yes No	Yes No	Yes No				
2.16	Forestland/Forestry	Yes No	Yes No	Yes No	Yes No				
2.17	Oil & Gas Extraction/Production, Refining Activities, or related Bulk Storage	Yes No	Yes No	Yes No	Yes No				

3		Wastes & Disposal	On the Subject Property		On an Adjoining Property		Comment/Explain all "Yes" responses (Use a separate sheet for additional comment space. Include the Question # you are commenting on.)
			Currently	In the Past	Currently	In the Past	
3.1	Waste Processing or Treatment		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	
3.2	Exterior Areas/Enclosures for waste storage other than trash dumpsters (e.g., fenced enclosures, sheds, storage bins/trailers, etc.)		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	
3.3	Interior Areas/Enclosures for waste storage (e.g., flammables cabinets, closets, maintenance workshops, etc.)		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		
3.4	Recycling of Used Materials (e.g., engine oil, cleaning solvents, coolants, metals, batteries [automotive or industrial], tires, etc.)		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	
3.5	Pits, Ponds, and Lagoons		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	
3.6	Sumps		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		
3.7	Oil-Water Separator or other Clarifiers		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	
3.8	Dismantled Vehicles, Equipment, or other Scrap Metal		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	
3.9	Landfill or Buried Materials		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	
3.10	Indiscriminate Dumping (i.e., open dumping)		Yes No ☒ ☐	Yes No ☒ ☐	Yes No ☒ ☐	Yes No ☒ ☐	SHOW Dump
3.11	Open Burning of Materials or Waste		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	
4		Storage Containers	On the Subject Property		On an Adjoining Property		Comment/Explain all "Yes" responses (Use a separate sheet for additional comment space. Include the Question # you are commenting on.)
			Currently	In the Past	Currently		
		Have you observed or are you aware of storage of chemicals of concern on the subject property currently or in the past in any of the following: • Individual containers of >5 gallons (19 L) in volume • A total of 55 gallons (200 L) or more • Compressed gas cylinders (Chemicals of concern includes chemicals, pesticides/herbicides, hazardous materials, hazardous waste, petroleum products [e.g., gasoline, oils, diesel, etc.], lubricants, [e.g., hydraulic fluid, oils, etc. including inside equipment])					
4.1	Drums (steel or plastic)		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		
4.2	Intermediate Bulk Containers/Large Totes		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		
4.3	Aboveground Storage Tanks		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		
4.4	Underground Storage Tanks		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		
4.5	Other Containers (compressed gas cylinders, totes, sacks, buckets, pails, bins, silos, etc.)		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		
4.6	Secondary Containment for Storage Containers and Equipment		Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		



8	Events		On the Subject Property		On an Adjoining Property		Comment/Explain all "Yes" responses (Use a separate sheet for additional comment space. Include the Question # you are commenting on.)
		Currently	In the Past	Currently	In the Past		
	Are you aware of any of the following events having occurred in association with the subject property currently or in the past:						
8.1	Leaks, spills, or unauthorized release from tanks, other containers, or equipment	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		
8.2	A natural disaster, weather event, or violent event that caused an unauthorized release	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		
8.3	Notifications of Environmental Violation (NOVs)	Yes No ☐ ☒	Yes No ☐ ☒				
8.4	Environmental site assessments which indicated the presence of chemicals of concern on, or contamination of, the subject property or recommended further assessment of the subject property?	Yes No ☐ ☒	Yes No ☐ ☒				
8.5	Past, threatened, or pending lawsuits or administrative proceedings concerning a release or threatened release of any chemicals of concern involving the subject property by any owner or occupant of the subject property?	Yes No ☐ ☒	Yes No ☐ ☒				
8.6	As the owner or occupant of the subject property, based on your knowledge and experience related to the subject property, is there any additional information known about the subject property, adjoining properties, or surrounding area which may indicate a potential environmental concern on the subject property?	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒	Yes No ☐ ☒		

END OF PART A (Sections 9 and 10 are only included on Part B questionnaire.)

11	Each Respondent's Contact Information and Signature	
The subject property owner responses were provided by:		
Owner Name and Title with respect to subject property: City of Belfast	Legal Name of subject property owner & Address: City of Belfast 131 Church St Belfast, ME 04915	Phone Number & Email Address: 338-3870 citymanager@cityofbelfast.org
Role(s) at the subject property: Fire/EMS Department	Number of years associated with the subject property: 40	Relationship to the user of this transaction screen:
Owner represents that to the best of the owner's knowledge the above statements and facts are true and correct and to the best of the owner's actual knowledge no material facts have been suppressed or misstated.		
Owner's Signature: 	Date completed: 03/28/2023	
The occupant responses were provided by:		
Occupant Name and Title with respect to subject property: Patrick Richards Fire chief	Occupant's Firm Name & Address: City of Belfast Fire Dept 131 Church St.	Phone Number & Email Address: 338-3362 firechief@cityofbelfast.org
Role(s) at the subject property: Fire/EMS Department	Number of years associated with the subject property: 25	Relationship to the user of this transaction screen:
Occupant represents that to the best of the occupant's knowledge the above statements and facts are true and correct and to the best of the occupant's actual knowledge no material facts have been suppressed or misstated.		
Occupant's Signature: 	Date completed: 3/23/23	
NOTE: The completed transaction screen questionnaire and copies of supporting government records reports and historical resources must be retained in the user's files and at such additional locations as the user and the preparer, if different from the user, may determine. Copies of the completed transaction screen questionnaire SHOULD NOT be transmitted to ASTM International, which has no role in collecting or reviewing completed transaction screen questionnaires.		

6.2 Part B—Preparer Environmental Questionnaire:

12

ASTM E 1528-22

Part B: Transaction Screen Questionnaire for Preparer

1	Description of Subject Property:
Subject Property Owner:	City of Belfast
Subject Property Address:	273 Main Street
Subject Property Parcel ID or Other Description:	Tax Map 12, Lot 50
Subject Property Occupant and Use:	Fire Station, Fire Department Museum, Snow Storage
Description of Adjoining Properties (provide observable address, occupant name and use):	
North:	Cemetery and High School
East:	Cemetery
South:	Shopping center and service station
West:	Former Gasoline Station current Autozone

2 Business Activity											
		Have you observed or are you aware of any of the following business activities currently or in the past on either the Subject Property or an adjoining property:	Subject Property				Adjoining Property				Comment: Explain all "Yes" responses (For additional comment space use a separate sheet, include the Question# you are responding to)
			Currently		In the past		Currently		In the past		
			Yes	No	Yes	No	Yes	No	Yes	No	
2.1	Gasoline, diesel, other fuel dispensing		☐	☒	☐	☒	☐	☒	☐	☒	
2.2	Vehicle Motor/Engine, fleet, repair or paint body service		☐	☒	☐	☒	☐	☒	☐	☒	
2.3	Dry Cleaning (solvent based)		☐	☒	☐	☒	☐	☒	☐	☒	
2.4	Printed circuit board/semiconductor Mfging		☐	☒	☐	☒	☐	☒	☐	☒	
2.5	Metal plating/finishing		☐	☒	☐	☒	☐	☒	☐	☒	
2.6	Machine Shop		☐	☒	☐	☒	☐	☒	☐	☒	
2.7	Commercial Printing		☐	☒	☐	☒	☐	☒	☐	☒	
2.8	Manufacturing Activities		☐	☒	☐	☒	☐	☒	☐	☒	
2.9	Distribution/transportation/shipping		☐	☒	☐	☒	☐	☒	☐	☒	
2.10	Warehouse/storage		☐	☒	☐	☒	☐	☒	☐	☒	
2.11	Photograph or X-radeveloping using wet methods		☐	☒	☐	☒	☐	☒	☐	☒	
2.12	Junkyard, salvage, or metal/electronics recycling		☐	☒	☐	☒	☐	☒	☐	☒	
2.13	Landfill/trash dump		☐	☒	☐	☒	☐	☒	☐	☒	
2.14	Other industrial/commercial activities		☐	☒	☐	☒	☐	☒	☐	☒	SP=Fire Station Current & historical gas stations
2.15	Agriculture activities		☐	☒	☐	☒	☐	☒	☐	☒	
2.16	Forestland/forestry		☐	☒	☐	☒	☐	☒	☐	☒	
2.17	Oil & gas extraction/production, refining or related bulk storage		☐	☒	☐	☒	☐	☒	☐	☒	

3 Wastes & Disposal											
		Subject Property				Adjoining Property					
		Currently		In the past		Currently		In the past			
Have you observed or are you aware of any of the following disposal practices or waste storage areas currently or in the past on either the Subject Property or an adjoining property?										Comment: Explain all "Yes" responses (For additional comment space use a separate sheet, include the Question# you are responding to)	
3.1	Waste processing or treatment	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒		
3.2	Exterior areas/enclosures for waste storage other than trash dumpsters (fenced enclosures, sheds, storage bins, trailers)	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒		
3.3	Interior areas/enclosures for waste storage (flammable cabinets, closets, maintenance workshops)	Yes ☒	No ☐	Yes ☐	No ☒	Yes ☐	No ☐				
3.4	Recycling of used materials(engine oil, cleaning solvents, coolants, metals, batteries, tires, etc)	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐		
3.5	Pits, ponds, lagoons	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐		
3.6	Sumps	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐			Drilled holes in concrete slab for drainage	
3.7	Oil/water separator or other clarifier	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐		
3.8	Dismantled vehicles, equipment, or other scrap metal	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒		
3.9	Landfill or buried materials	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐		
3.10	Indiscriminate dumping	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐	Storage of off-site snow and some materials along east side of building	
3.11	Open burning of materials or waste	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐		

4 Storage Containers															
		Have you observed or are you aware of chemicals of concern on the Subject Property currently or in the past in any of the following: • Individual containers of >5 gallons (19L) in volume • A total of 55-gallons (200L) or more • Compressed gas cylinders Chemicals of concern includes chemicals, pesticides/herbicides, hazardous materials, hazardous waste, petroleum products (e.g. gasoline, oils, diesel, etc., lubricants (e.g. hydraulic fluid, oils, etc. including inside equipment)												Comment: Explain all "Yes" responses (For additional comment space use a separate sheet, include the Question# you are responding to)	
						Subject Property				Adjoining Property					
						Currently		In the past		Currently					
	4.1	Drums (steel or plastic)		Yes ☒	No ☐	Yes ☐	No ☒	Yes ☐	No ☐				Temporary storage of solid waste		
	4.2	Intermediate bulk containers/large totes		Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐						
	4.3	Aboveground storage tanks		Yes ☒	No ☐	Yes ☐	No ☒	Yes ☐	No ☐						
	4.4	Underground storage tanks		Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐						
	4.5	Other containers (compressed gas cylinders, totes, sacks, buckets, pails, bins, silow, etc.)		Yes ☒	No ☐	Yes ☐	No ☒	Yes ☐	No ☐						
	4.6	Secondary containment for storage containers and equipment		Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☐						

5 Property Features							
Have you observed or are you aware of the following conditions or features on the Subject Property currently or in the past:		Subject Property					Comment: Explain all "Yes" responses (For additional comment space use a separate sheet, include the Question# you are responding to)
		Currently		In the past			
		Yes	No	Yes	No		
5.1	Exterior staining of soil or pavement as a result of a spill other than water	☐	☒	☐	☐		Not observed
5.2	Interior staining of floors, walls, or ceilings by substances other than water	☒	☐	☐	☐		
5.3	Imported fill material (includes fill that is from a contaminated property or an unknown source)	☐	☒	☐	☐		
5.4	Vent pipes, fill pipes, or accessways (includes a fill pipe protruding from the ground inside a building or adjacent to any structure)	☐	☒	☐	☒		
5.5	Foul odors associated with any drains, sinks, vents, building material, building surfaces, or exposed grounds	☐	☒	☐	☒		
5.6	Equipment lubricated with oil or hydraulic fluid (e.g. vehicle lifts, elevator shafts, air compressors)	☒	☐	☐	☒		
5.7	Equipment lubricated with heat transfer fluids or hydraulic fluid which may contain PCBs (e.g. transformers, capacitors, installed prior to 1980)	☐	☐	☐	☐		Unknown
5.8	Wastewater discharge (not including stormwater) onto or adjacent to the Subject Property into a sanitary sewer system	☒	☐	☐	☐		Floor drain and Floor trench Assume connected to sewer
5.9	Wastewater discharge (not including sanitary waste) onto or adjacent to the Subject Property into a stormwater system	☐	☒	☐	☐		
5.10	Wells (e.g. water wells, oil/gas wells, dry wells)	☐	☒	☐	☒		

6 Water Supply Systems					
	If the Subject Property is served by a public or municipal water system, private well, or non-public water system, are you aware of the following conditions on the Subject Property currently or in the past:		Subject Property Currently In the past		Comment: Explain all "Yes" responses (For additional comment space use a separate sheet, include the Question# you are responding to)
6.1	Is there evidence that contaminants have been identified in the private well or non-public water system that exceed guidelines applicable to the water system?		Yes ☐ No ☐ Yes ☐ No ☐		Public water
6.2	Has the municipal or public water system, private well or non-public water system supplying the Subject Property been designated as contaminated by any government environmental or health agency?		Yes ☐ No ☒ Yes ☐ No ☐		
7 Regulatory Documents					
	Are you aware of any of the following regulatory or legal documents issued to businesses on or to owners of the Subject Property currently or in the past:		Subject Property Currently In the past		Comment: Explain all "Yes" responses (For additional comment space use a separate sheet, include the Question# you are responding to)
7.1	Registrations/permits for storage tanks (AST or UST)		Yes ☐ No ☒ Yes ☐ No ☐		
7.2	Permits to store hazardous materials or hazardous waste		Yes ☐ No ☒ Yes ☐ No ☐		
7.3	Environmental liens		Yes ☐ No ☒ Yes ☐ No ☐		
7.4	Activity & Use Limitations		Yes ☐ No ☒ Yes ☐ No ☐		
7.5	Notification from a government agency relating to past or recurrent violations of environmental laws		Yes ☐ No ☒ Yes ☐ No ☐		

8 Events											
Are you aware of any of the following events having occurred in association with the Subject Property currently or in the past:		Subject Property Currently In the past				Adjoining Property Currently In the past				Comment: Explain all "Yes" responses (For additional comment space use a separate sheet, include the Question# you are responding to)	
8.1	Leaks, spills, or unauthorized release from tanks, other containers, or equipment	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☒	No ☐		
8.2	A natural disaster, weather event, or violent event that caused an unauthorized release	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒		
8.3	Notification of environmental violation (NOVs)	Yes ☐	No ☒	Yes ☐	No ☒						
8.4	Environmental site assessments which indicate the presence or chemicals of concern on or contamination of, the Subject Property or recommended further assessment of the Subject Property?	Yes ☐	No ☒	Yes ☐	No ☒						
8.5	Past, threatened, or pending lawsuits or administrative proceedings concerning a release or threatened release of any chemicals of concern involving the Subject Property by any owner or occupant of the Subject Property	Yes ☐	No ☒	Yes ☐	No ☒						
8.6	Based on your knowledge and experience related to the Subject Property, is there any additional information known about the Subject Property, adjoining properties, or surrounding area which may indicate a potential environmental concern on the Subject Property?	Yes ☒	No ☐	Yes ☐	No ☐	Past petroleum releases in SP vicinity		Yes ☐	No ☐	Yes ☐	No ☐

9 Government Records												
Do any of the following federal, state, or tribal government record systems list the Subject Property or any property within the approximate minimum search distance:		Approximate Maximum Search Distance (miles)	On the Subject Property		On an Adjoining Property		Further than an adjoining property but within the search radius		Comment: Explain all "Yes" responses (For additional comment space use a separate sheet, include the Question# you are responding to)			
9.1	Lists of Federal NPL (Superfund) sites	1.0	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐				
9.2	Lists of Federal Delisted NPL sites	0.5	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐				
9.3	Lists of Federal sites subject to CERCLA removals and CERCLA orders SEMS	0.5	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐				
9.4	Lists of Federal sites subject to CERCLA site with No further action planned (NFRAP) SEMS Archives	0.5	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☒	No ☐	Railroad			
9.5	Lists of Federal RCRA facilities undergoing Corective action CORRACTS	1.0	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐				
9.6	Lists of Federal RCRA TSD facilities	0.5	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒				
9.7	Lists of federal RCRA generators	SP & Adjacent	Yes ☐	No ☒	Yes ☐	No ☒						
9.8	Lists of Federal institutional control/engineering control sites	SP only	Yes ☐	No ☒								
9.9	Federal ERNS list	SP only	Yes ☐	No ☒								
9.10	Lists of state and tribal "Superfund" equivalent sites	1.0	Yes ☐	No ☒	Yes ☐	No ☐	Yes ☐	No ☐				
9.11	Lists of state and tribal hazardous waste facilities	0.5	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☒	No ☐	EM BEE Cleaners Stinson canning Belfast Moosehead RR			
9.12	Lists of state and tribal landfills and solid waste disposal facilities	0.5	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☐	No ☒				
9.13	Lists of stae and tribal leaking storage tanks	0.5	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☒	No ☐	Texaco/Autozone, Maritime, and CN Brown/Big Apple			
9.14	Lists of state and tribal registered storage tanks	SP & Adjacent	Yes ☐	No ☒	Yes ☐	No ☒						
9.15	Lists of state and tribal institutional control/engineering controlsites	SP only	Yes ☐	No ☒								
9.16	Lists of state and tribal voluntary cleanup sites	0.5	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☒	No ☐	Rite Aid, Exxon, Waterfall Arts, EM Bee Cleaners, Waldo jail, FSS, Inc.			
9.17	Lists of state and tribal brownfield sites	0.5	Yes ☐	No ☒	Yes ☐	No ☒	Yes ☒	No ☐	Merrill's Power Wash, Exxon 29 Belmont, Waterfall Arts, Waldo Jail, FSS, Inc.			

FOOTNOTE: for government records section 1) records should be researched for both current and formerly active sites; 2) Sites where following an initial investigation, no contamination was found, contamination was removed quickly without the need for the site to be placed on the NPL or the contamination was not serious enough to require federal Superfund action. This should not be interpreted as there being no contamination at he site or that other regulatory agencies such as at the state level have not required further action. Such sites may be found on other environmental record sources.

10 Historical Resources		
Based upon a review of fire insurance maps, local street directories, or aerial photographs, all as specified in the guide (8.10), are any buildings or other improvements on the Subject Property or on an adjoining property identified as having been used for an industrial use or other uses likely to lead to contamination of the Subject Property?		
10.1	List historical resource used: EDR	
10.2	List Historical resource used Aerial and Topo Maps	
10.3	List historical resource used Directories	
11 Each Respondent's Contact Information and Signature		
The preparer responses were provided by:		
Preparer responses and Title with respect to Subject Property: Danica Kay, Senior Geologist		Preparer's Firm's Name & Address: Campbell Environmental Group, Inc. 173 Gray Road, Falmouth, ME 04105 Preparers's Phone Number & Email Address: 207-253-1990 dkay@cegenvironmental.com
Preparer's Role(s) at the Subject Property: Qualified Environmental Professional		Number of years Preparer associated with Subject Property 0 Preparer's relationship to the User of this transaction screen: Consultant
Preparer represents that to the best of the preparer's knowledge the above statements and facts are true and correct and to the best of the preparer's actual knowledge no material facts have been suppressed or misstated.		
Preparer's Signature 		Date completed: 3/31/2023 Which portions of this questionnaire did this preparer complete? Part B
Copies of the completed questionnaire have been filed at:		Or copies of the completed questionnaire have been mailed to:
The User of this transaction screen: ☐		Check if user is the same as the preparer
User's Firm Name and Address (Optional) City of Belfast 131 Church Street Belfast, ME 04915		Phone Number & E-mail address: Office: 207-338-3370 Mobile: -
User's relationship to Subject Property:		
If the user is different from the preparer(s), the user shall sign Part B of the questionnaire affirming that the user has received both Parts A and B of the questionnaire. It is the User's responsibility to draw conclusions regarding affirmative or unknown answers.		
Users Signature (Optional)		Date completed:

APPENDIX C
EDR Sanborn Maps
City Directories
Historical Topographic Maps
Aerial Photographs



EMDC Belfast Fire Sta

273 Main Street

Belfast, ME 04915

Inquiry Number: 7273839.3

March 08, 2023

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

03/08/23

Site Name:

EMDC Belfast Fire Sta
273 Main Street
Belfast, ME 04915
EDR Inquiry # 7273839.3

Client Name:

Campbell Environmental Group
173 Gray Rd
Falmouth, ME 04105
Contact: Danica Kay



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by Campbell Environmental Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # 45EB-4907-B6D4
PO # 0123-427-00/301
Project EMDC Belfast Fire Station

Maps Provided:

1965
1948
1931
1923



Sanborn® Library search results

Certification #: 45EB-4907-B6D4

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- ☒ Library of Congress
- ☒ University Publications of America
- ☒ EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

Campbell Environmental Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT. Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2023 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1965 Source Sheets



Volume 1, Sheet 9
1965

1948 Source Sheets




Volume 1, Sheet 9
1948

1931 Source Sheets



Volume 1, Sheet 9
1931

1923 Source Sheets

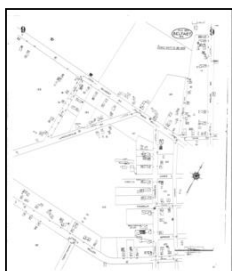


Volume 1, Sheet 9
1923

Site Name: EMDC Belfast Fire Sta
 Address: 273 Main Street
 City, ST, ZIP: Belfast, ME 04915
 Client: Campbell Environmental Group
 EDR Inquiry: 7273839.3
 Order Date: 03/08/2023
 Certification #: 45EB-4907-B6D4
 Copyright: 1965




The certified Sanborn Library search results in this report can be authenticated by visiting
 www.edr.com/sanborn and entering the certification number. Only Environmental
 Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of
 maps by The Sanborn Library LLC, the copyright holder for the collection.



Certification # 45EB-4907-B6D4

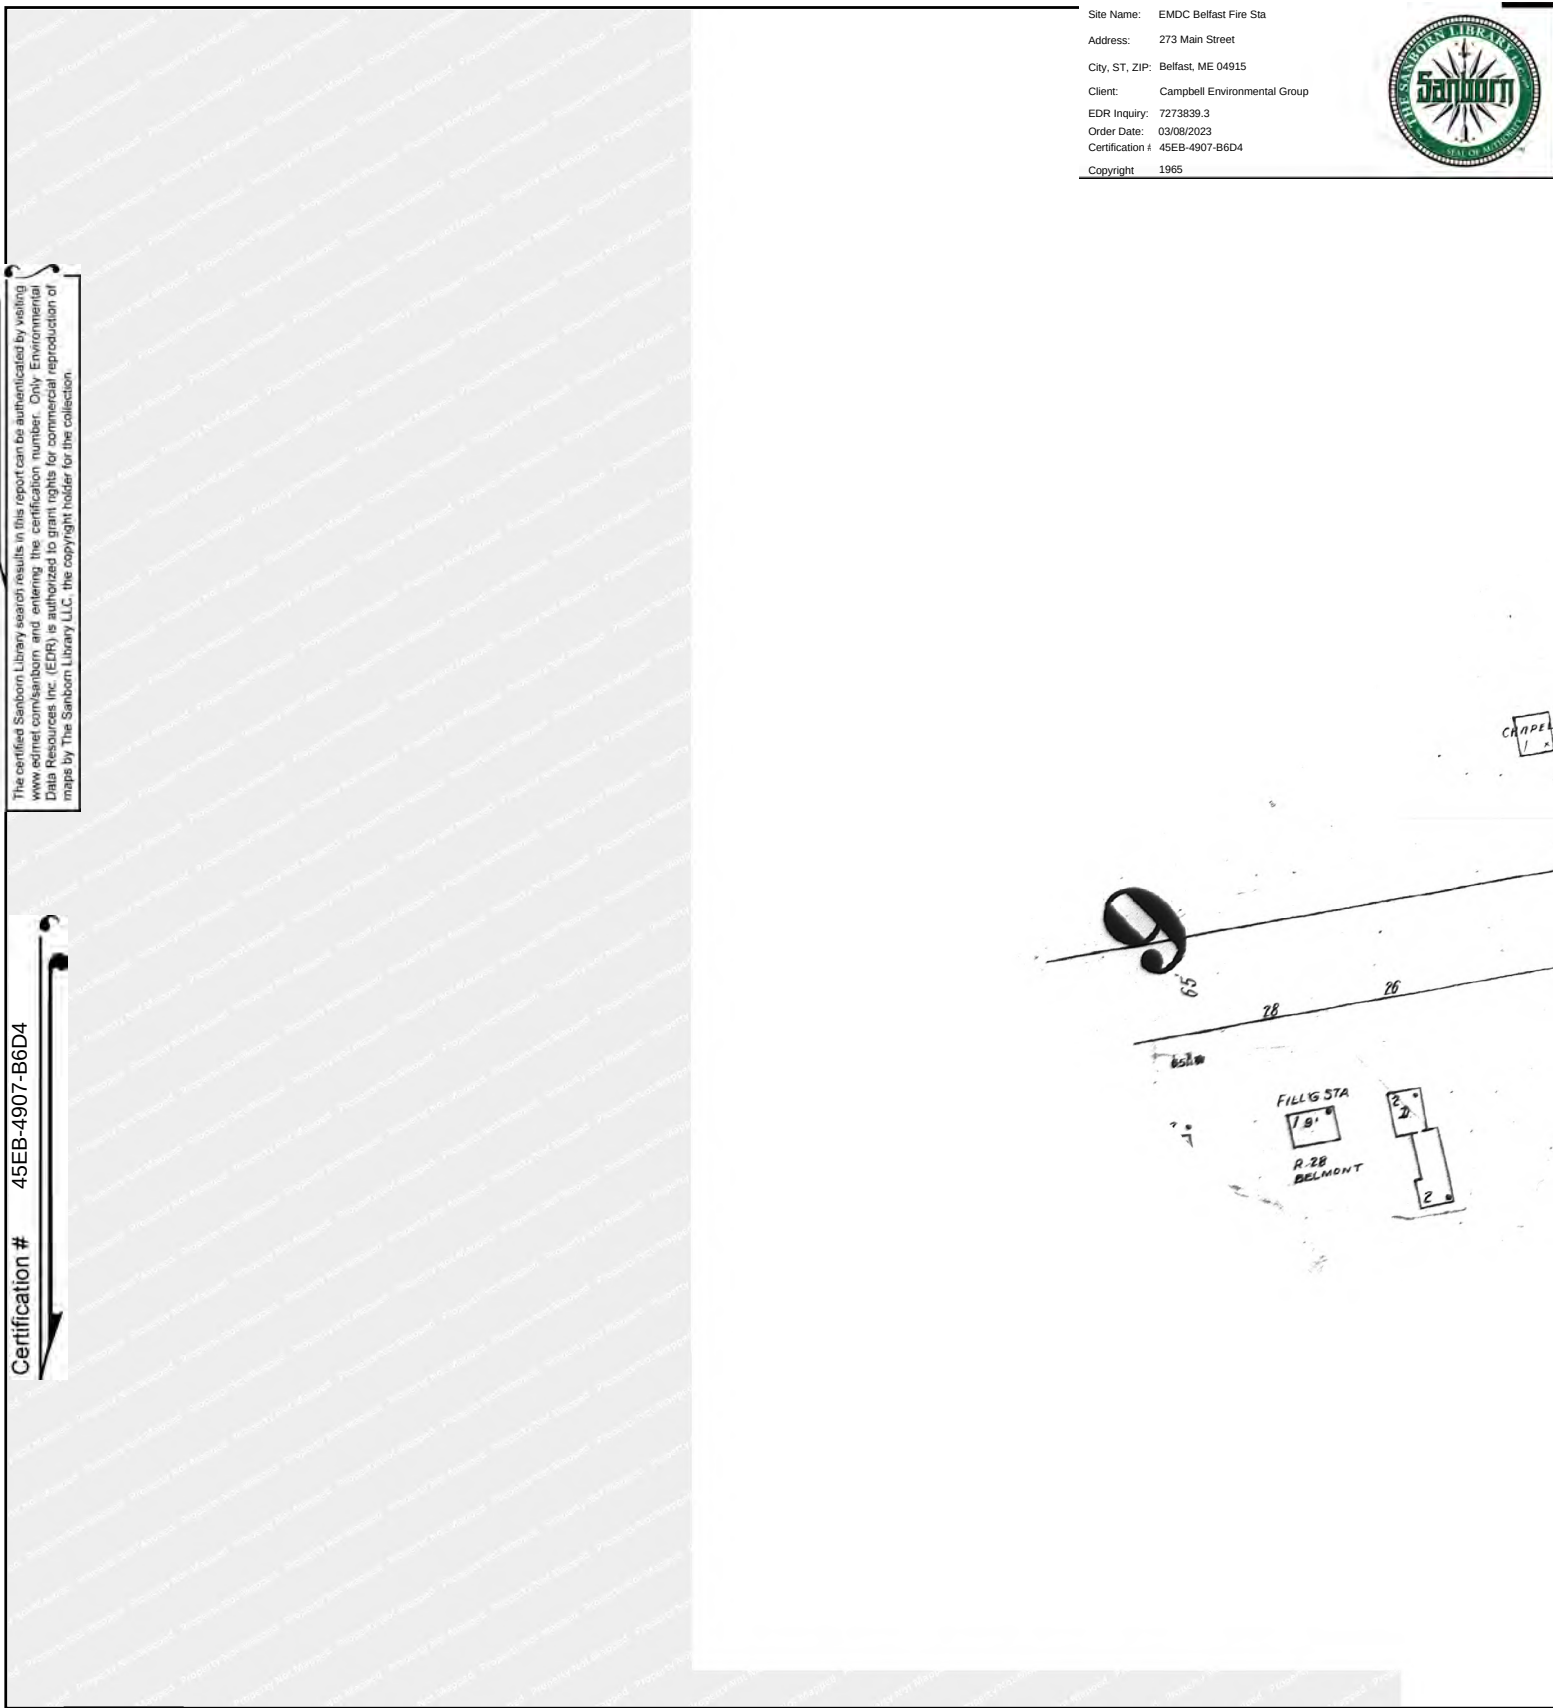

This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 1, Sheet 9

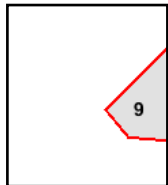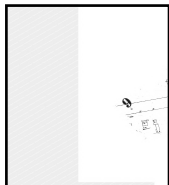


Site Name: EMDC Belfast Fire Sta
 Address: 273 Main Street
 City, ST, ZIP: Belfast, ME 04915
 Client: Campbell Environmental Group
 EDR Inquiry: 7273839.3
 Order Date: 03/08/2023
 Certification #: 45EB-4907-B6D4
 Copyright: 1948




The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.



Certification # 45EB-4907-B6D4

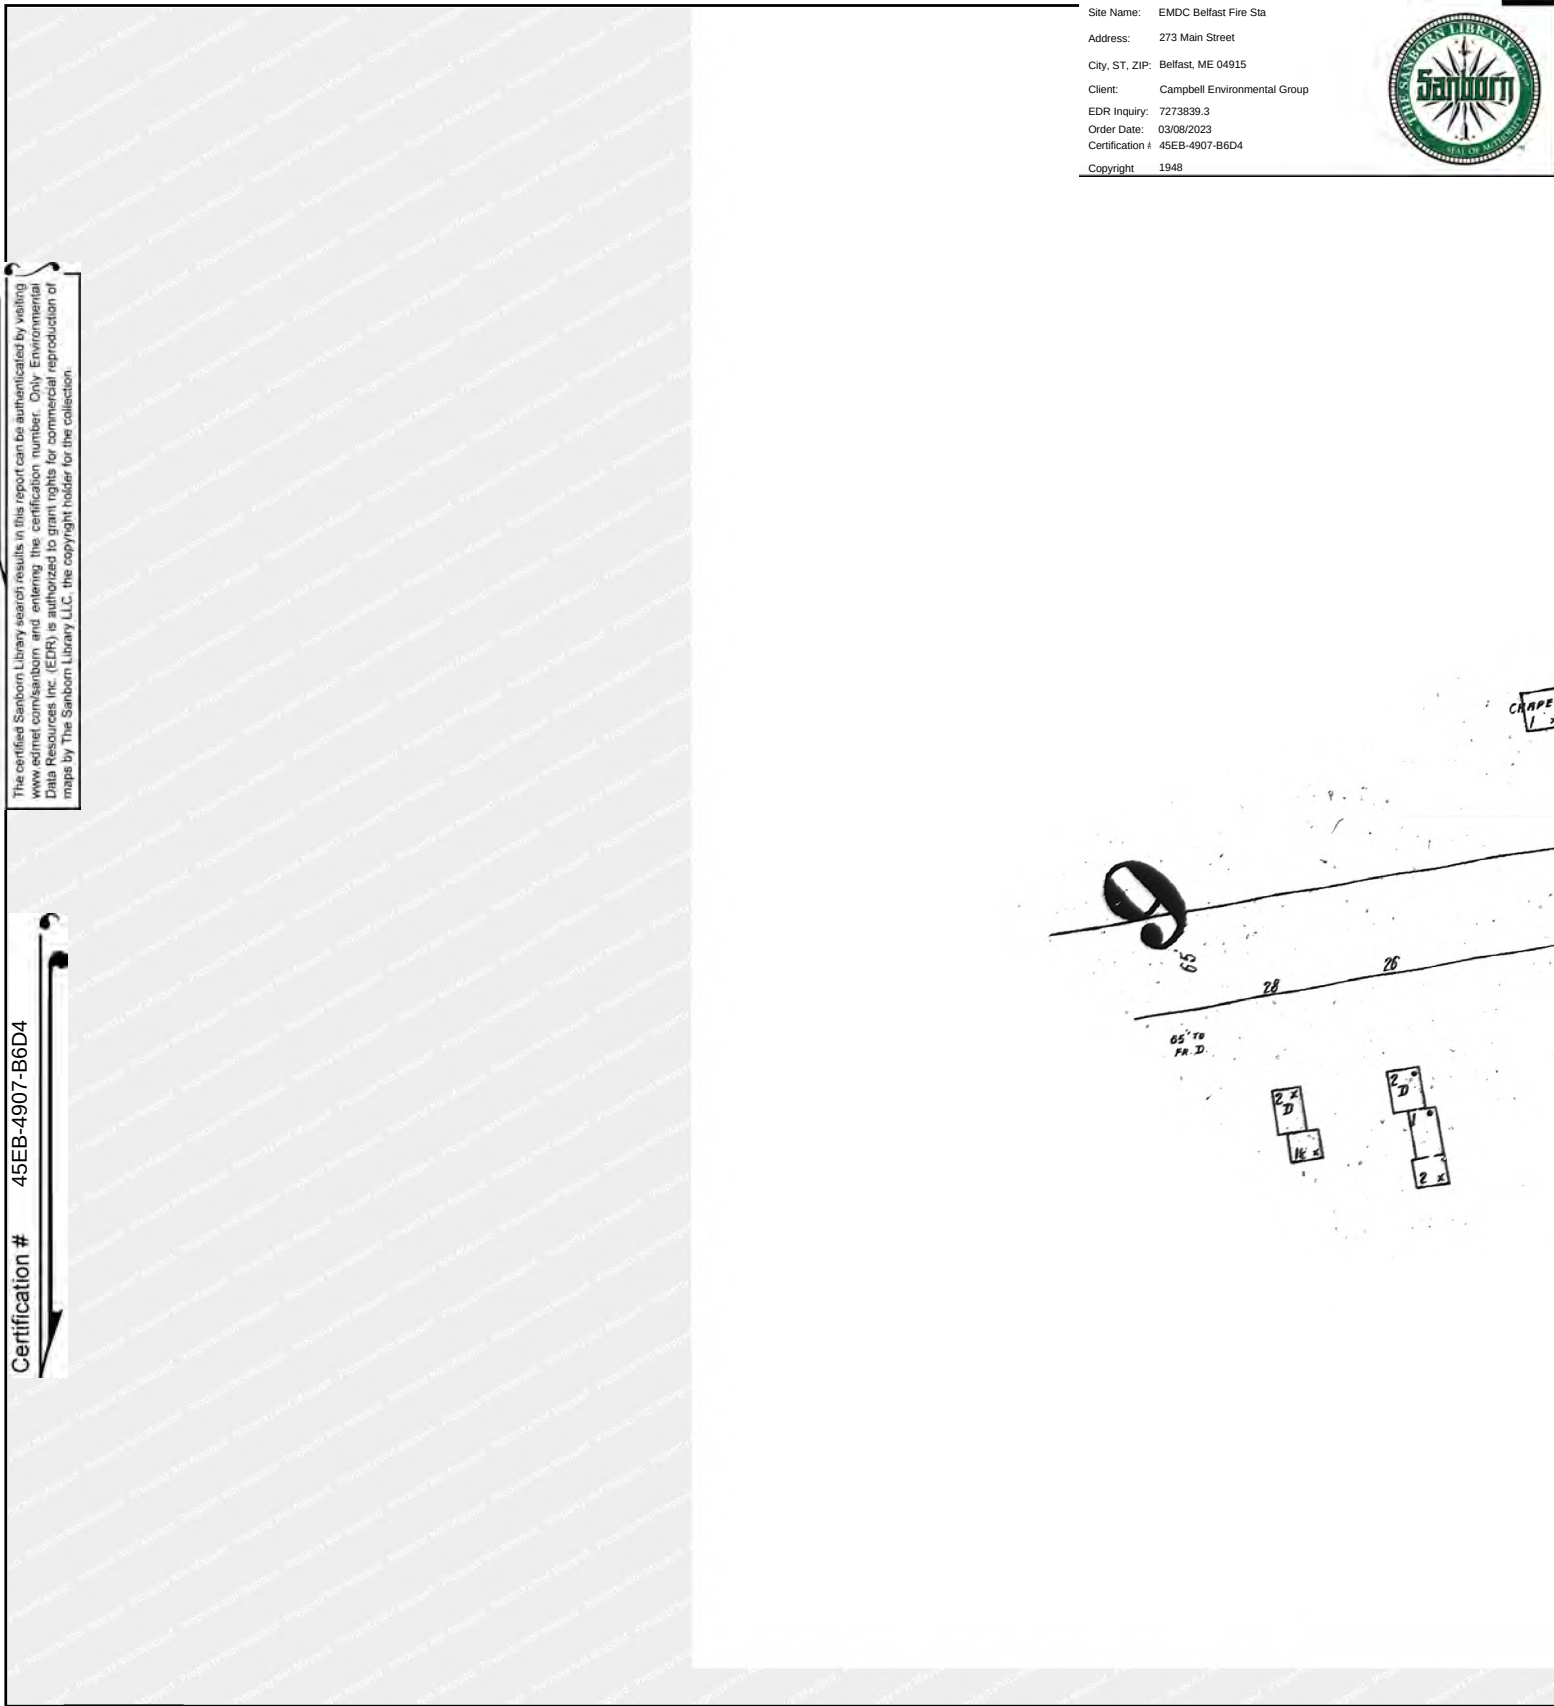

This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 1, Sheet 9

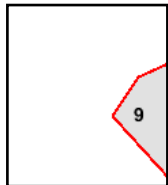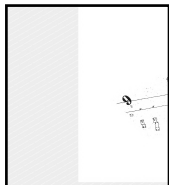


Site Name: EMDC Belfast Fire Sta
 Address: 273 Main Street
 City, ST, ZIP: Belfast, ME 04915
 Client: Campbell Environmental Group
 EDR Inquiry: 7273839.3
 Order Date: 03/08/2023
 Certification #: 45EB-4907-B6D4
 Copyright: 1931




The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.



Certification # 45EB-4907-B6D4

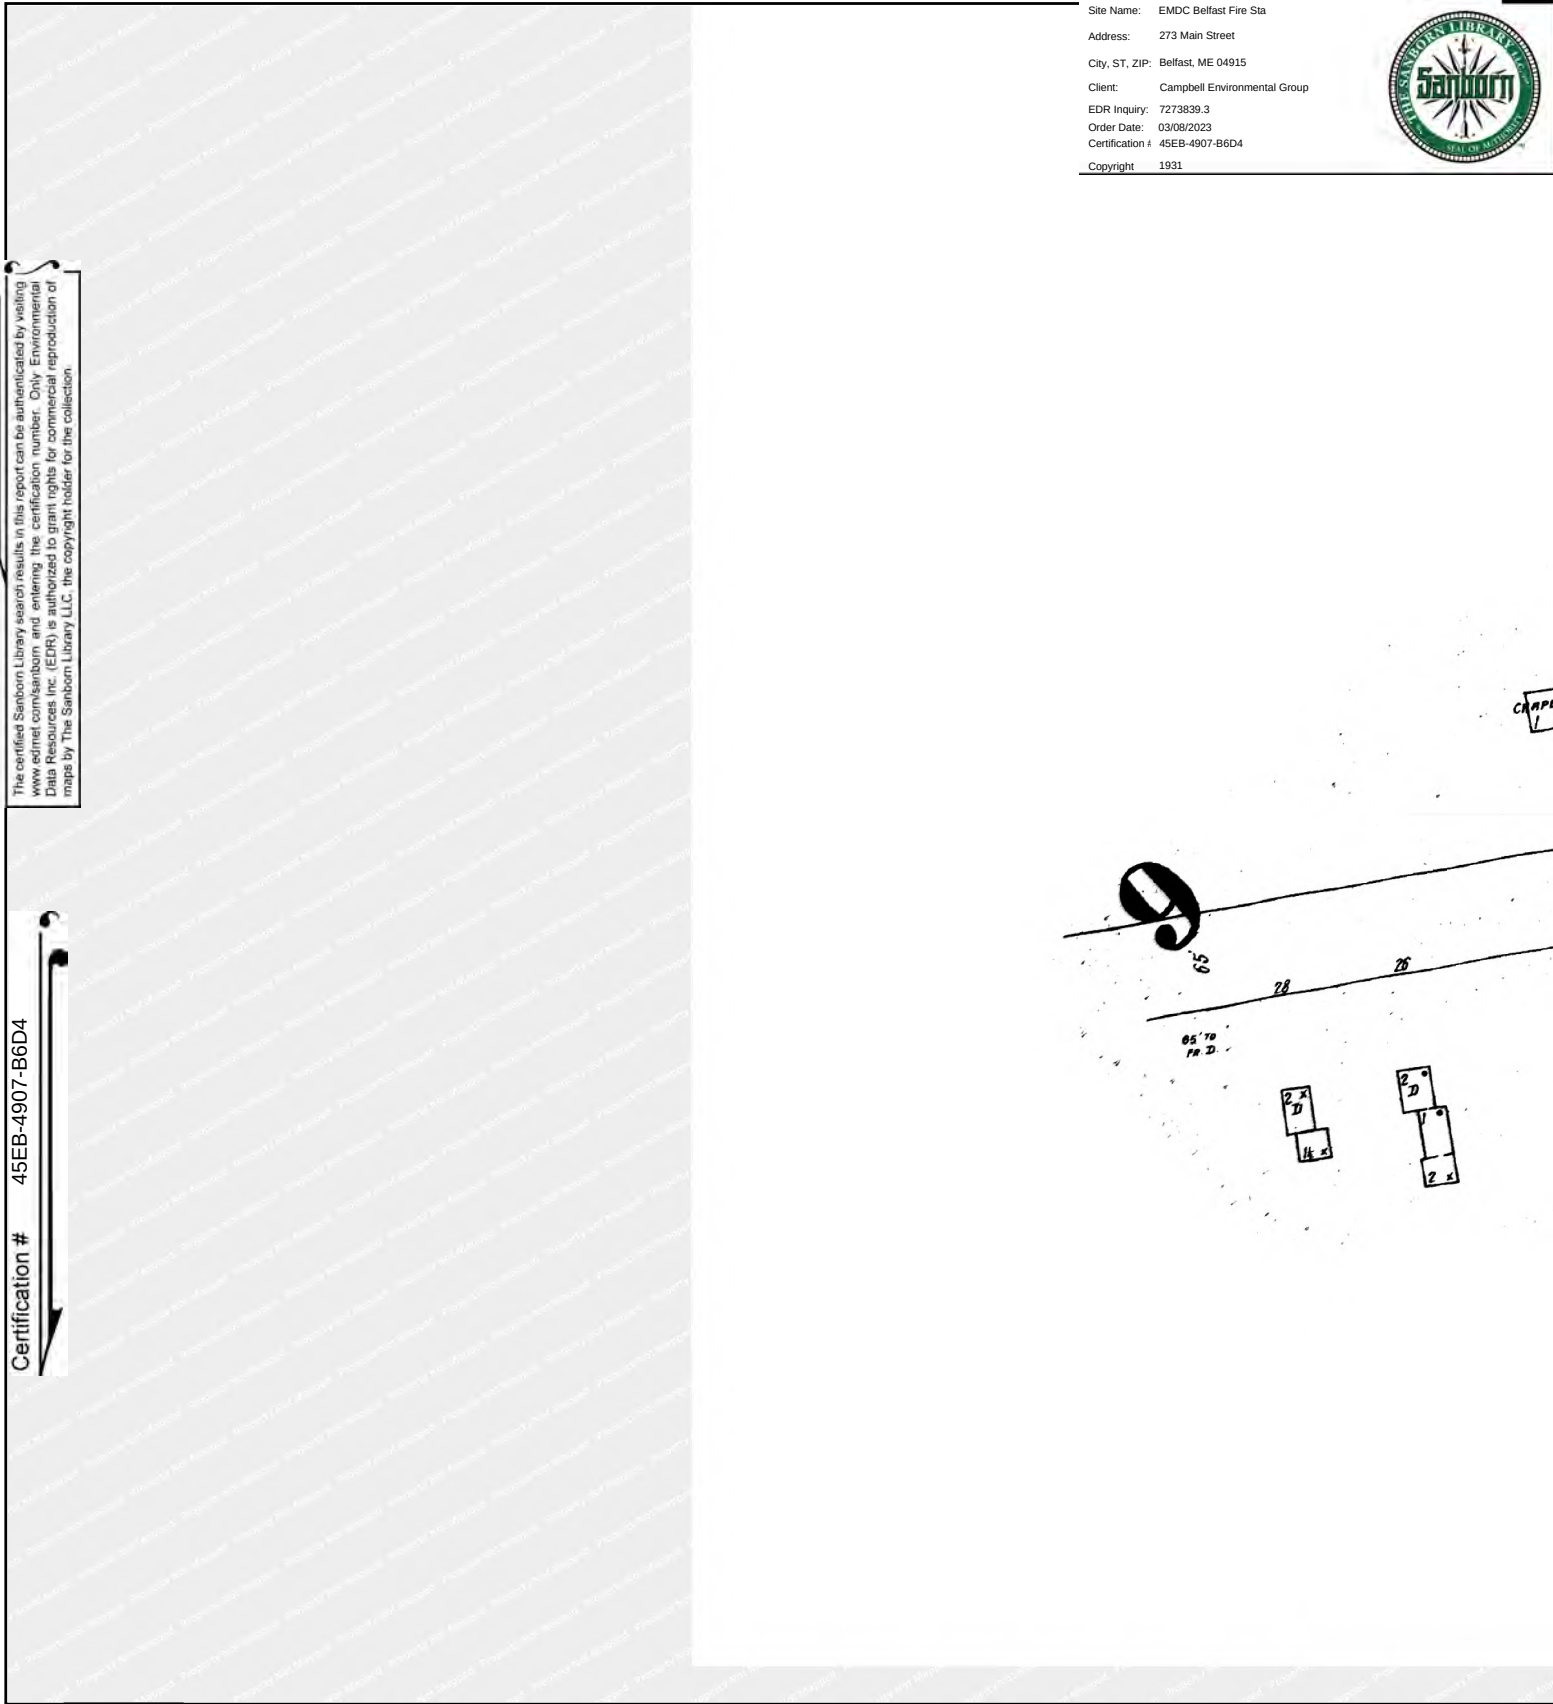

This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.



Volume 1, Sheet 9

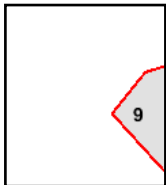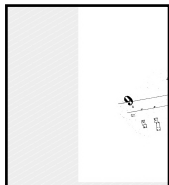


Site Name: EMDC Belfast Fire Sta
 Address: 273 Main Street
 City, ST, ZIP: Belfast, ME 04915
 Client: Campbell Environmental Group
 EDR Inquiry: 7273839.3
 Order Date: 03/08/2023
 Certification #: 45EB-4907-B6D4
 Copyright: 1923





The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.


Certification # 45EB-4907-B6D4

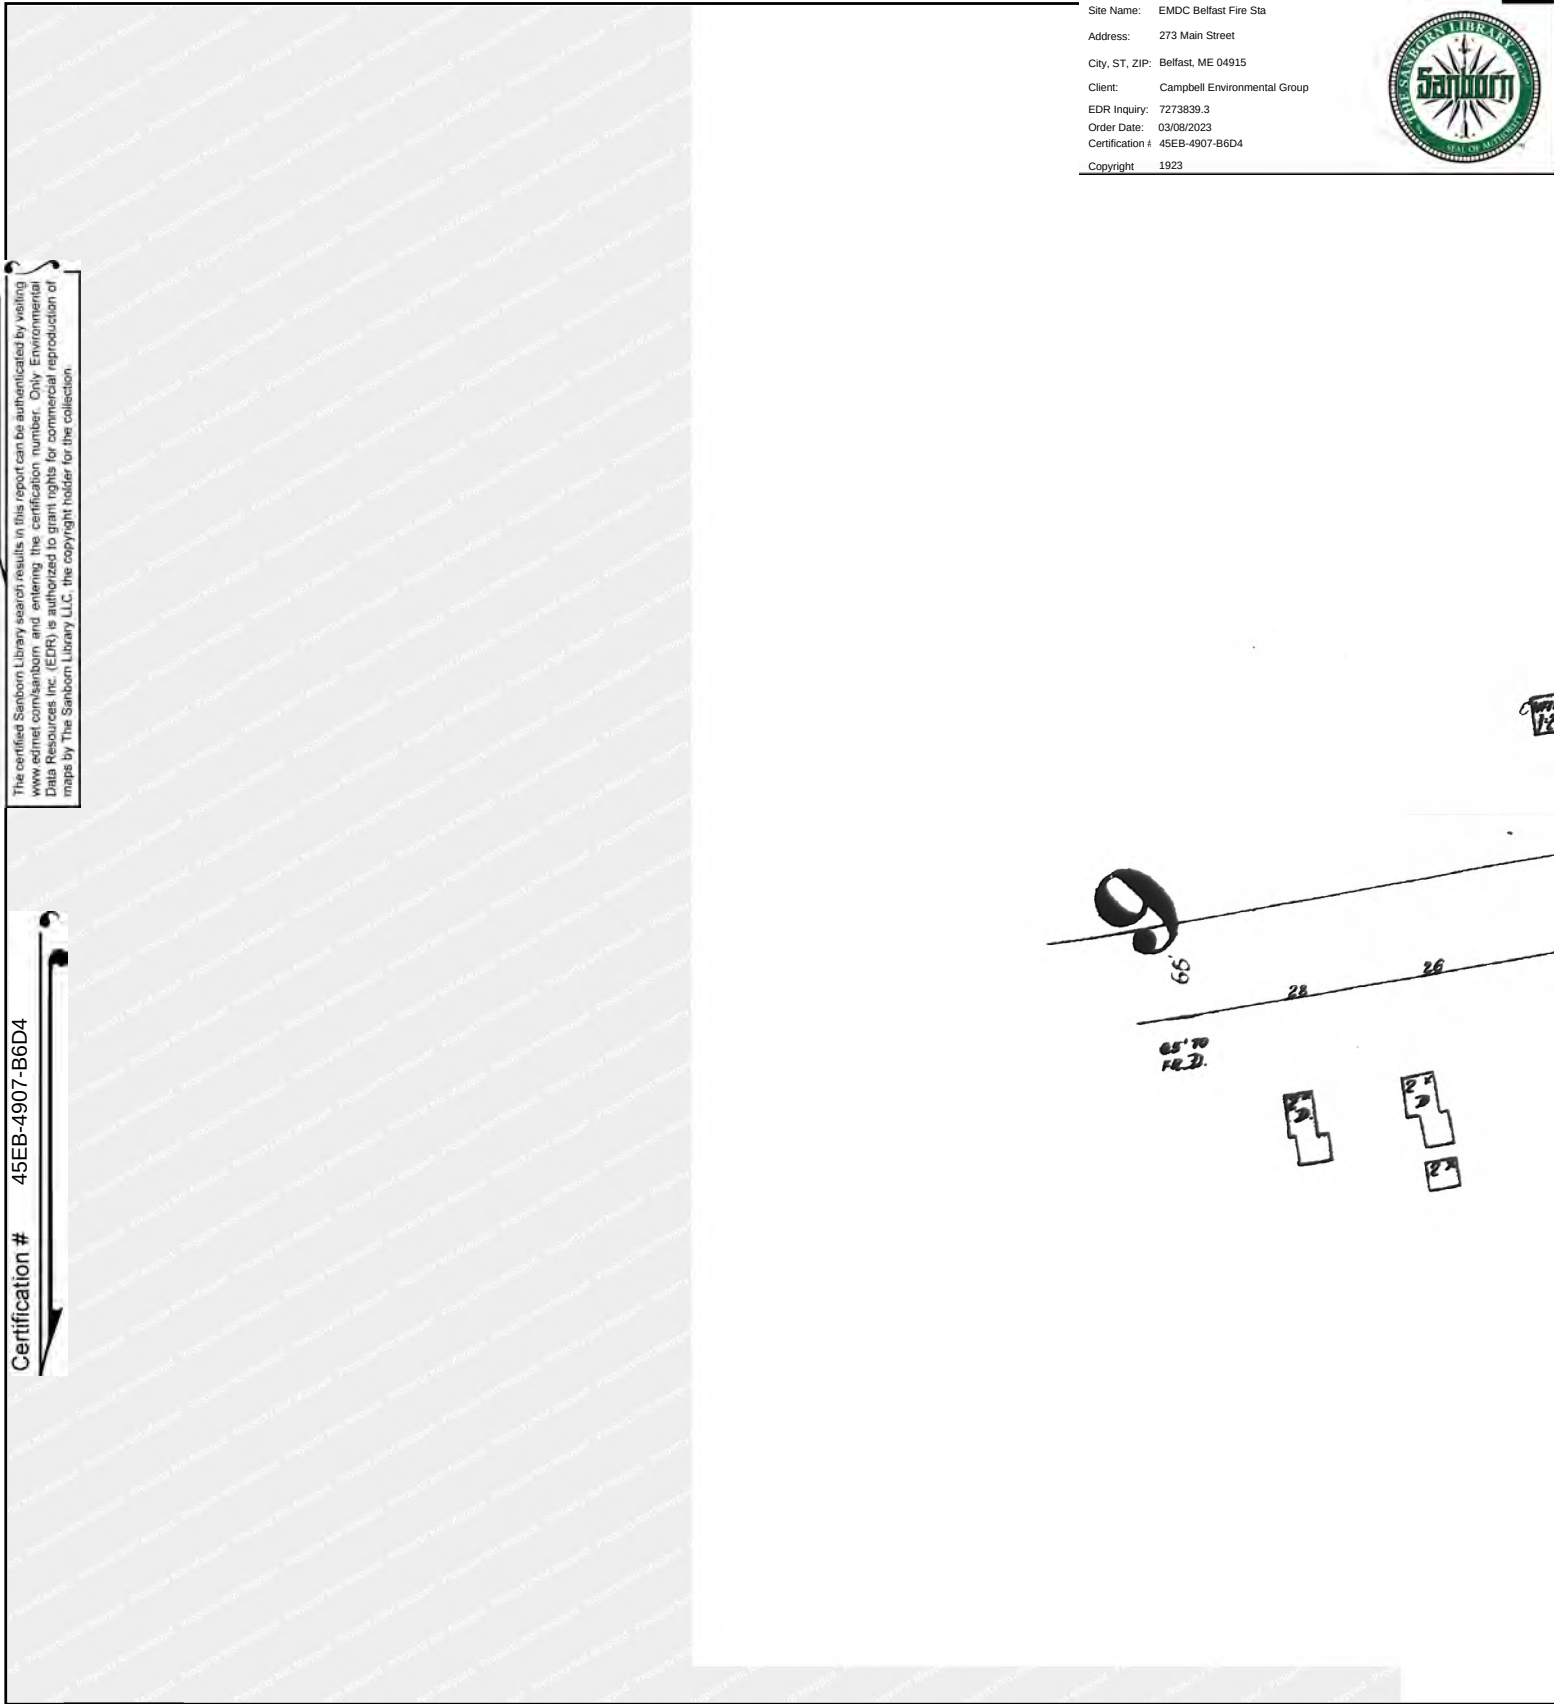

This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

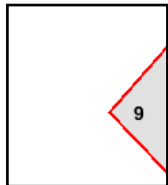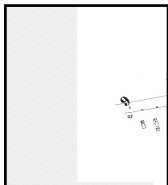

Volume 1, Sheet 9



EMDC Belfast Fire Sta

273 Main Street
Belfast, ME 04915

Inquiry Number: 7273839.5
March 09, 2023

The EDR-City Directory Image Report

TABLE OF CONTENTS

SECTION

Executive Summary

Findings

City Directory Images

Thank you for your business.

Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2023 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

DESCRIPTION

Environmental Data Resources, Inc.'s (EDR) City Directory Report is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's City Directory Report includes a search of available business directory data at approximately five year intervals.

RECORD SOURCES

The EDR City Directory Report accesses a variety of business directory sources, including Haines, InfoUSA, Polk, Cole, Bresser, and Stewart. Listings marked as EDR Digital Archive access Cole and InfoUSA records. The various directory sources enhance and complement each other to provide a more thorough and accurate report.

EDR is licensed to reproduce certain City Directory works by the copyright holders of those works. The purchaser of this EDR City Directory Report may include it in report(s) delivered to a customer.

RESEARCH SUMMARY

The following research sources were consulted in the preparation of this report. A check mark indicates where information was identified in the source and provided in this report.

<u>Year</u>	<u>Target Street</u>	<u>Cross Street</u>	<u>Source</u>
2020	☑	☑	EDR Digital Archive
2017	☑	☑	Cole Information
2014	☑	☑	Cole Information
2010	☑	☑	Cole Information
2005	☑	☑	Cole Information
2000	☑	☑	Cole Information
1995	☑	☑	Cole Information
1992	☑	☑	Cole Information

FINDINGS

TARGET PROPERTY STREET

273 Main Street
Belfast, ME 04915

<u>Year</u>	<u>CD Image</u>	<u>Source</u>

MAIN ST

2020	pg A2	EDR Digital Archive
2017	pg A4	Cole Information
2014	pg A9	Cole Information
2010	pg A13	Cole Information
2005	pg A17	Cole Information
2000	pg A21	Cole Information
1995	pg A25	Cole Information
1992	pg A28	Cole Information

FINDINGS

CROSS STREETS

<u>Year</u>	<u>CD Image</u>	<u>Source</u>

BELMONT AVE

2020	pg. A1	EDR Digital Archive
2017	pg. A3	Cole Information
2014	pg. A8	Cole Information
2010	pg. A12	Cole Information
2005	pg. A16	Cole Information
2000	pg. A20	Cole Information
1995	pg. A24	Cole Information
1992	pg. A27	Cole Information

City Directory Images

BELMONT AVE 2020

1	BELFAST JEWELRY
	BERKSHIRE HATHAWAY HOME SVC
	DAMARISCOTTA BANK & TRUST CO
	LINDA FEENEY
	LOYAL BISCUIT
	MAKIN WAVES
	RENYS DEPARTMENT STORE
	RONANNE HAIGH BELFAST ME REAL
6	DUTCH CHEVROLET BUICK INC
7	ATM
	BANGOR SAVINGS BANK
15	BELL THE CAT
17	CAMDEN NATIONAL BANK
21	GROVE CEMETERY
22	AMERIGAS PROPANE EXCHANGE
	ATM
	CIRCLE K
23	DQ GRILL & CHILL
29	GRF REAL ESTATE CO
30	BLUE RHINO
	HAMMOND LUMBER CO
267	BARBARA GRASS
	MERLE GRASS
268	ALLEN WEAVER
272	ANDREA BOUCHARD
	DREW EMERY
	GRACE MONTALBO
274	WILLIAM MORRIS

MAIN ST 2020

179	ALAN WOOD
	JULIE WOOD
	PETER KEENAN
183	MATT ADRAGNA
	NATALIE GREEN
185	KENDEL ANDERSON
	KEVIN ANDERSON
191	SILKWEEDS
193	JOSHUA BIROCCO
	TRACY BIROCCO
195	CAROL HOUGHTON
199	RICHARD PHILLIPS
	SAMANTHA CAUSON
203	JESSICA SUTHERLAND
209	ALEXANDER ROSENTHAL
	TAMARA ROSENTHAL
210	ELIZABETH TOWNSEND
	LAIRD TOWNSEND
215	HAROLD BROWN
216	JOHN CRONIN
	KATHERINE MATHIEU
220	LINDA HEWLETT
	THERESA BEITLER
224	CATHERINE SANDERS
	COURTNEY SANDERS
236	DENNIS REMILLARD
	DONALD FLANDERS
	KEITH WRY
	LINDA WRY
244	QUIRK AUTO
	QUIRK CHRYSLER DODGE JEEP RAM
	QUIRK FORD OF BELFAST
	QUIRK MOTOR CITY USED VEHICLE
262	MARITIME ENERGY
268	ATM
	BLUE RHINO
	REDBOX
	WALGREENS
	WESTERN UNION AGENT LOCATION
273	BELFAST FIRE DEPT
	CITY OF BELFAST
281	AUTOZONE
	BELFAST CITY FIRE DEPT
282	MC DONALD'S

BELMONT AVE 2017

1	BELFAST JEWELRY
	LOYAL BISCUIT
	MAKIN WAVES
	OLYMPIA SPORTS
	SWEETFROG
6	DUTCH CHEVROLET BUICK PONTIAC
	ENTERPRISE RENTACAR
7	BANGOR SAVINGS BANK
15	PIZZA HUT
17	CAMDEN NATIONAL BANK
22	CIRCLE K
	SHELL
	WENDYS
25	BIELENBERG, GENEVA
67	THOMAS, PAULINE L

MAIN ST 2017

3	WEATHERVANE SEAFOOD RESTAURANTS
12	CONSUMERS FUEL CO
14	BELFAST AREA CHAMBER OF COMMERCE
15	BELFAST OFFICE SUPPLY & SERVICES BOS
	COUNTY COPY & PRINT CENTER
	FELLOWS KEE TYMOCZKO & PIERSON LLC
	LAANXANG CAFE
	LEWIS, NATHAN W
17	BELFAST OFFICE SUPPLY & SERVICES BOS
	MAINE COAST PHOTO
	MARKS PRINTING HOUSE
30	BELFAST DOCKSIDE RESTAURANT
	DOCKSIDE FAMILY RESTAURANT
	EARTH DHARMA FARM
	WINSMOR GARAGE DOOR COMPANY
33	NEEDFUL THINGS LLC
	REVIVAL SALON
	SONYAS SKIN CARE
34	CAPTAIN TINKHAMS EMPORIUM
35	COOL SPOT THE
	SCOOPS
	THE COOL SPOT
37	ROLLIES BAR & GRILL
	SEARSMONT TOWN LIBRARY
39	AINA MOJA
	ART ALLIANCE GALLERY
	REVIVAL SALON
	SONYAS SKIN CARE
48	BIGFOOT INC
	THE MEADOW OF BELFAST
	UPPER CUT HAIR STYLES
50	AARHUS GALLERY
	COE, SUSAN K
52	DELVINOS GRILL & PASTA HOUSE
54	COYOTE MOON
57	TRACIS DINER
60	THE CHOCOLATE DROP CANDY SHOPPE
62	BROOKS, PHILIP J
64	DOWNTOWN JEWELRY & ENGRAVING SHOP
65	WORKING ART GALLERY
68	S & W PUBLISHING LLC
	THE GOOD TABLE
69	PATINA
	TRAVELLERS LEATHER
70	N TWH GALLERY
71	BENTLEY, LUCINDA
	GREEN STORE THE
72	BELFAST BAY INN
	IMAGE BOX PHOTOS
74	BARNES, ROBERT M

MAIN ST

2017

(Cont'd)

74	GRAY, HANNAH IMAGE BOX PHOTOS MATZELL, NANCY S VINOLIO
75	DEAN, LINDA A DOWNEAST DIVERS HOME SUPPLY CENTER
76	BELFAST ARMY NAVY M M JULZ CHRISTMAS SHOP THOMAS, FELICIA A
78	THE GAME LOFT
79	COLBURN SHOE STORE
82	HEAVENLY SOCKS YARNS
90	WHITECAP BUILDERS INC
92	BABYBELLA FIRST LIGHT GALLERY NORTHWOODS GOURMET GIRL PARENT GALLERY STEPHENS WARING YACHT DESIGN
93	ALEXIAS PIZZA BIGSCREENBIZ
94	EAT MORE CHEESE SWITZER FOUNDATION ROBERT & PATRICIA
96	BELFAST FRAMER THE CHASES DAILY NORTHERN TILTH YO MAMMA S HOUSE
97	HAGNEY TIM NATUROPATHIC PHYSICIAN MAINE FARMLAND TRUST
99	OLD PROFESSORS BOOKSHOP
101	LOTIC INC
103	ARCHANGEL COMPUTERS WATSON, LEAH
104	KATWALK SPEAKING ROSES OF MAINE
105	CITY DRAWERS MORIN, DAVE
106	BANGOR SAVINGS BANK YORK PETRIE GOLDSMITH & GALLERY
107	BELFAST CREATIVE COALITION BELFAST OUR TOWN REALTY OF MAINE
108	THE GOTHIC RESTAURANT
109	GOOD DEEDS INC
111	KEYBANK
128	ORIENTAL CUISINE
129	BRIMMER, VIRGINIA T CATANZARO, THERESA KING, JEFFREY RUSSELL, EMILY

MAIN ST

2017

(Cont'd)

129	SCHULTZ, EBEN THROCKMORTON, VIRGINIA
137	HOLBROOK, BENJAMIN MCCREA, NICHOLAS MOONBAT CITY BAKING CO MURHAMMER, SUZANNE M ZEPHYR, KATE
138	COASTAL COMMUNICATIONS INTEGRITY SELLERS INC SUN TAN CITY T & T NAIL SPA
139	CYKMAN, KATHERINE B EDES, BEN D QUANTUM INSULATORS
140	SUN TAN CITY
153	TARRATINE TRIBE IORM
156	CAMDEN NATIONAL BANK
167	MANK, JOHN M MCINTYRE, JAN L
179	REED, LARRY P
183	CONARY, SHAUN A GENDRON, ROBERT GREEN, NATALIE L
185	ANDERSON, KEVIN GILBERT, VIOLA JACOBS, CHRIS JAMIESON, JOHN M
187	INGERSOLL, BILL E
191	BURDITT, NOAH LITTLEFIELD, K MCINTIRE, TRACY R
193	BIROCCO, JOSHUA E
195	HOUGHTON, CAROL
199	KLAIMON, JEROLD H MARITIME ENERGY SUBWAY
203	SUTHERLAND, ALAN
210	TOWNSEND, LAIRD D
215	BROWN, HAROLD E
216	CRONIN, JOHN
220	REED, BETSY R
224	SANDERS, ERIC F
236	REMILLARD, DENNIS J
244	CARS BY US MOTOR CITY QUIRK CARS BY US QUIRK CHRYSLERDODGEJEEP OF BELFAST QUIRK CHRYSLERDODGEJEEPRAM OF BEL QUIRK FORD OF BELFAST QUIRK FORDCHRYSLER INC

MAIN ST**2017****(Cont'd)**

244	QUIRK FORDMERCURY OF BELFAST
	QUIRK MOTORCITY
254	RITE AID
262	MARITIME ENERGY
268	REDBOX
281	AUTOZONE
282	MCDONALDS

BELMONT AVE 2014

1	CURVES
	DOWNTOWN JEWELRY & ENGRAVING SHOP
	LOYAL BISCUIT
	MAKIN WAVES
	OLYMPIA SPORTS
	SCALLIONS
	WALTZ PHARMACY BELFAST
2	KEENE, DAVID E
6	DUTCH CHEVROLET BUICK PONTIAC
	ENTERPRISE
7	BANGOR SAVINGS BANK
15	PIZZA HUT
17	CAMDEN NATIONAL BANK
18	FLANDERS, DONALD E
22	CIRCLE K
	DEAD RIVER COMPANY
	SHELL
	WENDYS
23	DAIRY QUEEN
25	OVERLOCK, ALDEN L
27	COLLINS, MIKE
28	WILLIS, GREG
33	OCCUPANT UNKNOWN,
40	HOLMES, JOSEPH E
	SMART, ASHLEY M
67	THOMAS, PAULINE L
74	OCCUPANT UNKNOWN,

MAIN ST 2014

12	CONSUMERS FUEL CO
14	BELFAST AREA CHAMBER OF COMMERCE
15	COUNTY COPY & PRINT CENTER
	DELSANTO, CHRISTINA M
	LAANXANG CAFE
17	BELFAST OFFICE SUPPLY & SERVICES BO
	MAINE COAST PHOTO
	MARKS PRINTING HOUSE
25	OSGOOD, LAURIE
29	ALEXIAS PIZZA
30	DOCKSIDE FAMILY RESTAURANT
33	NEEDFUL THINGS LLC
35	COOL SPOT THE
37	ROLLIES BAR & GRILL
39	AINA MOJA
	ART ALLIANCE GALLERY
	REVIVAL SALON
	SONYAS SKIN CARE
48	BIGFOOT INC
	MACGREGOR MILL SYSTEMS
	UPPER CUT HAIR STYLES
50	AARHUS GALLERY
52	DELVINOS GRILL & PASTA HOUSE
54	COYOTE MOON
57	TRACIS DINER
60	CHOCOLATE DROP CANDY SHOPPE THE
	HARBOR ARTISANS
68	GOOD TABLE THE
	S & W PUBLISHING LLC
69	BRAMBLES
70	BELFAST BAY INN & LUXURY SUITES
71	BENTLEY, LUCINDA
	GREEN STORE THE
74	BARNES, ROBERT M
	GRAY, HANNAH
	IMAGE BOX PHOTOS
	OCCUPANT UNKNOWN,
	VINOLIO
75	DEAN, LINDA A
	DOWNEAST DIVERS
	HOME SUPPLY CENTER
	TRUSTWORTHY STORE
76	BELFAST ARMY NAVY
	OCCUPANT UNKNOWN,
77	OCCUPANT UNKNOWN,
78	GAME LOFT THE
79	COLBURN SHOE STORE
	JAMIESON THOMAS B ACUPNCTR
80	PERMANENT EXPRESSIONS TATTOO
82	HEAVENLY SOCKS YARNS

MAIN ST 2014 (Cont'd)

92	PARENT GALLERY STEPHENS WARING YACHT DESIGN THE LIGHTING ZONE INC
93	BANGOR DAILY NEWS BIGSCREENBIZ COASTAL DISTRIBUTORS
94	SWITZER FOUNDATION ROBERT & PATRICIA
96	BELFAST FRAMER THE CHASES DAILY NORTHERN TILTH RESTORATIVE JUSTICE PROJECT YO MAMMA S HOUSE
97	HAGNEY TIM NATUROPATHIC PHYSICIAN MAINE FARMLAND TRUST
98	FEURTADO, INEZ L
99	OLD PROFESSORS BOOKSHOP
101	OCIEPKA SEAN THE LAW OFFICE OF WEAVERS BAKERY
103	OCCUPANT UNKNOWN, WATSON, LEAH
104	KATWALK MAINE GROUP THE
105	CITY DRAWERS MORIN, DAVE OCCUPANT UNKNOWN,
106	BANGOR SAVINGS BANK YORK PETRIE GOLDSMITH & GALLERY
107	LAURA SWIFT LTD INTERIOR DESIGN REALTY OF MAINE
108	GOTHIC RESTAURANT THE
109	GOOD DEEDS INC
111	KEYBANK
125	OLD STUFFLAMPLAMPSHADES
128	ORIENTAL CUISINE
129	DUDLEY, JANYME RHODES, MILFORD A THERRIEN, SARA THROCKMORTON, VIRGINIA
136	HOWARD, EDWIN
137	BACON, SKYE L EDES, BEN D MCCARTHY, MARY MOONBAT CITY BAKING CO
138	COASTAL COMMUNICATIONS FAMILY DOLLAR T & T NAIL SPA
139	CYKMAN, KATHERINE QUANTUM INSULATORS TRAVES, RICHARD
140	SUN TAN CITY

MAIN ST

2014

(Cont'd)

153	TARRATINE TRIBE 13 IORM
156	CAMDEN NATIONAL BANK
167	MANK, JOHN M
	MCINTYRE, JAN L
	NOBLE, D
	YOUNG, COURTNEY J
170	OCCUPANT UNKNOWN,
179	WOOD, ALAN M
183	GENDRON, ROBERT
	LAMPHIER, AMY
	ROBERTS, BRIAN
185	ANDERSON, KEVIN
	GILBERT, VIOLA
	HOPKINS, POLLY
	JACOBS, CHRIS
	LAMBERT, JUDY F
	OCCUPANT UNKNOWN,
	TRACY, ASHLEIGH
187	OCCUPANT UNKNOWN,
191	LITTLEFIELD, K
	MCNAMARA, JACK
	WHITE, DANIELLE
	WING, D
193	BIROCCO, JOSHUA E
195	BARROWS, LAWRENCE D
199	KLAIMON, JEROLD H
203	STOVER, MICHAEL D
210	TOWNSEND, LAIRD D
215	BROWN, HAROLD E
216	OCCUPANT UNKNOWN,
224	SANDERS, ERIC F
236	FLANDERS, DONALD E
244	MOTOR CITY
	QUIRK CHRYSLERDODGEJEEP OF BELFAST
	QUIRK FORD OF BELFAST
	QUIRK FORDCHRYSLER
	QUIRK FORDCHRYSLER INC
	QUIRK FORDMERCURY OF BELFAST
254	RITE AID
262	MARITIME ENERGY
281	AUTOZONE
282	MCDONALDS

BELMONT AVE 2010

1	BELL THE CAT
	GANNESTON CONSTRUCTION
	MAKIN WAVES
	MR PAPERBACK
	OLYMPIA SPORTS
2	GIFFORD, DAVID E
6	DUTCH CHEVROLET BUICK PONTIAC
7	BANGOR SAVINGS BANK
15	PIZZA HUT
17	UNION TRUST CO
18	FLANDERS, DONALD E
21	GROVE CEMETERY
22	DEAD RIVER CO CONVENIENCE
	WENDYS
23	DAIRY QUEEN
27	COLLINS, MIKE
28	WILLIS, GREG
30	EBS BUILDING SUPPLIES
33	STEWART, JOAN E
40	HOLMES, ALLEN D
	HOLMES, RICHARD A
	MC DONALDS
67	THOMAS, PAULINE L

MAIN ST 2010

3	WEATHERVANE SEAFOOD RSTRNT
12	CONSUMERS FUEL CO
15	BELFAST BAKESHOP & DELI
	COUNTY COPY CTR
	GAIL SAVITZ STUDIO
	MARKS PRINTING HOUSE
17	BELFAST OFFICE SUPPLY & SVC
	FALVEY NANCY J
	LUNCH WAGON
	MAINE COAST PHOTO
24	GILLETTE, M C
28	HAMILTON, JANELLE L
29	ALEXIAS PIZZA
33	REVIVAL SALON
	SONYAS SKIN CARE
35	SCOOPS
37	ROLLIES BAR & GRILL
39	ART ALLIANCE GALLERY
48	MAINE WOOD PRODUCTS ASSN
	UPPER CUT
50	AARHUS GALLERY
54	COYOTE MOON
57	DUDLEYS DINER
60	CHOCOLATE DROP CANDY SHOPPE
62	EDWARDS, ARNIE
	HOLMAN, SUSAN
	WILKIE, WILLIAM F
64	DOWNTOWN JEWELRY & ENGRAVING
65	WORKING ART GALLERY
68	GOOD TABLE
	S & W PUBLISHING LLC
69	BRAMBLES
71	BENTLEY, LUCINDA
	GREEN STORE
	SUSAN FARRELL CAUST MEMORIAL
72	BELFAST BAY INN & LUXURY
74	CLARK, BENJAMIN
	FOSTER, THOMAS L
	GREENFIELD, KRNSA
75	DEAN, LINDA A
	HOME SUPPLY CTR
76	BELFAST ARMY NAVY
	BOVEY, DIANTHA S
	SAVAGE, ASHLEY L
78	ALL ABOUT GAMES
	GAME LOFT
79	COLBURN SHOE STORE
	ELIZABETH W GARBER TRADITIONAL
	JAMIESON THOMAS B
80	DISH HAIR SALON

MAIN ST

2010

(Cont'd)

80	YO MAMMA INC
82	HEAVENLY SOCKS YARNS
92	FIRST LIGHT GALLERY
	PARENT GALLERY
93	BANGOR DAILY NEWS
	GRAY LANE H
94	INDIGO GALLERY
	SWITZER FOUNDATION
96	BELFAST FRAMER
	CHASES DAILY
	NORTHERN TILTH
	YO MAMMAS HOUSE
97	HAGNEY TIM
	MAINE FARMLAND TRUST
98	FEURTADO, INEZ L
99	OLD PROFESSORS BOOKSHOP
101	HYPNOGENICS MIND & BODY HEALIN
	WEAVERS BAKERY
104	SPEAKING ROSES OF MAINE
105	CUMMINGS, JIM
	FERTILE MIND BOOK SHOP
106	BANGOR SAVINGS BANK
107	REALTY OF MAINE
111	KEY BANK
125	OLD STUFF LAMP SHADES
128	BICKFORD, MAHLON C
129	ARSENAULT, FABIAN
	CASEY, MARY
	ROBERTS, BRIAN K
	SIMCOCK, STEVEN J
	STAMP, ADAM
136	HOWARD, EDWIN
137	BUSS, A
	HURST, A
138	CENTURY LINK
	FAMILY DOLLAR STORE
	SUN TAN CITY
139	EDES, BEN D
	JEAN, SUSAN
	MARASS, NELSON S
	PARKER, RANDALL
	TRAVES, RICHARD
149	MANK, JOHN M
	SKAFIDAS, GREG
156	CAMDEN NATIONAL BANK
167	BRYANT, M
	NOBLE, CYRELLA
	NOBLE, D
	STIMPSON, HANNAH
170	DINSMORE, MICHELLE

MAIN ST

2010

(Cont'd)

172	BECKER, BONNIE L
179	WOOD, ALAN M
182	PLACE, JAMES C
183	ANDERSON, WHITNEY
	DEGIOVANI, MIA
	ROABARMEL, T
	RUNCI, W
	WEINER, S
185	ANDERSON, K
	BELDEN, MAURICE
	C R BEACH PLUMBING & HEATING
	GILBERT, VIOLA
	HOPKINS, POLLY
	JACOBS, CHRIS
	KERFOOT, SHANNON
	SKINNER, JOHN S
187	SAWTELLE, ROSS K
193	BIROCCO, JOSHUA E
195	BARROWS, LOIS J
199	KLAIMON, JEROLD H
203	STOVER, HENRY C
210	TOWNSEND, LAIRD D
215	BROWN, HAROLD E
216	MATHIEU, JOSEPH P
220	WOLCOTT, SANDRA S
224	SANDERS, ERIC F
244	QUIRK CHRYSLER DODGE JEEP
254	RITE AID
262	MARITIME ENERGY
281	AUTOZONE

BELMONT AVE 2005

1	BELFAST COMPUTERS
	BELFAST DRUG
	BELL CAT
	DAMARISCOTTA BANK & TRUST CO
	DISCOUNT PAVING
	MAKIN WAVES
	MONROE SALT WORKS OUTLET
	WASSES HOT DOGS
2	BERRY, DAWN L
6	DUTCH CHEVROLET OLDSMOBILE BUICK PON
11	WALTZ PHARMACY
23	DAIRY QUEEN
25	NICKERSON, VICKI L
30	ELLSWORTH BUILDERS SUPPLY INC
40	MCDONALDS OF BELFAST
67	THOMAS, PAULINE L
74	OCCUPANT UNKNOWN,

MAIN ST 2005

3 WROUGHT WASHER MANUFACTURING INC
 11 KEYBANK
 12 CONSUMERS FUEL CO
 15 COUNTY COPY CENTER
 16 PAUL KAMINS MD PA
 17 MARKS PRINTING HO
 OCCUPANT UNKNOWN,
 THE LUNCH WAGON
 THE PROVIDENCE MUTUAL FIRE INSURANCE
 24 GILLETTE, M C
 27 CROSBY, C
 28 HAMILTON, JANELLE L
 33 TILE WITH STYLE
 35 SCOOPS
 37 ROLLIES BAR & GRILL INC
 39 BAY RIVER MARKET ON MAIN STREET
 48 THE UPPER CUT
 50 JACOBS MARVIN ART GALLERY
 KARAMAZOV, ASENETH
 52 GARDEN COTTAGE
 57 RH MILLER INC
 62 DUKE, RAOUL
 PILLSBURY, M
 THOMPSON, ROBERT C
 WILKIE, WILLIAM F
 63 JAMIESON, THOMAS B
 64 DOWNTOWN JEWELRY & ENGRAVING SHOP
 68 THE GOOD TABLE
 69 OCCUPANT UNKNOWN,
 TRAVELERS LEATHER
 70 NTWH GALLERY
 TWILIGHT CAFE
 71 BENTLEY, LUCINDA
 GREEN STORE INC
 OCCUPANT UNKNOWN,
 74 CLARK, BENJAMIN
 PURINTON, AMON
 THE CLOWN
 75 DEAN, LINDA A
 EVANS, A
 HOME SUPPLY CENTER CORP
 OCCUPANT UNKNOWN,
 76 BELFAST ARMY NAVY
 CLARK, BENJAMIN
 LEIF WEAVER DESIGN
 77 OCCUPANT UNKNOWN,
 78 ALL ABOUT GAMES
 THE GAME LOFT
 80 DISH HAIR SALON
 92 ART ALLIANCE GALLERY

MAIN ST

2005

(Cont'd)

92	PARENT GALLERY
93	BANGOR DAILY NEWS
	TOWER CONTROL INC
96	AWAY WE GROW
	BELFAST FRAMER
	BETH TRACY PERSONAL TRAI
	JUDITH MATHIEU MS RNCS
	MORNINGSTAR MIDWIFERY
	SECRET TATTOO
97	HAGNEY TIM NATUROPATHIC PHYSICIAN
	KRAZY KONES & KREATIONS
98	FEURTADO, INEZ L
99	MRS GRAYS ANTIQUES
101	WEAVERS BAKERY
102	HOBBLEDEHOY TOYS
103	REALTY OF MAINE
104	SPADOLA JOHN
105	ARNOLD, GRETCHEN L
	FERTILE MIND BOOKSTORE
	OCCUPANT UNKNOWN,
107	JARET & COHN REAL ESTATE
108	LANDMARK ARCHITECTURAL ANTIQUE
109	GOOD DEEDS INC
111	KEYBANK NATIONAL ASSOCIATION
121	LOGOS PUB & GRILL
123	OCCUPANT UNKNOWN,
128	BELFAST, I G
129	BISHOP, KING
	HILLS, RYAN
	MCGARY, LUCAS
	MISLUK, A
	MSLUK, ADRIAN
	ROBERTSON, JAMIE
	SCHNEIDER, LEONARD
	THOMAS, TAMSIN
	THROCKMORTON, VIRGINIA
137	EDES, BEN D
	FISH, CHARLES F
	INGRAHAM, AMANDA
	PELC, M
138	WILLIAMS DEVELOPMENT INC
139	MARASS, NELSON S
149	MANK, JOHN M
167	ANDREWS, PAUL
	BRYANT, M
	MOORES, K
	RILING, KENNETH J
	STROUT, KATHERINE L
	WOOD, JAN M
170	DINSMORE, MICHELLE

MAIN ST

2005

(Cont'd)

172	BECKER, BONNIE L
179	JACKSON, JOHN W
	WOOD, ALAN M
183	ADRAGNA, MATT
	DEGIOVANI, MIA
	ESPERANCE, R
	MITCHELL, D
	SANKOVA, ANNA
185	ASHLEY, A
	DUKE, MARGARET A
	RUSSELL, MICHAELA
	SKINNER, JOHN S
187	WALTON, J
188	CAMDEN NATIONAL BANK
191	OCCUPANT UNKNOWN,
193	BIROCCO, JOSHUA
195	BARROWS, LAWRENCE D
199	KLAIMON, JEROLD H
203	STOVER, HENRY C
209	PARMLEY, CASSIDY
210	TOWNSEND, LAIRD D
215	BROWN, HAROLD E
216	JOSEPH MATHIEU PAINTING
	MATHIEU, JOSEPH P
220	WOLCOTT, SANDRA S
224	SANDERS, ERIC F
232	OCONNOR, SHIRLEY
244	KALLIS FORD CHRYSLER JEEP INC
254	RITE AID PHARMACY # 4149
262	MARITIME ENERGY
281	BELFAST FIRE DEPARTMENT

BELMONT AVE 2000

21 GROVE CEMETERY
38 SOUNDS EASY VIDEO
40 MCDONALDS RESTAURANT

MAIN ST 2000

4	WALDO HANCOCK SUNDAY
5	KEY WEST INCORPORATED KEY CENTERS
12	CONSUMERS FUEL CO
	LADD W C & SONS INS
	MORSE PAYSON & NOYES INS BELFAST
15	ATTORNEYS OFFICE PA
	COUNTY COPY CENTER
	FULLER C CLIFTON ATTORNEY
	MACGREGOR MILL SERVICES
	MAINE COAST PHOTO
17	ATLANTIC INSURANCE & BENEFITS
24	GILLETTE, M C
27	COHEN, DANIEL I
29	ALEXIAS PIZZA
30	DOCKSIDE FAMILY RESTAURANT
33	TILE WITH STYLE
37	ROLLIES CAFE
40	DICKS SERVICE STATION
47	IMPROVED ORDER OF REDMAN
48	REED, BARBARA
	UPPER CUT THE
50	JACOBS MARVIN ART GALLERY
52	CANTERBURY TALES
54	COYOTE MOON
56	WOODWARD LEE JR
	WORTH PATRICIA GOODRIDGE LAWYER
57	DUDLEYS DINER
60	CHOCOLATE DROP CANDY SHOPPE THE
63	JAMIESON, THOMAS B
	RAKISLAMBROULI, P
64	YE OLDE COIN SHOP
65	FIELD & QUIMBY REAL ESTATE
68	GOOD TABLE THE
	ZOPP, DUDLEY M
69	BABBIDGE, LEWIS W
70	MIDCOAST REAL ESTATE
	RYAN, WILLIAM P
71	FARRELL SUSAN CAUST MEMORIAL LIBRARY
	GREEN STORE THE
72	WRIGHT RYAN CONSTRUCTION SITE 9904
74	GOLDENTHAL, REBECCA
	JOHNSON, WILLIAM E
	KELLEY, J
	MIDCOAST REAL ESTATE
	ROE, SUSAN
75	DOWNEAST DIVERS
	HOME SUPPLY CENTER
	TRUSTWORTHY STORE
76	BELFAST ARMY NAVY
77	JONES, M

MAIN ST

2000

(Cont'd)

78	ALL ABOUT GAMES COMMERCIAL PRINTING SERVICES GAMERS LOFT THE
79	BALDWIN ELIZ GARBER TRADITIONAL ACUPUNCTURE COLBURN SHOE STORE JAMIESON THOMAS B ACUPNCTR
80	BROWN, K P DISH HAIR SALON
90	FREDERICK, LINDEN
92	90 MAIN OCCUPANT UNKNOWN,
93	BANGOR DAILY NEW COASTAL DISTRIBUTORS HURLEY MICHAEL HURLEY, MICHAEL SUN SERVICES
94	SOFTEC COMPUTERS
96	AWAY WE GROW BELFAST FRAMER THE CHASE, MEGAN JULIE ROSE BODY ARTS PRIMERICA FINANCIAL SERVICES TRACY BETH PERSONAL TRAINER WHITE MOUNTAIN RESOURCE MANAGEMENT INCORPORATED
97	BIRTHRIGHT MIDWIFERY RAKISLAMBROULIS, P
99	BELFAST TRAVEL SERVICE INCORPORATED
101	WEAVERS BAKERY
102	OCCUPANT UNKNOWN, WELCHS BEVERAGE & TOBACCO HOUSE
103	CLOTHING CONTINUUM
104	HOGAN MICHAEL ARCHT MICAELA BOUTIQUE SPADOLA JOHN ARCHT THE MAINE GROUP WALDO MECHANICAL PLUMBING
105	BRADFORDSAUCIER, JEN FERTILE MIND BOOK SHOP FROM BELFAST ME MONROE ME
107	JARET & COHEN REAL ESTATE JARET & COHN REAL ESTATE
108	GOTHIC CAFE & COFFEE HOUSE LANDMARK ARCHITECTURAL ANTIQUES WHITING, DAVID
109	GOOD DEEDS INCORPORATED
121	LOGOS PUB & GRILL
125	ECLECTIC CLOSET
128	BELFAST I G A
129	BISHOP, KING BISHOP, MARY BURROWS, P L

MAIN ST

2000

(Cont'd)

129	CHAMBERS, R DEHLINGER, PETER HASKELL, DAVID KATUZNY, SARAH E MOODY, JUDITH RICCIO, J THIBODEAU, JULIE D WRIGHT, TIMOTHY
137	FLOYD, ARTHUR TOWLE, SHAWNA WRIGHT, SHERRIE
139	EDES, B D
149	MANK, JOHN MUNSON, JON
155	CONARY, WAYNE
156	CAMDEN NATIONAL BANK
159	BARROWS, L
167	MUNSON, JON
170	BINSMORE, M
179	JACKSON, J W WOOD, ALAN M
183	GIBBONS, HEIDI GREENFIELD, MARK I
185	SANTILLO, AMY C
191	ROCKWELL, K
195	SMITH, HAROLD E
199	OCCUPANT UNKNOWN,
203	STOVER, HENRY C
209	OCCUPANT UNKNOWN,
244	KALLIS FORD CHRYSLER INCORPORATED

BELMONT AVE 1995

1	STOVER, HENRY C
3	HORST, CLEMENT
	SINCLAIR, STEVEN
4	TOWNSEND, LAIRD & ELIZABETH
5	BROWN, HAROLD E
6	RANDALL ASSOCIATES
	RANDALL, WM P & LISA
8	NESMITH, MICHAEL & MADELINE
10	BROOKS, ADRIAN J
18	FLANDERS, DONALD E
21	GROVE CEMETERY
27	BOUMAN, BETH A
29	GREENLEAF, ALLEN
32	MARITIME FARMS
38	SOUNDS EASY VIDEO
40	MC DONALD'S RESTAURANT

MAIN ST 1995

4	GOTHIC CAFE LANDMARK ARCHITECTURAL ANTIQUES
5	KEY BANK OF MAINE
7	GOOD DEEDS INC
9	JARET & COHN REAL ESTATE-REAL ESTATE OFFICES
12	LADD W C & SONS, INS-BELFAST
13	FERTILE MIND BOOK SHOP-FROM BELFAST ME MONROE ME SEARSPORT M HENDERSON, HAL L, COUNSLR THOMAS, LETITIA
14	HULBERT, WM T
15	DOWNEAST TECHNOLOGY INC MCGLAMERY, PETER SAVITZ, GAIL, STUDIO TAKE ONE PHOTO & VIDEO THREADS
16	ARTFELLOWS GALLERY
20	KIRK DRUG
24	AWAY WE GROW BELFAST FRAMER THE GILLETTE, M CAROL PRIMERICA FINANCIAL SERVICES
25	BELFAST TRAVEL SERVICE INC O'CAIREALLAIN, MICHAEL
26	PUFFIN'S NEST
27	BAY CITY CARGO COASTAL DISTRIBUTORS CUBBERLY, ROBIN HURLEY, MICHAEL SUN SERVICES
28	MAINE COAST PHOTO
29	ALEXIA'S PIZZA CLIFF'S HAIR STYLING SALON WEAVER'S BAKERY
30	DOCKSIDE FAMILY RESTAURANT
35	KRAZY KONES
37	JOHNSON, DENNY J ROLLIE'S CAFE
40	DICK'S SERV STA
44	JACOBS MARVIN ART GALLERY MAINE JOB SERVICEE UPPER CUT THE, HAIR STYLES
47	IMPROVED ORDER OF REDMAN
48	GOOSE RIVER FINE CRAFTS REMINGTON, LORI
52	CANTERBURY TALES
54	COYOTE MOON
55	BELFAST ARMY NAVY
57	DUDLEY'S DINER
59	TILE WITH STYLE
60	BELFAST LIGHTING

MAIN ST

1995

(Cont'd)

60	SMALL, DAVID A
61	TIMELINES
62	BARDEN, RUSSELL
	MARIA, B
	O'CONNELL, COLEEN
	PETTIT, L
63	JAMIESON, THOS B
	RAKIS, JOHN & ALEXIA
64	YE OLDE COIN SHOP
67	FAMILY WELLNESS CO-OPERATIVE THE
68	AMES J S FINE ART GALLERY
70	MIDCOAST REAL ESTATE-FAX
	MIDCOAST REAL ESTATE-OFC
71	B & M BUILDERS
	GREEN STORE THE
72	GOOD TABLE THE
74	MATZELL, N S
	WALDO-KNOX AIDS COALITION
75	DEAN, LINDA A
	DOWNEAST DIVERS
	GREENLAW, DONALD
	HOME SUPPLY CENTER
	KOLMENT, DENNIS
	TRUSTWORTHY STORE
76	CLASSIC LIMOUSINE
	JWD JEWELERS
	LARKIN, SHARON
81	COLBURN SHOE STORE-FROM BELFAST MONROE SEARSPORT
90	90 MAIN, BKRY
	COSTELLO, ROSEANN & MARK
	DUNN, KATHRYN
134	CAMDEN NATIONAL BANK
137	ARBOUR, DENNIS A
138	NICKERSON, PATRICIA E
147	MARRINER, KENNETH, SR
149	MANK, JOHN & JAN
151	WOOD, ALAN M
153	BRYANT, S M
	ELLIS, D A
	GOGUEN, DENICE
	MAINE COAST CONSULTING
	STEVENS, BEVERLEY
155	CONARY, WAYNE & DOROTHY
157	CUNNINGHAM, H
	STOVER, MARY L
159	BARROWS, LAWRENCE & LOIS
	ESTES, GEO R

BELMONT AVE 1992

1	STOVER, HENRY C
3	SINCLAIR, STEVEN
4	WATERMAN, JOHN
5	BROWN, HAROLD E
6	COLE, LAWRENCE & JUDITH
10	BROOKS, ADRIAN J
18	FLANDERS, DONALD E
27	BOUMAN, BETH A
29	CACADOR, KRISTINA
	GREENLEAF, ALLEN

MAIN ST 1992

13	FELIS, SALLY
14	HULBERT, WM T
15	MCGLAMERY, PETER
	SAVITZ, GAIL, STUDIO
25	KEMPTON, GAY
27	ROBERTSON, JANE
	SOLOMON, HARRY
48	PERKINS, JONATHAN
58	KERZNER, MICHAEL
59	FAULKNER, JOHN
	LLOYD, WAYNE
62	BILLINGS, JUNE C
	BRAY, NATHANAEL
	PARENT, STEVEN
	PETTIT, L
	ROCHE, KERRY
63	JAMIESON, THOS B
	PORTER, D S
71	BENTLEY, L
74	FREEMAN, ROSS
	FULLER, GLENN M
	KUZIO, M
75	MORSE, LESTER SAMUEL
	WAYNE, MICHAEL
76	PIERCE, J S
90	COSTELLO, ROSEANN & MARK
	GILLETTE, M CAROL
135	BRANDT, ELENA
	SLOCUM, C
137	BERRY, R A JR
	PYE, DOUGLAS
138	NICKERSON, PATRICIA E
147	MARRINER, KENNETH SR & ELLA
149	MANK, JOHN & JAN
	MCINTYRE, JEANNE
151	PETERMAN, RICHARD & DEBORA
153	PAGE, MICHELE
	STEVENS, BEVERLEY & EARL
	STEVENS, DOT
	WILSON, JOS
155	CONARY, WAYNE & DOROTHY
157	STEPHENS, ROBT W
159	BARROWS, LAWRENCE & LOIS
	ESTES, GEO R
161	DOYLE, RUSSELL T & BARBARA JOHNSON



EMDC Belfast Fire Sta

273 Main Street

Belfast, ME 04915

Inquiry Number: 7273839.4

March 08, 2023

EDR Historical Topo Map Report

with QuadMatch™



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Historical Topo Map Report

03/08/23

Site Name:

EMDC Belfast Fire Sta
273 Main Street
Belfast, ME 04915
EDR Inquiry # 7273839.4

Client Name:

Campbell Environmental Group
173 Gray Rd
Falmouth, ME 04105
Contact: Danica Kay



EDR Topographic Map Library has been searched by EDR and maps covering the target property location as provided by Campbell Environmental Group were identified for the years listed below. EDR's Historical Topo Map Report is designed to assist professionals in evaluating potential liability on a target property resulting from past activities. EDR's Historical Topo Map Report includes a search of a collection of public and private color historical topographic maps, dating back to the late 1800s.

Search Results:**Coordinates:**

P.O.#	0123-427-00/301	Latitude:	44.424651 44° 25' 29" North
Project:	EMDC Belfast Fire Station	Longitude:	-69.019758 -69° 1' 11" West
		UTM Zone:	Zone 19 North
		UTM X Meters:	498427.26
		UTM Y Meters:	4919039.84
		Elevation:	191.53' above sea level

Maps Provided:

2018	1915
2014	
1979	
1973	
1960	
1950	
1941	
1917	

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT.

ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT. Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2023 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

2018 Source Sheets



Belfast
2018
7.5-minute, 24000



Searsport
2018
7.5-minute, 24000

2014 Source Sheets



Belfast
2014
7.5-minute, 24000



Searsport
2014
7.5-minute, 24000

1979 Source Sheets



Belfast
1979
7.5-minute, 24000
Aerial Photo Revised 1973

1973 Source Sheets



Belfast
1973
7.5-minute, 24000
Aerial Photo Revised 1973



Searsport
1973
7.5-minute, 24000
Aerial Photo Revised 1970

Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.

1960 Source Sheets



Belfast
1960
7.5-minute, 24000
Aerial Photo Revised 1956

1950 Source Sheets



Belfast
1950
15-minute, 50000
Aerial Photo Revised 1940

1941 Source Sheets




Castine
1941
15-minute, 62500



Belfast
1941
15-minute, 62500

1917 Source Sheets

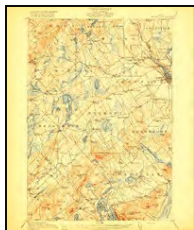

Belfast
1917
15-minute, 62500


Topo Sheet Key

This EDR Topo Map Report is based upon the following USGS topographic map sheets.



1915 Source Sheets



Belfast
1915
15-minute, 62500

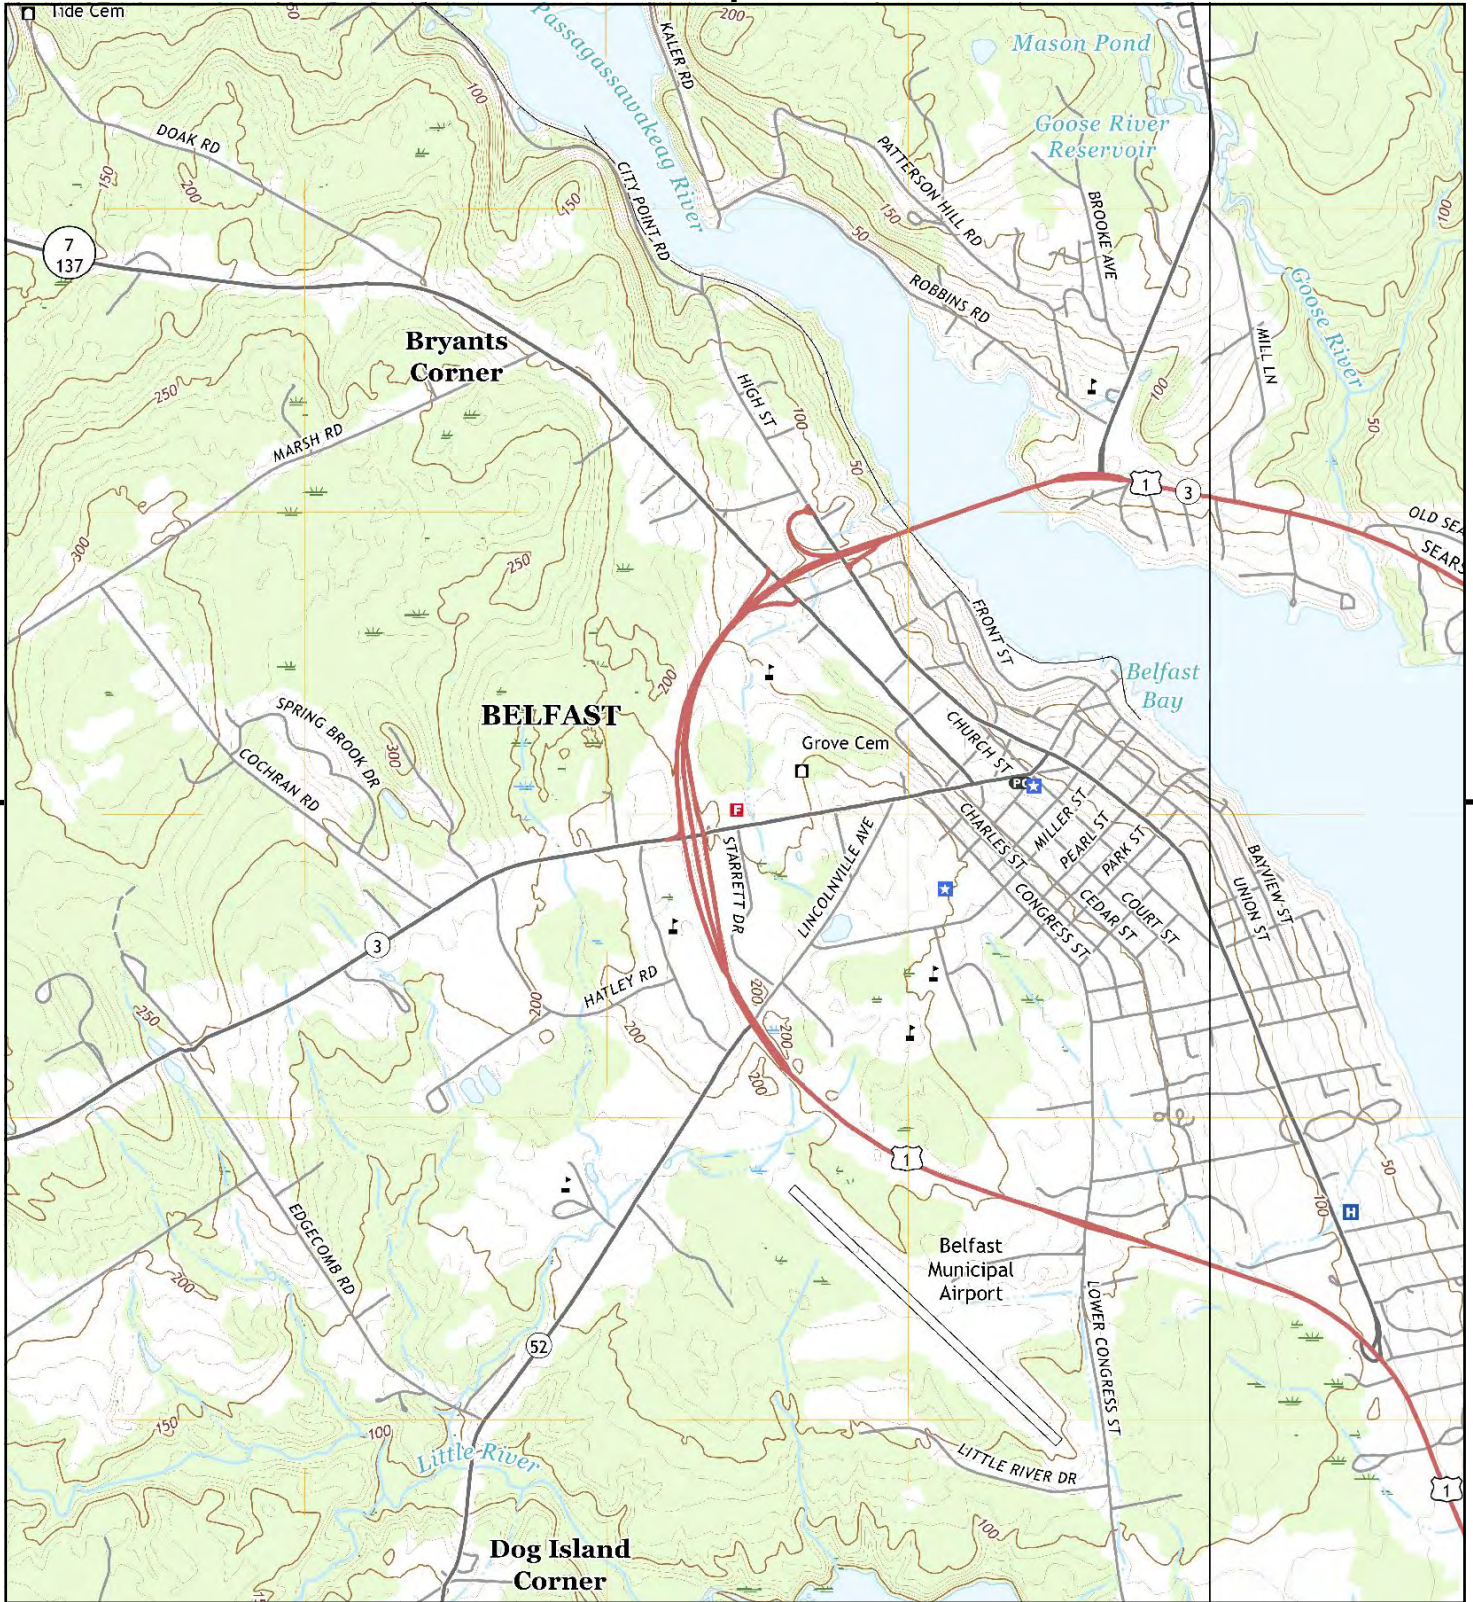

This report includes information from the following map sheet(s).

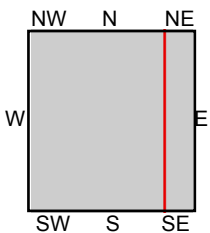


TP, Belfast, 2018, 7.5-minute
E, Searsville, 2018, 7.5-minute

SITE NAME: EMDC Belfast Fire Sta
ADDRESS: 273 Main Street
Belfast, ME 04915
CLIENT: Campbell Environmental Group






This report includes information from the following map sheet(s).

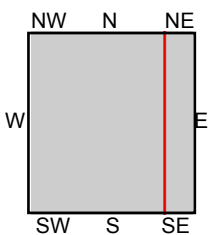



TP, Belfast, 2014, 7.5-minute
E, Searsport, 2014, 7.5-minute

SITE NAME: EMDC Belfast Fire Sta
ADDRESS: 273 Main Street
Belfast, ME 04915
CLIENT: Campbell Environmental Group



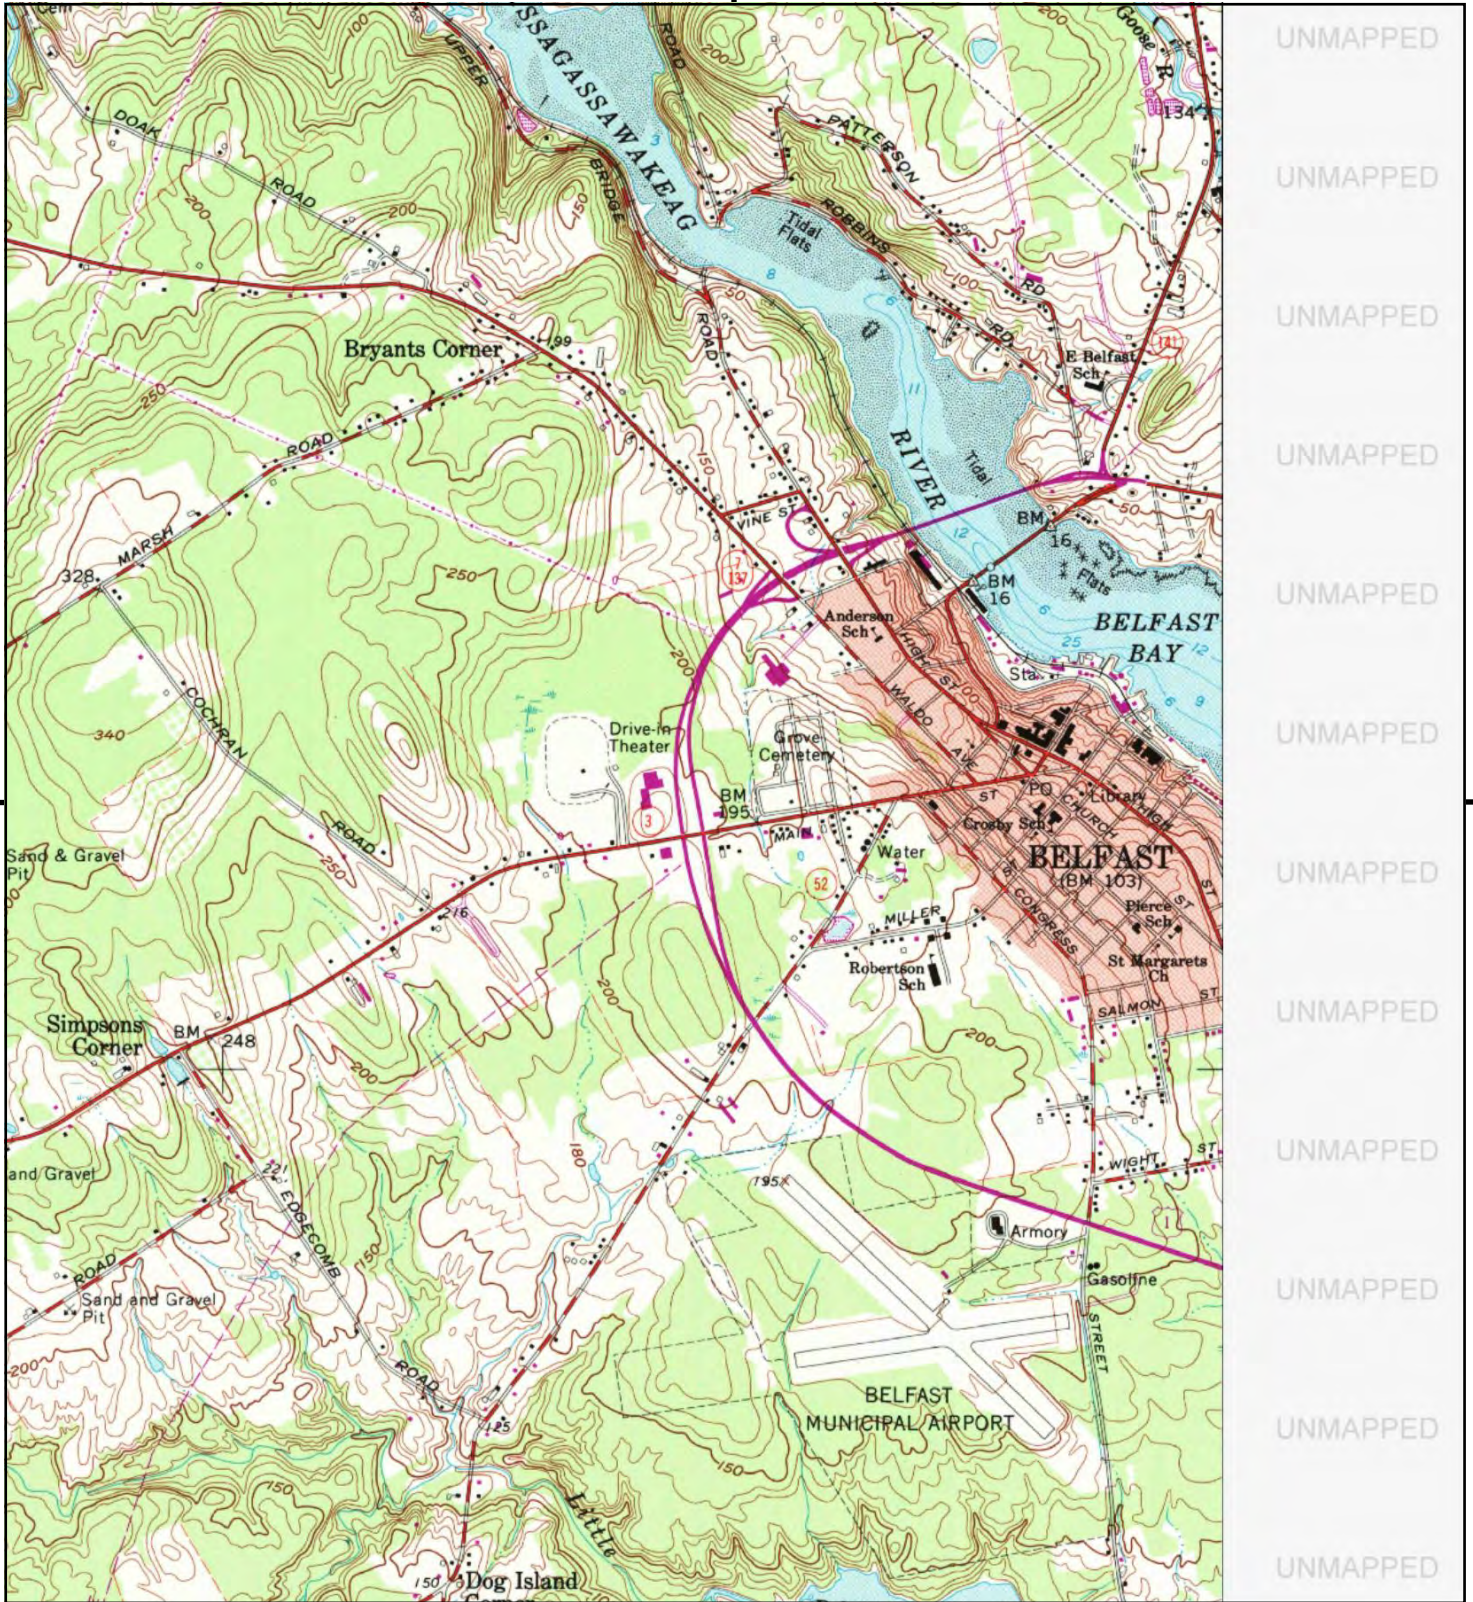


This report includes information from the following map sheet(s).

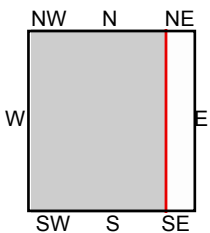


TP, Belfast, 1979, 7.5-minute

SITE NAME: EMDC Belfast Fire Sta
ADDRESS: 273 Main Street
Belfast, ME 04915
CLIENT: Campbell Environmental Group



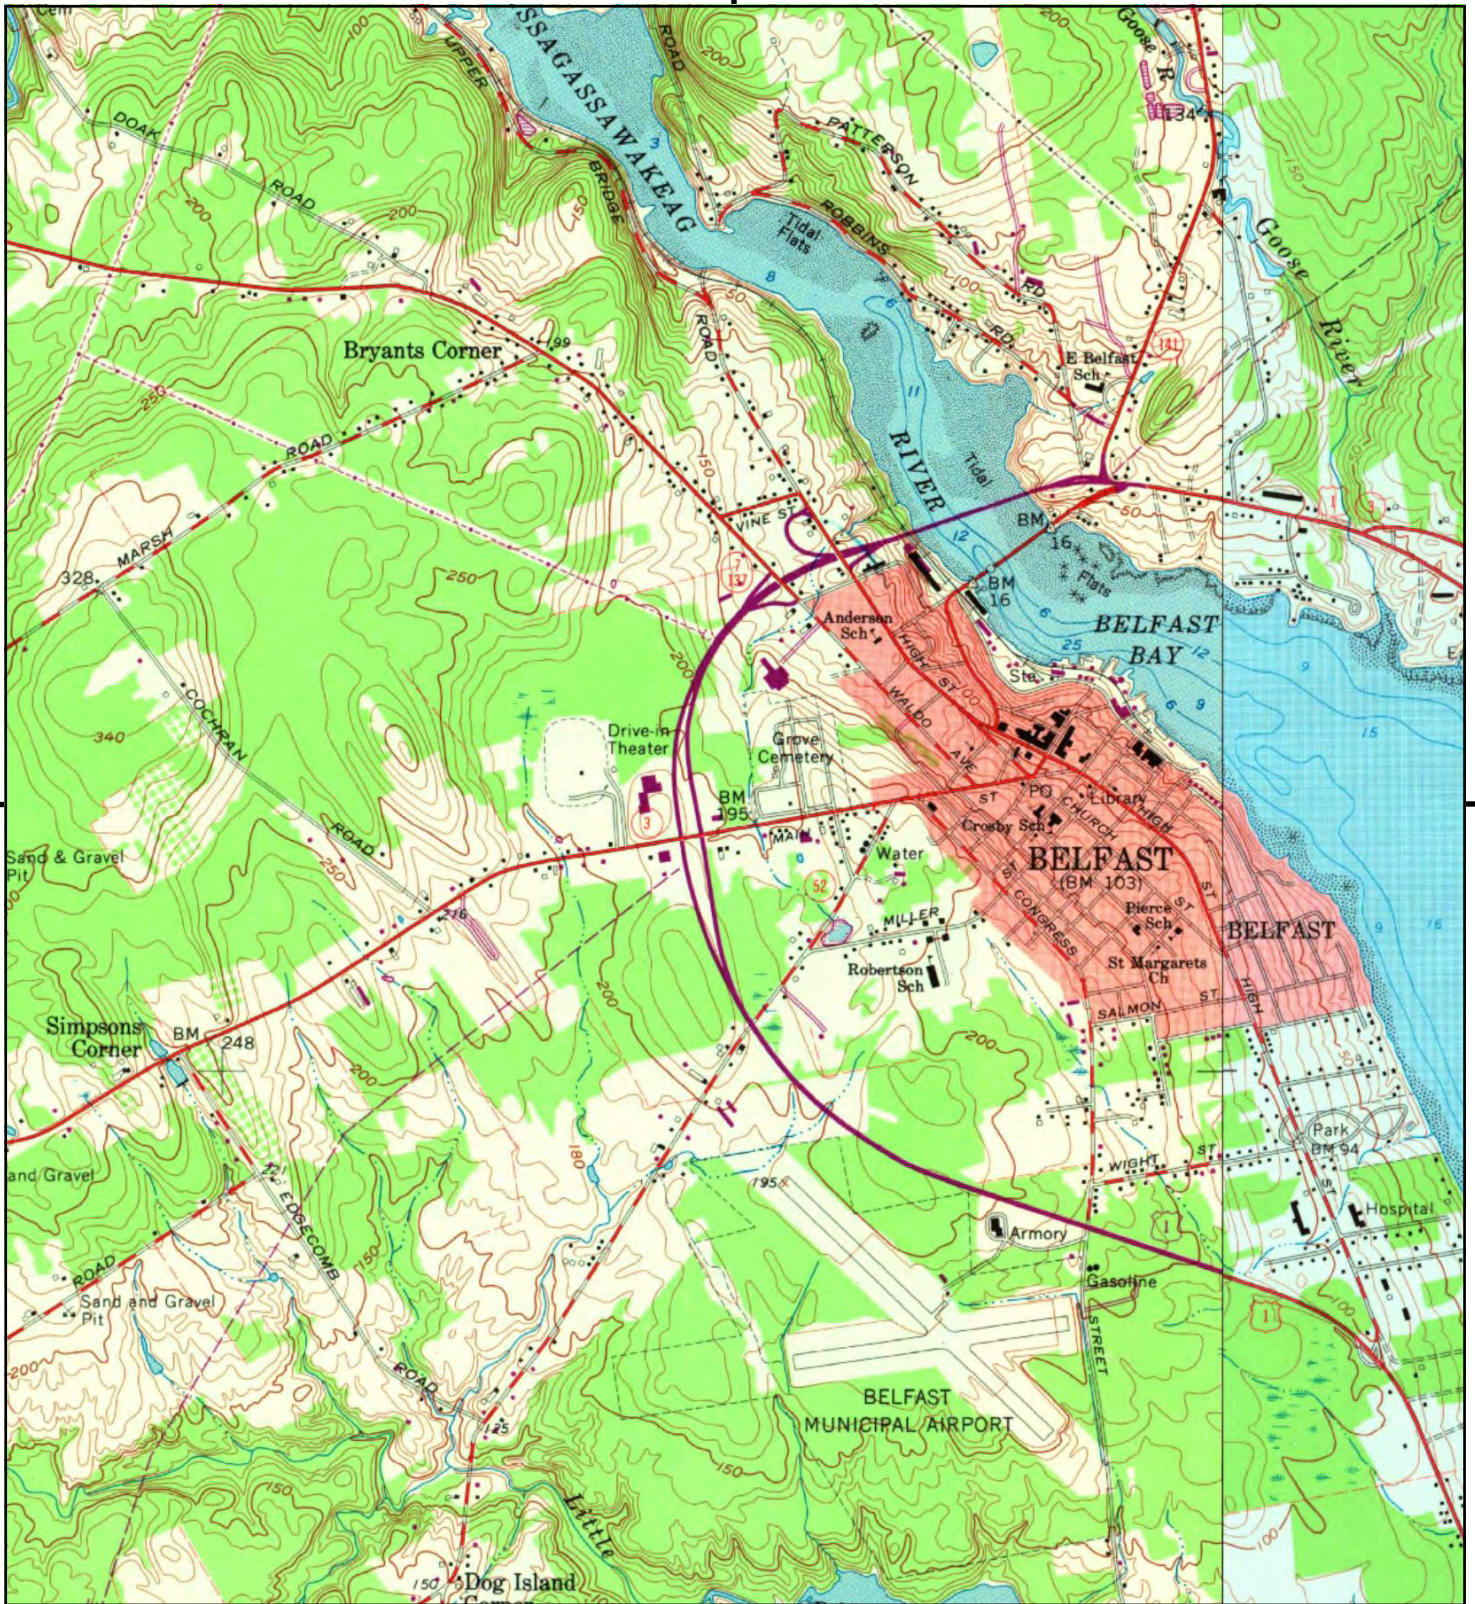


This report includes information from the following map sheet(s).

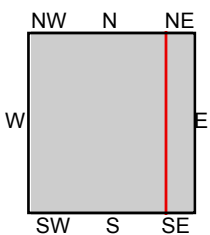



TP, Belfast, 1973, 7.5-minute
E, Searsport, 1973, 7.5-minute

SITE NAME: EMDC Belfast Fire Sta
ADDRESS: 273 Main Street
Belfast, ME 04915
CLIENT: Campbell Environmental Group



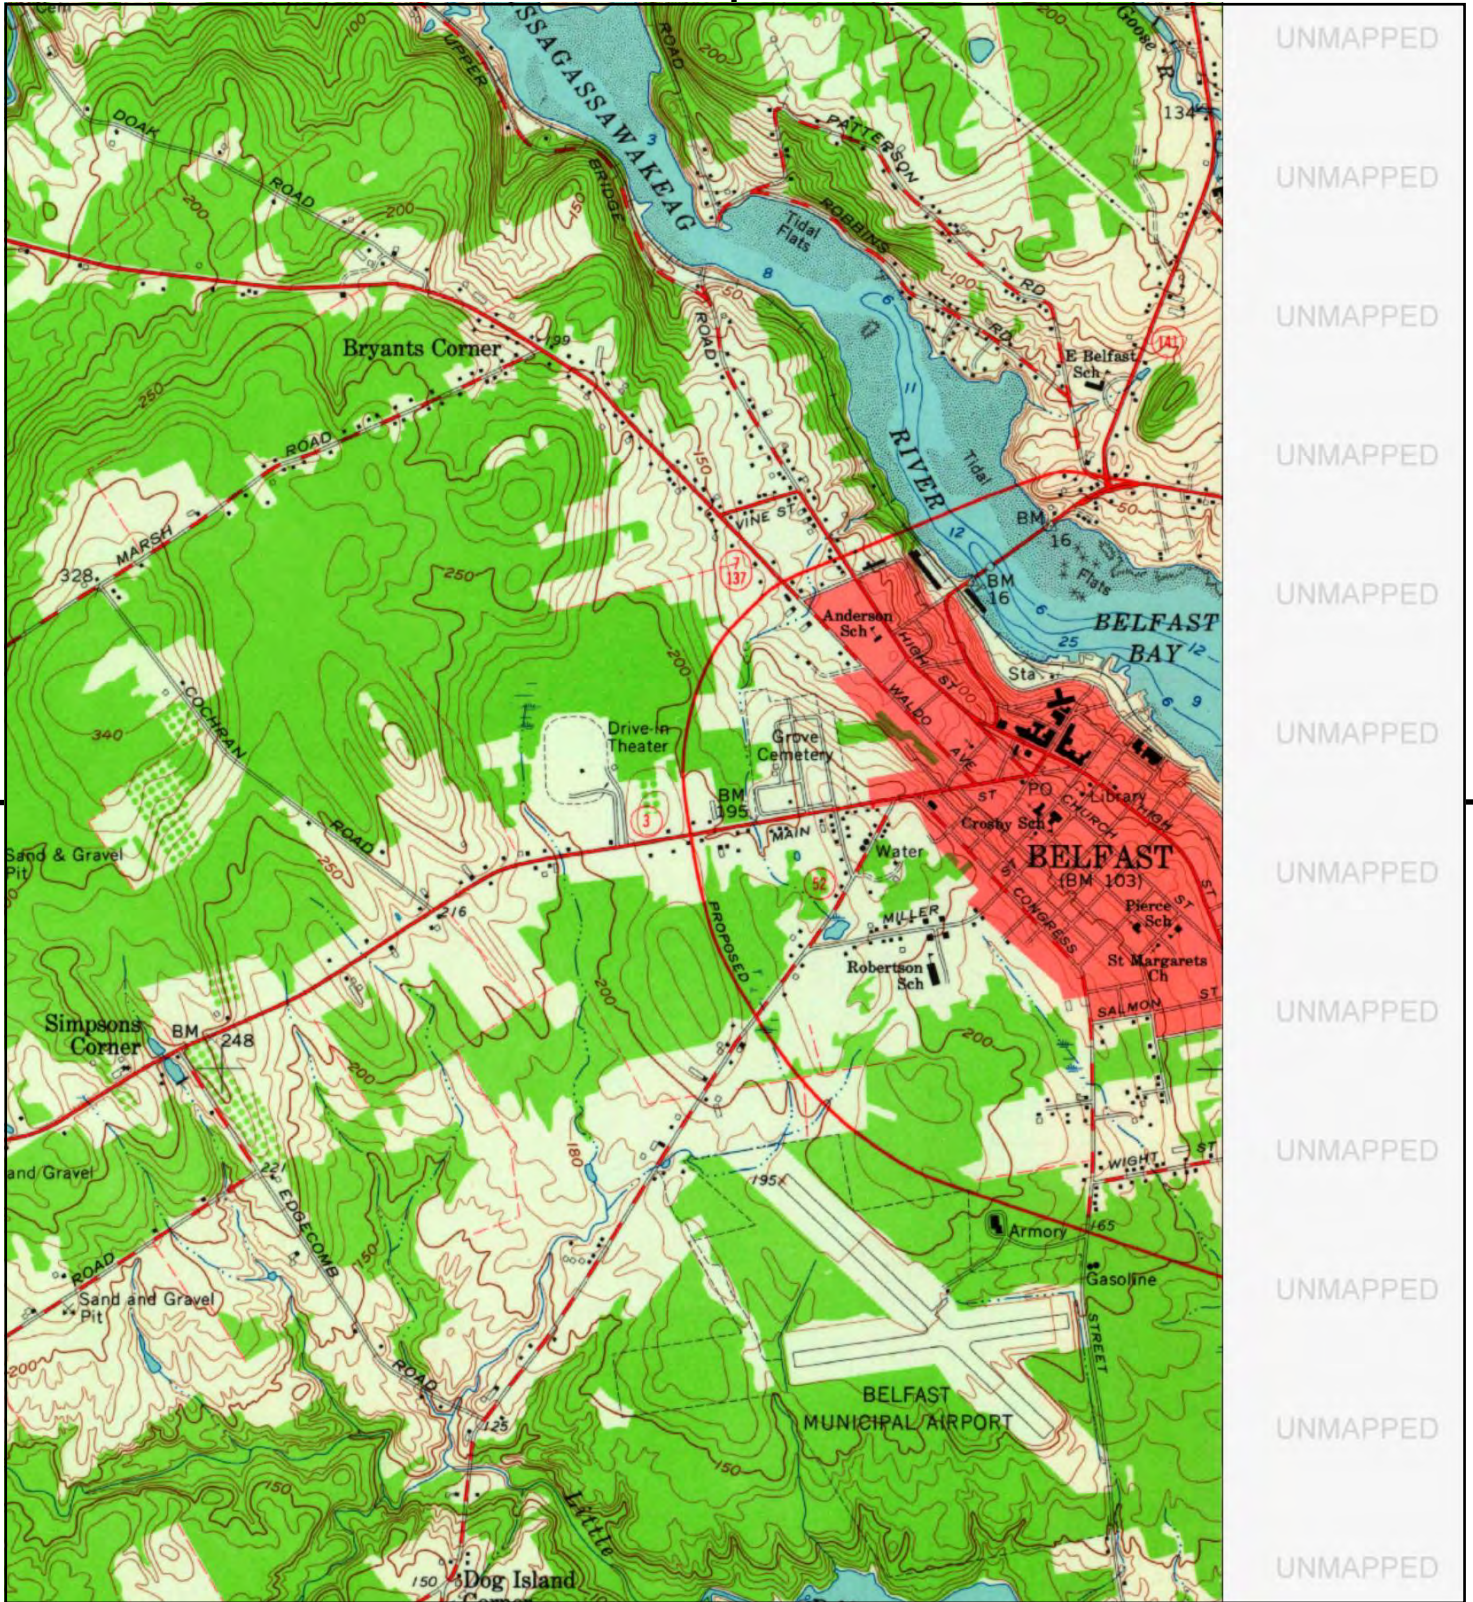


This report includes information from the following map sheet(s).

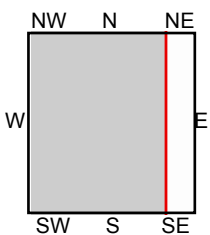



TP, Belfast, 1960, 7.5-minute

SITE NAME: EMDC Belfast Fire Sta
ADDRESS: 273 Main Street
Belfast, ME 04915
CLIENT: Campbell Environmental Group



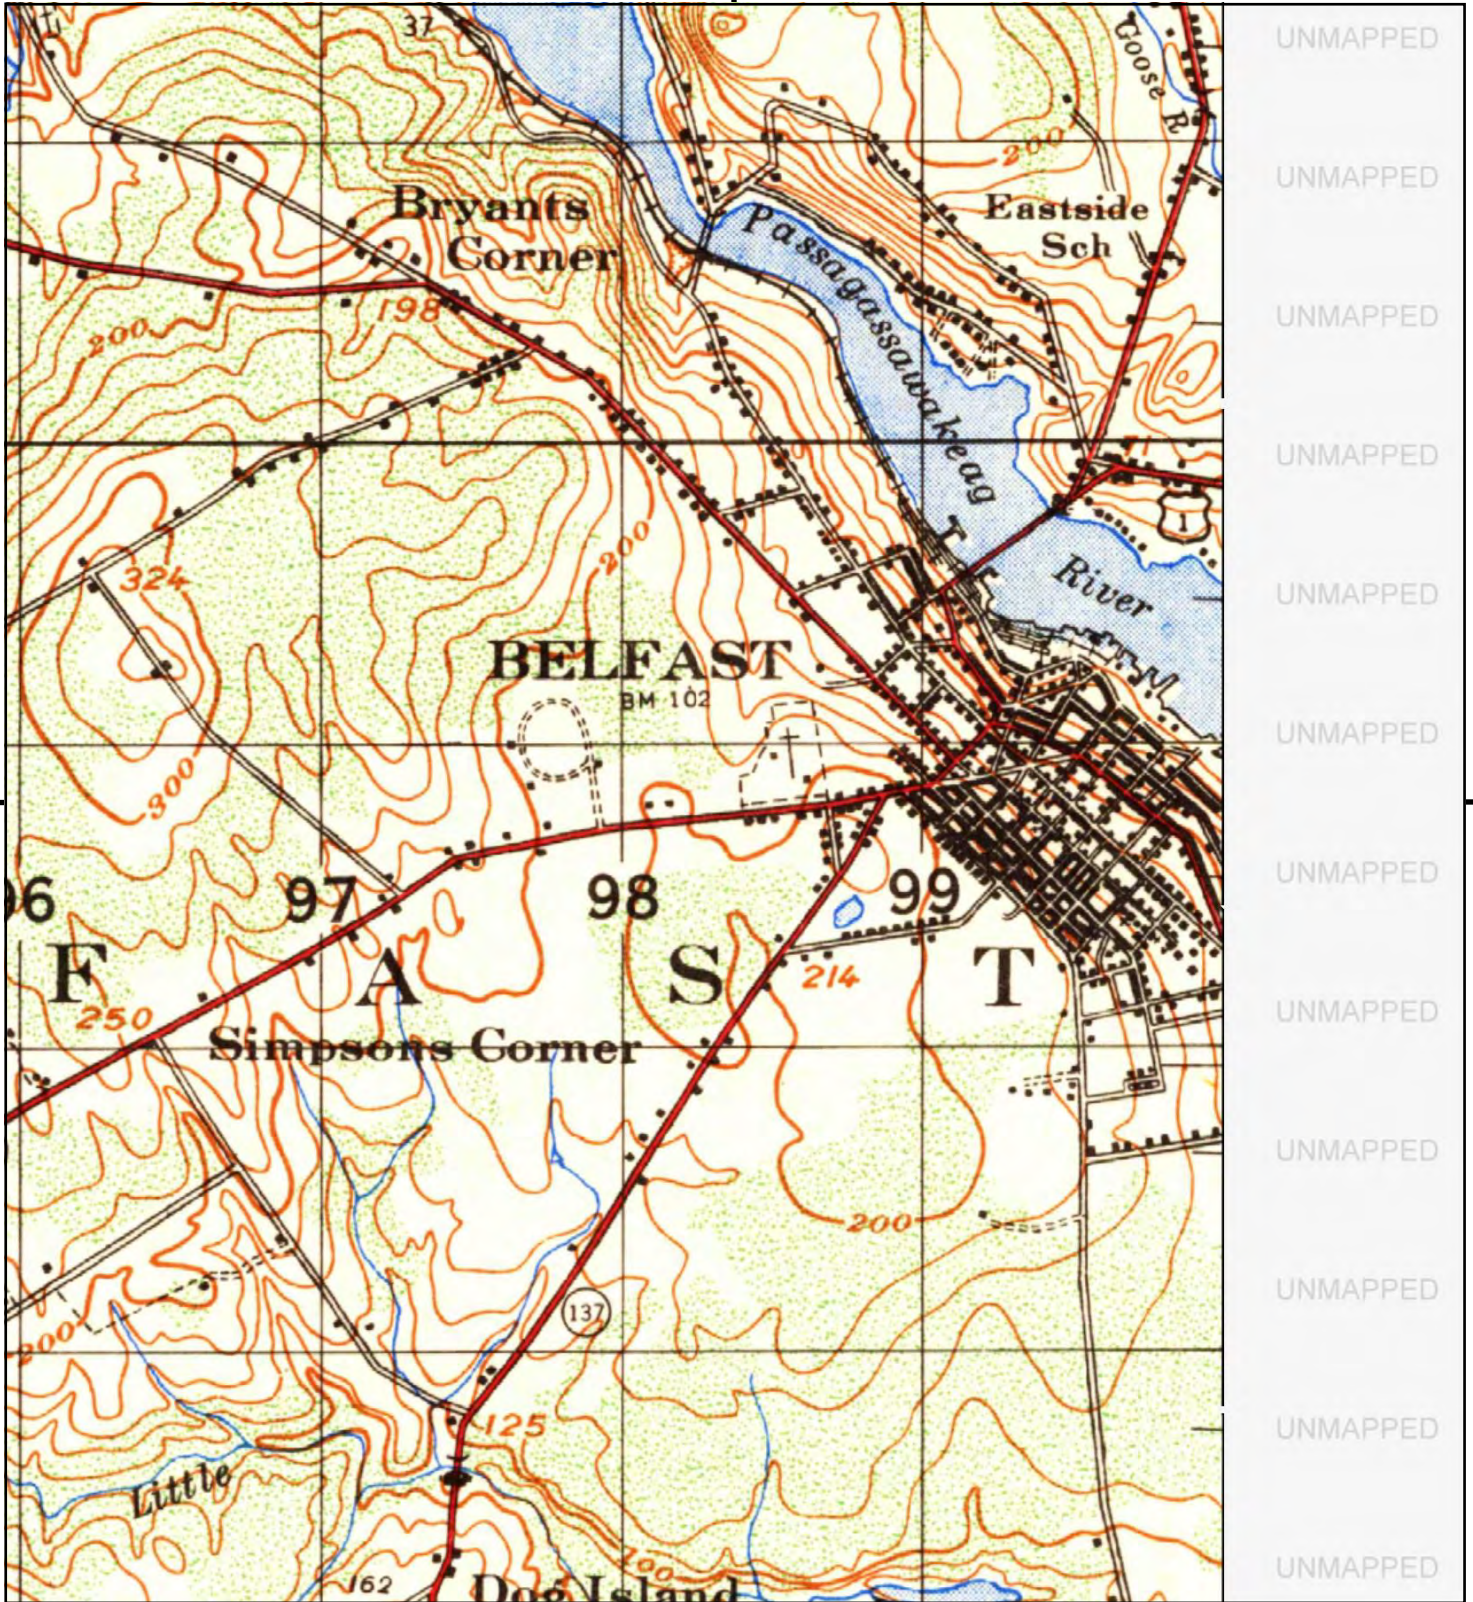


This report includes information from the following map sheet(s).

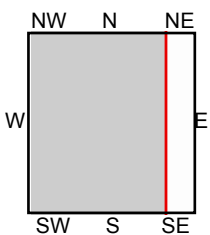



TP, Belfast, 1950, 15-minute

SITE NAME: EMDC Belfast Fire Sta
ADDRESS: 273 Main Street
Belfast, ME 04915
CLIENT: Campbell Environmental Group



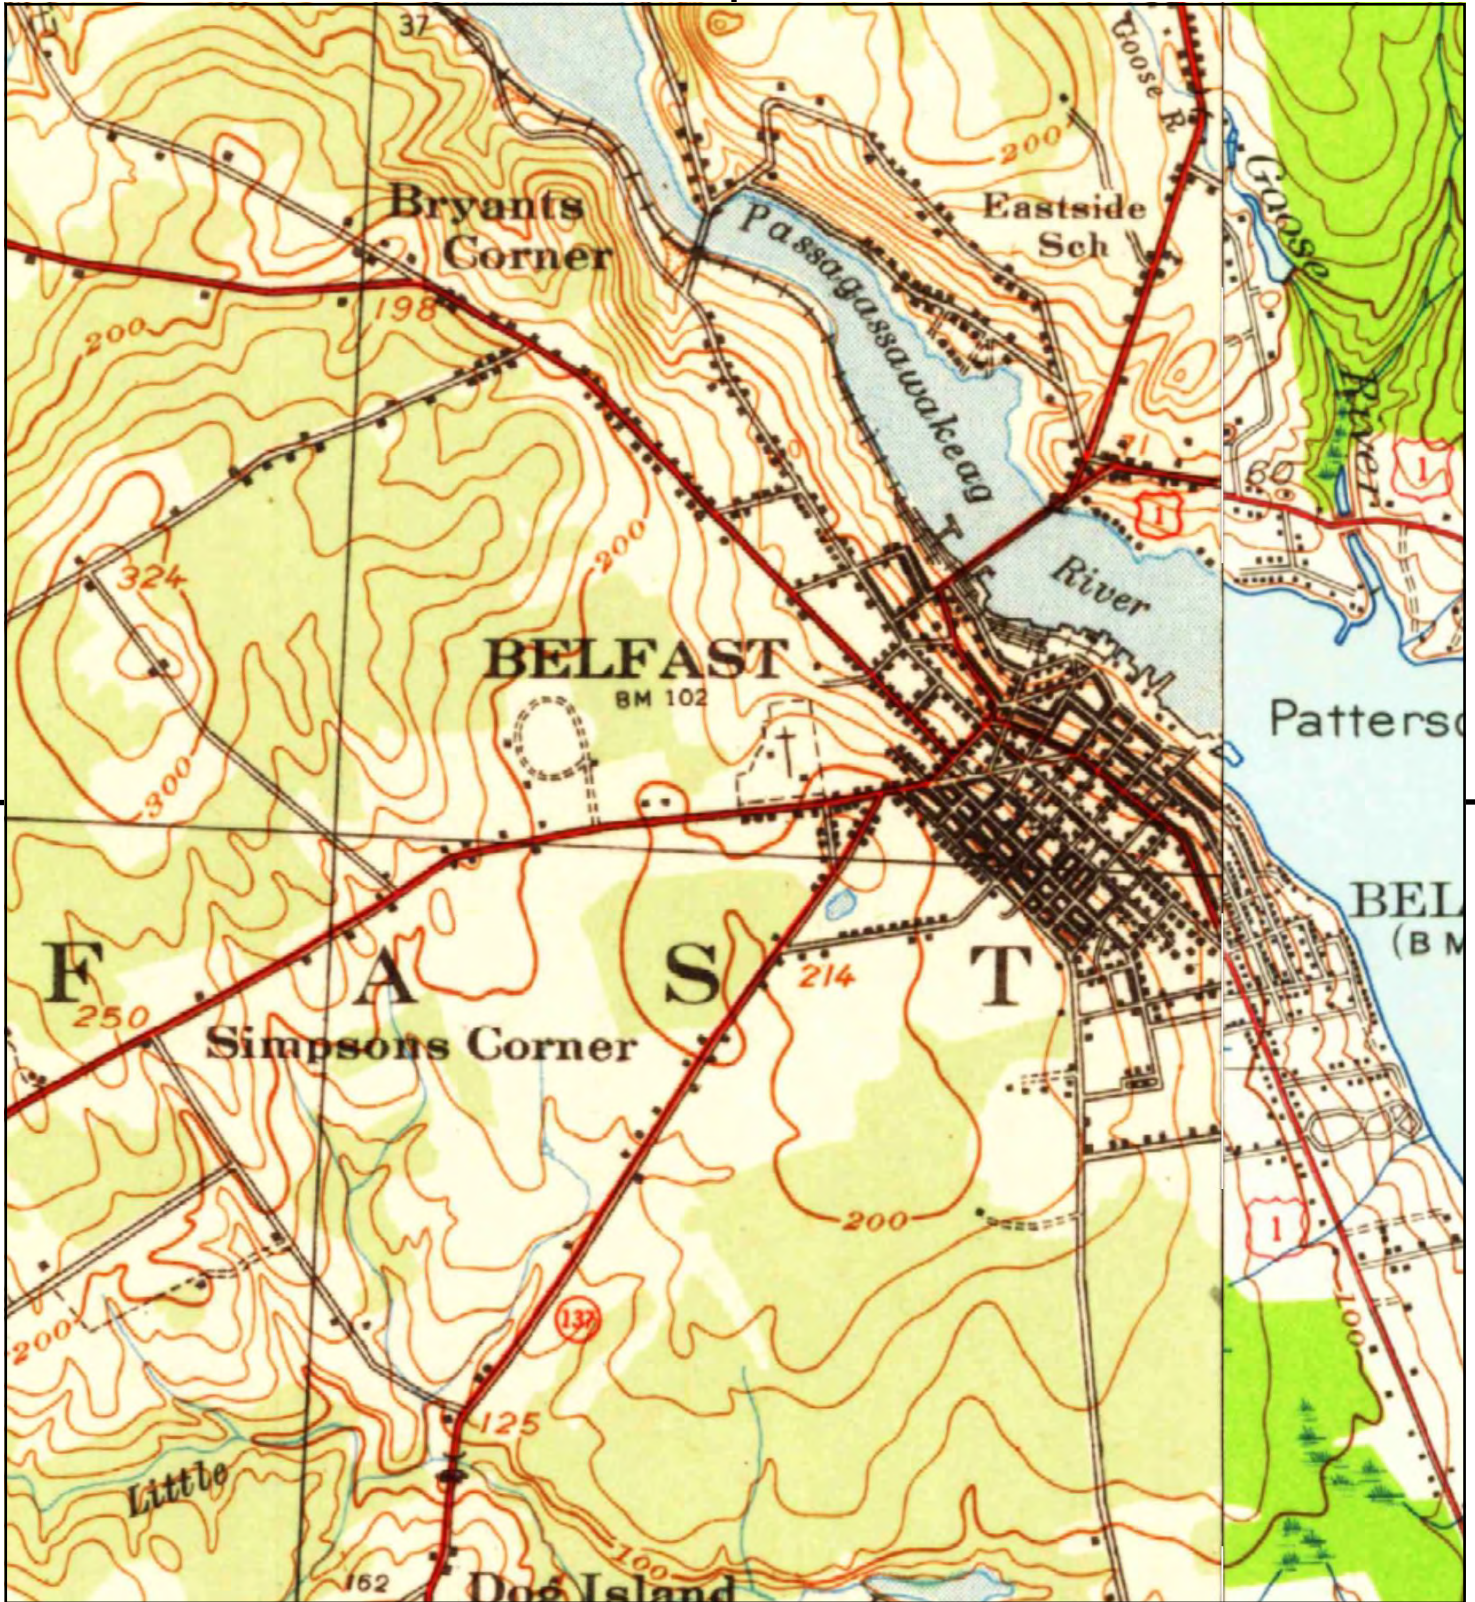


This report includes information from the following map sheet(s).

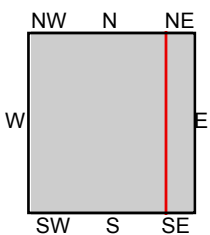

TP, Belfast, 1941, 15-minute
SE, Castine, 1941, 15-minute



SITE NAME: EMDC Belfast Fire Sta
ADDRESS: 273 Main Street
Belfast, ME 04915
CLIENT: Campbell Environmental Group



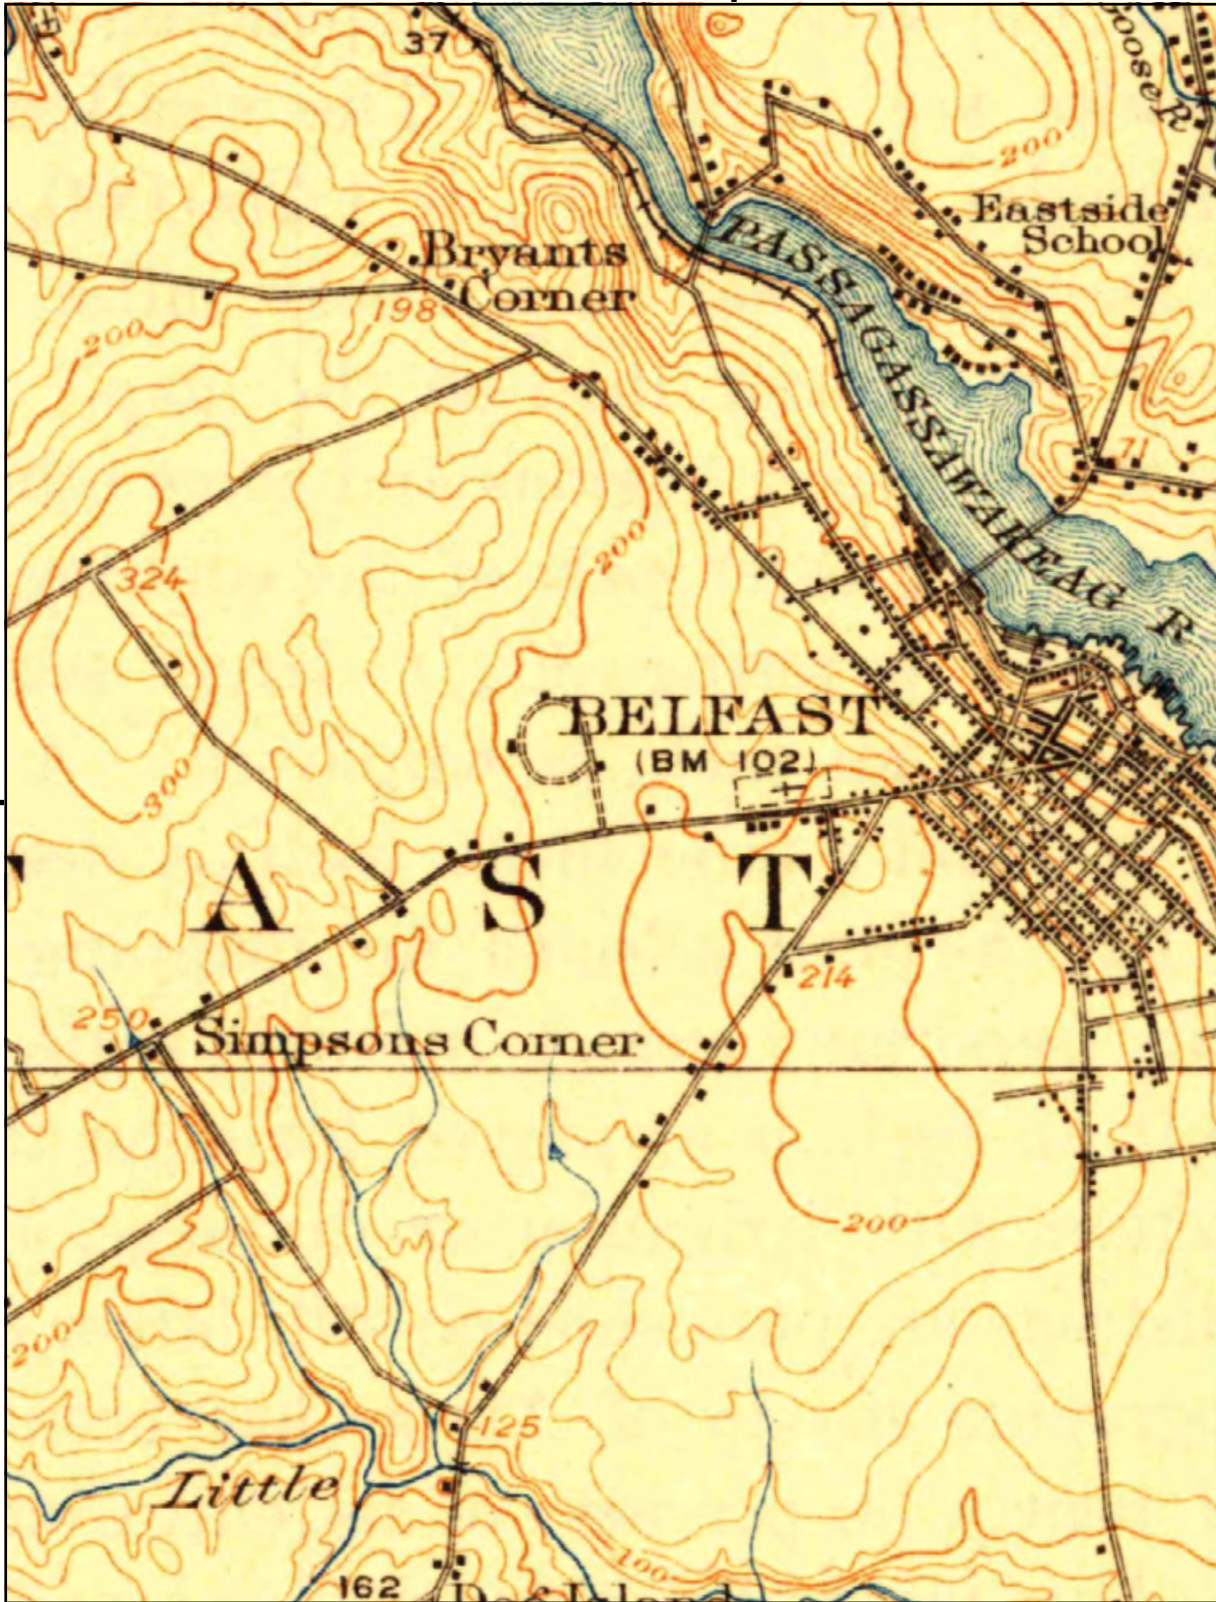

UNMAPPED
UNMAPPED
UNMAPPED
UNMAPPED
UNMAPPED
UNMAPPED
UNMAPPED
UNMAPPED
UNMAPPED
UNMAPPED


This report includes information from the following map sheet(s).

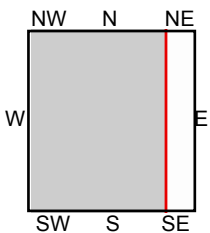



TP, Belfast, 1917, 15-minute

SITE NAME: EMDC Belfast Fire Sta
ADDRESS: 273 Main Street
Belfast, ME 04915
CLIENT: Campbell Environmental Group



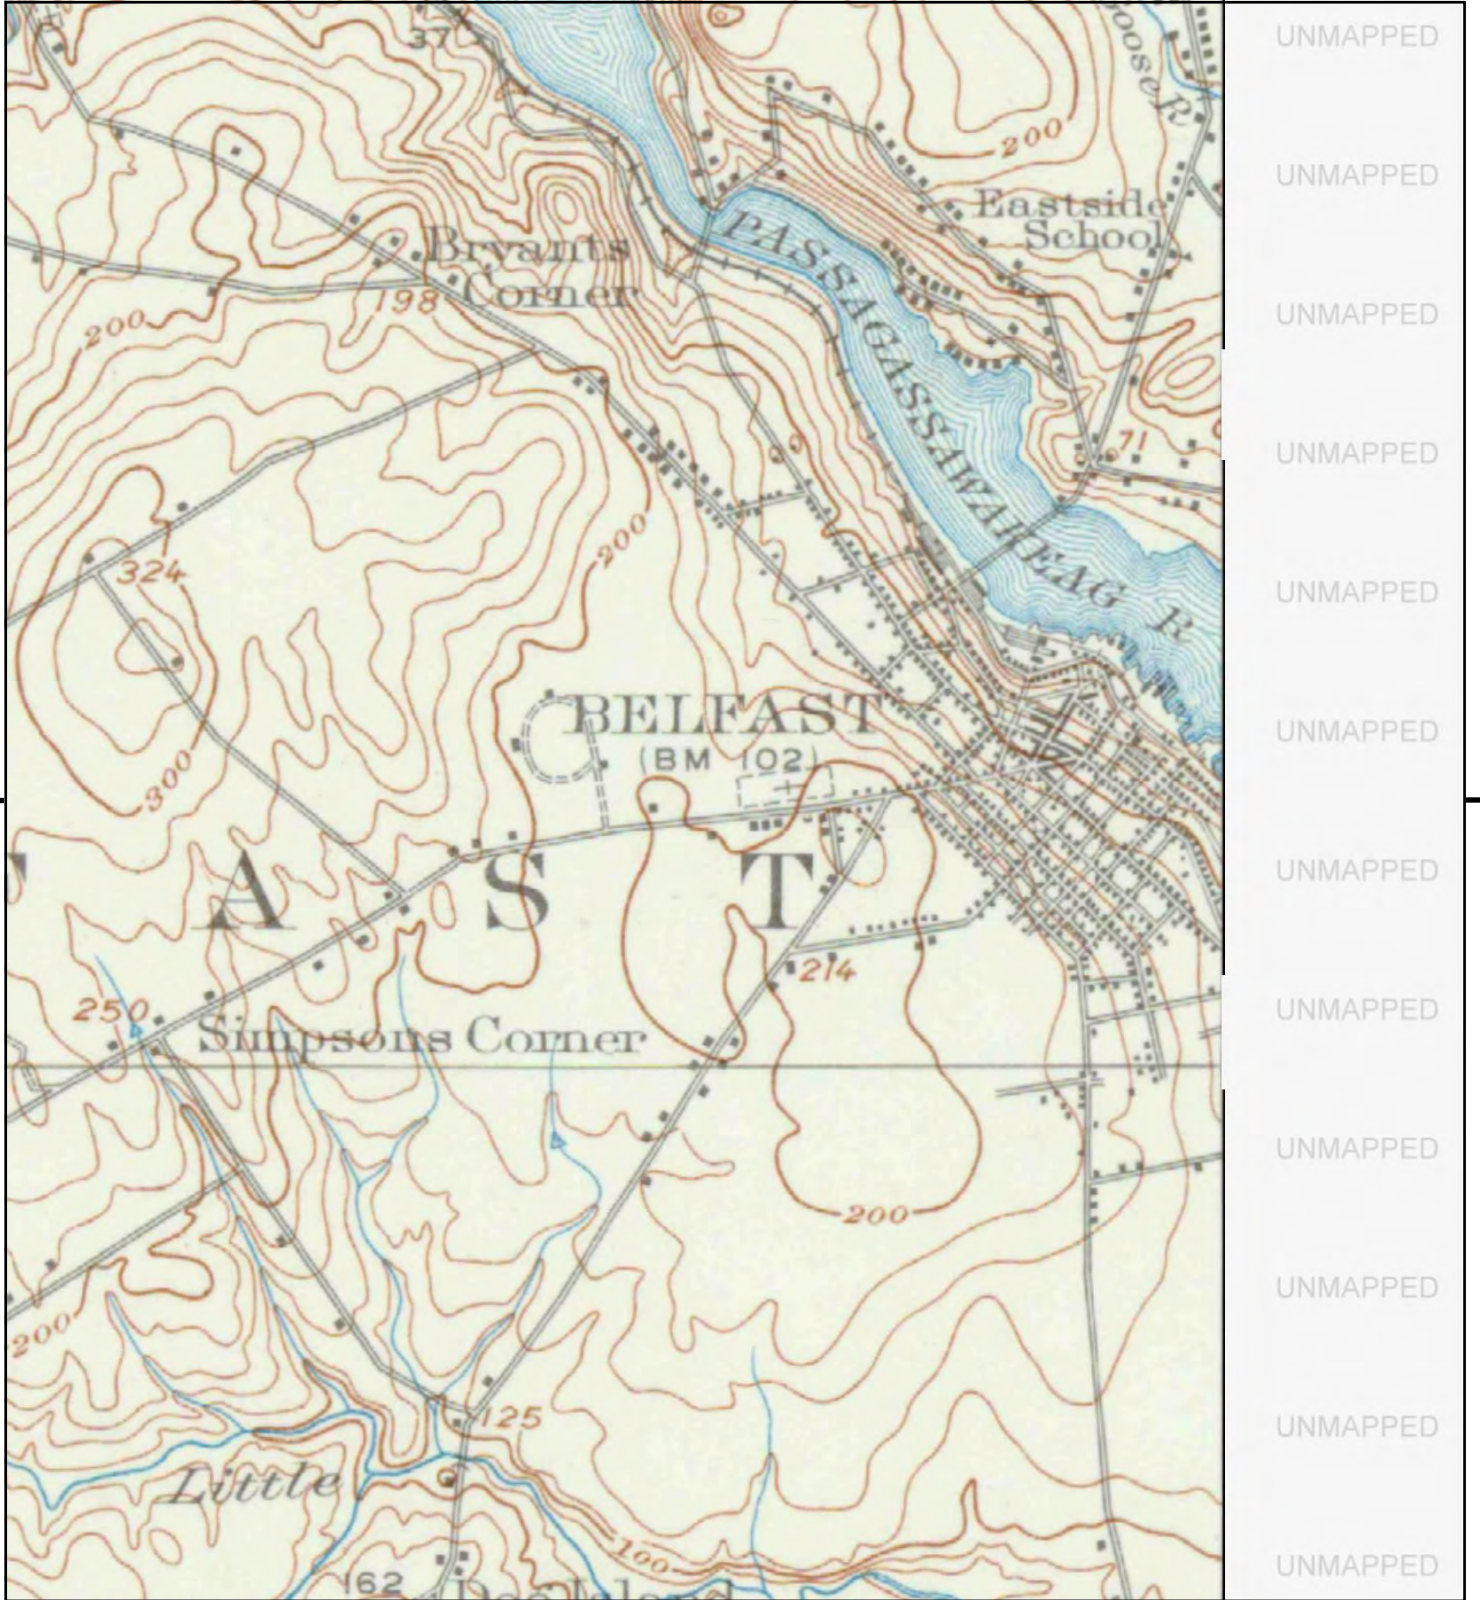

This report includes information from the following map sheet(s).

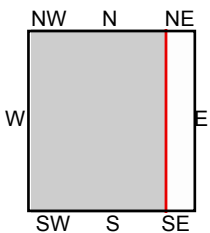

TP, Belfast, 1915, 15-minute

SITE NAME: EMDC Belfast Fire Sta
 ADDRESS: 273 Main Street
 Belfast, ME 04915
 CLIENT: Campbell Environmental Group



EMDC Belfast Fire Sta

273 Main Street

Belfast, ME 04915

Inquiry Number: 7273839.8

March 11, 2023

The EDR Aerial Photo Decade Package



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

EDR Aerial Photo Decade Package

03/11/23

Site Name:

EMDC Belfast Fire Sta
273 Main Street
Belfast, ME 04915
EDR Inquiry # 7273839.8

Client Name:

Campbell Environmental Group
173 Gray Rd
Falmouth, ME 04105
Contact: Danica Kay



Environmental Data Resources, Inc. (EDR) Aerial Photo Decade Package is a screening tool designed to assist environmental professionals in evaluating potential liability on a target property resulting from past activities. EDR's professional researchers provide digitally reproduced historical aerial photographs, and when available, provide one photo per decade.

Search Results:

<u>Year</u>	<u>Scale</u>	<u>Details</u>	<u>Source</u>
2018	1"=500'	Flight Year: 2018	USDA/NAIP
2011	1"=500'	Flight Year: 2011	USDA/NAIP
2007	1"=500'	Flight Year: 2007	USDA/NAIP
1996	1"=500'	Acquisition Date: May 09, 1996	USGS/DOQQ
1984	1"=500'	Flight Date: May 07, 1984	USDA
1973	1"=500'	Flight Date: May 08, 1973	USGS
1970	1"=500'	Flight Date: May 09, 1970	USGS
1960	1"=500'	Flight Date: June 01, 1960	USGS
1956	1"=500'	Flight Date: May 09, 1956	USGS

When delivered electronically by EDR, the aerial photo images included with this report are for ONE TIME USE ONLY. Further reproduction of these aerial photo images is prohibited without permission from EDR. For more information contact your EDR Account Executive.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT.

ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA), ARISING OUT OF OR IN ANY WAY CONNECTED WITH THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT. Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2023 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.



INQUIRY #: 7273839.8

YEAR: 2018

— = 500'





INQUIRY #: 7273839.8

YEAR: 2011

— = 500'





INQUIRY #: 7273839.8

YEAR: 2007

— = 500'





INQUIRY #: 7273839.8

YEAR: 1996

— = 500'





INQUIRY #: 7273839.8

YEAR: 1984

— = 500'





INQUIRY #: 7273839.8

YEAR: 1973

— = 500'





INQUIRY #: 7273839.8

YEAR: 1970

— = 500'





INQUIRY #: 7273839.8

YEAR: 1960

— = 500'





INQUIRY #: 7273839.8

YEAR: 1956

— = 500'



APPENDIX D
EDR Radius Report

EMDC Belfast Fire Sta

273 Main Street
Belfast, ME 04915

Inquiry Number: 7273839.2s
March 08, 2023

The EDR Radius Map™ Report with GeoCheck®



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	413
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-14
Physical Setting Source Map Findings	A-16
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, LLC. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. This Report is provided on an "AS IS", "AS AVAILABLE" basis. **NO WARRANTY EXPRESS OR IMPLIED IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, LLC AND ITS SUBSIDIARIES, AFFILIATES AND THIRD PARTY SUPPLIERS DISCLAIM ALL WARRANTIES, OF ANY KIND OR NATURE, EXPRESS OR IMPLIED, ARISING OUT OF OR RELATED TO THIS REPORT OR ANY OF THE DATA AND INFORMATION PROVIDED IN THIS REPORT, INCLUDING WITHOUT LIMITATION, ANY WARRANTIES REGARDING ACCURACY, QUALITY, CORRECTNESS, COMPLETENESS, COMPREHENSIVENESS, SUITABILITY, MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, TITLE, NON-INFRINGEMENT, MISAPPROPRIATION, OR OTHERWISE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, LLC OR ITS SUBSIDIARIES, AFFILIATES OR THIRD PARTY SUPPLIERS BE LIABLE TO ANYONE FOR ANY DIRECT, INCIDENTAL, INDIRECT, SPECIAL, CONSEQUENTIAL OR OTHER DAMAGES OF ANY TYPE OR KIND (INCLUDING BUT NOT LIMITED TO LOSS OF PROFITS, LOSS OF USE, OR LOSS OF DATA) INFORMATION PROVIDED IN THIS REPORT.** Any analyses, estimates, ratings, environmental risk levels, or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only an assessment performed by a qualified environmental professional can provide findings, opinions or conclusions regarding the environmental risk or conditions in, on or at any property.

Copyright 2023 by Environmental Data Resources, LLC. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, LLC, or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, LLC or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E1527-21), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E 2247-16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E 1528-14) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

273 MAIN STREET
BELFAST, ME 04915

COORDINATES

Latitude (North):	44.4246510 - 44° 25' 28.74"
Longitude (West):	69.0197580 - 69° 1' 11.12"
Universal Transverse Mercator:	Zone 19
UTM X (Meters):	498427.2
UTM Y (Meters):	4918823.0
Elevation:	192 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	11711344 BELFAST, ME
Version Date:	2018
East Map:	11700249 SEARSPORT, ME
Version Date:	2018

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	20150711
Source:	USDA

MAPPED SITES SUMMARY

Target Property Address:
273 MAIN STREET
BELFAST, ME 04915

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	AUTOZONE #3210	281 MAIN STREET	RCRA-VSQG	Higher	40, 0.008, SSW
B2	BELFAST TEXACO - WEB	BELMONT AVE	ME LUST	Higher	77, 0.015, WNW
B3	BELFAST TEXACO; WEBB	BELMONT AVE	ME LUST	Higher	77, 0.015, WNW
A4	C.N. BROWN COMPANY #	268 MAIN ST	ME AST, ME TIER 2	Higher	83, 0.016, SSE
A5	C N BROWN BULK PLANT	268 MAIN ST	ME LUST, ME LAST, ME SPILLS	Higher	83, 0.016, SSE
C6	MARITIME FARMS	262 MAIN STREET	ME LUST	Higher	108, 0.020, SE
C7	COASTAL SMOKESHOP-MA	262 MAIN ST	ME AST	Higher	108, 0.020, SE
C8	MARITIME ENERGY	262 MAIN ST	EDR Hist Auto	Higher	108, 0.020, SE
C9	COASTAL SMOKESHOP-MA	262 MAIN ST	ME UST	Higher	108, 0.020, SE
A10	C.N. BROWN / BIG APP	ROUTE 1	ME LUST	Higher	115, 0.022, South
A11	C N BROWN; BELFAST H	BELMONT AVE	ME LAST	Higher	115, 0.022, South
C12			ME LUST	Higher	129, 0.024, SE
C13	MARITIME FARMS 51	RT 3	ME UST, ME AST	Higher	132, 0.025, SE
A14	BIG APPLE BELFAST	BELMONT & STARRETT D	ME UST	Higher	203, 0.038, SSE
C15	BELFAST RITE AID	256 MAIN STREET	ME INST CONTROL, ME VCP, ME ALLSITES	Higher	215, 0.041, ESE
A16	HANNAFORD BELFAST #8	14 STARRETT DRIVE	ME AST, ME TIER 2	Higher	237, 0.045, South
A17	SHERWIN WILLIAMS CO	BELFAST SHPG CTR RT1	RCRA NonGen / NLR	Higher	255, 0.048, SW
A18	FLEET BANK	JCT RT 1 BY PASS & R	ME UST	Higher	255, 0.048, SW
A19	DUTCH CHEVROLET, BUI	6 BELMONT AVENUE	RCRA-VSQG, RI MANIFEST	Higher	255, 0.048, SW
A20	MAINE PROPANE ENERGY	15 STARRET DRIVE	ME AST	Higher	258, 0.049, South
A21	SHERWIN-WILLIAMS #51	15A STARRETT DT	RCRA-VSQG, RI MANIFEST	Higher	262, 0.050, South
C22	RITE AID #04149	254 MAIN STREET	ME ALLSITES	Higher	262, 0.050, ESE
C23	DBA RITE AID #04149	254 MAIN STREET	RCRA NonGen / NLR, FINDS, ECHO	Higher	262, 0.050, ESE
D24	MERRILL'S POWER WASH	26 STARRETT DRIVE	US BROWNFIELDS	Higher	380, 0.072, South
E25	C.N. BROWN	INT. RT 1 AND RT 3	ME LAST	Higher	388, 0.073, SW
D26	XPRESS LUBE	30 STARRETT DR	EDR Hist Auto	Higher	428, 0.081, South
D27	TEXACO, XPRESS LUBE	35 STARRET DR.	ME LAST	Higher	491, 0.093, South
F28	BENNERS AUTO SVC	BELMONT AVE	ME UST	Higher	544, 0.103, ESE
F29	POULTRY BARN	BELMONT AVE	ME UST	Higher	544, 0.103, ESE
F30	GRASS, MERLE A	BELMONT AVE	ME UST	Higher	544, 0.103, ESE
F31	KALLIS FORD	BELMONT AVE	ME UST	Higher	544, 0.103, ESE
F32	SEACOAST GROCERY	BELMONT AVE	ME UST	Higher	544, 0.103, ESE
F33	MOLLISONS INC	BELMONT AVE	ME UST	Higher	544, 0.103, ESE
F34	MAWHINNEY, DORIS	BELMONT AVE	ME UST	Higher	544, 0.103, ESE
E35	R.H. RENY, INC.	1 BELMONT AVE	ME AST, ME TIER 2	Higher	612, 0.116, WSW
G36	DUTCH CHEVROLET	6 BELMONT AVE	ME MANIFEST	Higher	680, 0.129, WSW
G37	DUTCH CHEVROLET BUIC	6 BELMONT AVE	ME AST, ME ALLSITES, ME TIER 2	Higher	680, 0.129, WSW
G38	DUTCH CHEV OLDS BUIC	JCT RTS 1 & 3	ME UST	Higher	768, 0.145, SW
H39	CHARLES BOYNTON	11 BELMONT AVE	ME LAST	Higher	1003, 0.190, WSW

MAPPED SITES SUMMARY

Target Property Address:
273 MAIN STREET
BELFAST, ME 04915

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
40			ME LUST	Higher	1128, 0.214, WSW
H41	BANK OF AMERICA / MB	1 HATLEY ROAD	ME AST, ME TIER 2	Higher	1174, 0.222, WSW
H42	ATHENAHEALTH INC	1 HATLEY RD	ME UST	Higher	1174, 0.222, WSW
H43	MBNA NEW ENGLAND BEL	1 HATLEY RD	ME AST	Higher	1174, 0.222, WSW
H44	MBNA BELFAST FLEET B	1 HATLEY RD	ME UST	Higher	1174, 0.222, WSW
H45	ATHENAHEALTH, INC.	3 HATLEY RD	ME AST, ME AIRS, ME TIER 2	Higher	1196, 0.227, WSW
H46	ATHEANAHEALTH INC	3 HATLEY RD	ME UST	Higher	1196, 0.227, WSW
47	CRONIN	216 MAIN STREET	ME LAST	Higher	1201, 0.227, East
I48	NICKERSON'S EXXON	ROUTE 3	ME LUST	Higher	1752, 0.332, WSW
J49	MCTAGGART APARTMENT	60 WALDO AVENUE	ME LAST	Lower	1754, 0.332, NE
I50	NICKERSONS EXXON	25 BELMONT AVE	ME LUST, ME UST	Higher	1771, 0.335, WSW
J51	KNIGHT KATHLEEN	67 WALDO AVE	ME LUST	Lower	1771, 0.335, NE
K52	MSAD 34 (BELFAST HIG	P.O. BOX 363	ME LUST	Lower	1835, 0.348, NNE
K53	RSU 20 BELFAST AREA	98 WALDO AVE	ME LAST, ME AST, ME TIER 2	Lower	1840, 0.348, NNE
54	THE AMBASSADOR	6 CONGRESS STREET	ME LAST	Lower	1872, 0.355, East
I55	29 BELMONT AVE. (FOR	29 BELMONT AVENUE	US BROWNFIELDS, FINDS	Higher	1917, 0.363, WSW
I56	EXXON STATION (29 BE	29 BELMONT AVE	ME VCP, ME BROWNFIELDS, ME ALLSITES	Higher	1917, 0.363, WSW
L57	MARITIME ENERGY	BELMONT AVENUE STORE	ME LUST	Higher	2032, 0.385, WSW
L58	MARITIME FARMS	32 BELMONT AVENUE	ME LUST	Higher	2101, 0.398, WSW
59	DANWELL RESIDENCE	133 MILLER STREET	ME LAST	Higher	2128, 0.403, SE
60	CONSOLIDATED COMMUNI	19 WALDO AVENUE	ME LUST	Lower	2173, 0.412, ENE
M61	WATERFALL ARTS	256 HIGH STREET	US BROWNFIELDS, FINDS	Lower	2203, 0.417, NE
M62	WATERFALL ARTS	256 HIGH STREET	ME INST CONTROL, ME VCP, ME BROWNFIELDS, ME...	Lower	2203, 0.417, NE
M63	WATERFALL ARTS	256 HIGH ST	ME LUST, ME UST, ME TIER 2	Lower	2203, 0.417, NE
N64	MSAD # 34/BELFAST HI	8 WALDO STREET	ME LUST	Lower	2285, 0.433, East
N65	RSU 20 BUS GARAGE	6A WALDO AVE	ME LUST	Lower	2285, 0.433, East
66	BELFAST HEADSTART	275 HIGH STREET	ME LAST	Lower	2378, 0.450, NNE
O67	WENTWORTH FAMILY QWI	142 WALDO AVENUE	ME LAST, ME LUST	Lower	2425, 0.459, North
68	GEO S ROBINSON SCHOO	HIGH STREET	ME LUST	Higher	2452, 0.464, SE
69	BELFAST-MOOSEHEAD LA	11 WATER STREET	SEMS-ARCHIVE	Lower	2467, 0.467, ENE
70	PELLERITI RENTAL PRO	38 FRANKLIN STREET	ME LAST	Lower	2495, 0.473, East
O71	BELFAST FAMILY PLANN	147 WALDO AVENUE	ME LAST	Lower	2541, 0.481, North
P72	OLD WALDO COUNTY JAI	45 CONGRESS STREET	US BROWNFIELDS, FINDS	Lower	2557, 0.484, ESE
P73	WALDO COUNTY JAIL	45 CONGRESS STREET	ME LAST, ME LUST	Lower	2557, 0.484, ESE
P74	WALDO COUNT JAIL COM	45/45A CONGRESS STRE	ME INST CONTROL, ME VCP, ME BROWNFIELDS, ME...	Lower	2557, 0.484, ESE
75	EM BEE CLEANERS	126 CHURCH STREET	ME SHWS, ME VCP, ME ALLSITES, ME DRYCLEANERS	Lower	2970, 0.562, East
76	FSS, INC.	101 FRONT ST	ME SHWS, ME INST CONTROL, ME VCP, ME BROWNFIELDS,	Lower	3049, 0.577, ENE
77	BELFAST GAS LIGHT CO	MARKET STREET	EDR MGP	Lower	3120, 0.591, ENE
78	BELFAST-MOOSEHEAD RA	11 WATER STREET	ME SHWS, ME ALLSITES	Lower	3297, 0.624, ENE

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was not listed in any of the databases searched by EDR.

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens

Lists of Federal Delisted NPL sites

Delisted NPL..... National Priority List Deletions

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY..... Federal Facility Site Information listing
SEMS..... Superfund Enterprise Management System

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS..... Corrective Action Report

Lists of Federal RCRA TSD facilities

RCRA-TSDF..... RCRA - Treatment, Storage and Disposal

Lists of Federal RCRA generators

RCRA-LQG..... RCRA - Large Quantity Generators
RCRA-SQG..... RCRA - Small Quantity Generators

Federal institutional controls / engineering controls registries

LUCIS..... Land Use Control Information System
US ENG CONTROLS..... Engineering Controls Sites List
US INST CONTROLS..... Institutional Controls Sites List

Federal ERNS list

ERNS..... Emergency Response Notification System

EXECUTIVE SUMMARY

Lists of state and tribal landfills and solid waste disposal facilities

ME SWF/LF..... Solid Waste Facility List
ME LCP..... Municipal Landfill Closure Database

Lists of state and tribal leaking storage tanks

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

Lists of state and tribal registered storage tanks

FEMA UST..... Underground Storage Tank Listing
INDIAN UST..... Underground Storage Tanks on Indian Land

Lists of state and tribal voluntary cleanup sites

INDIAN VCP..... Voluntary Cleanup Priority Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

ME SWRCY..... Recycling Facilities
INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands
ODI..... Open Dump Inventory
DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations
IHS OPEN DUMPS..... Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL..... Delisted National Clandestine Laboratory Register
ME DEL SHWS..... Sites Removed from the Uncontrolled Sites List
US CDL..... National Clandestine Laboratory Register

Local Land Records

ME LIENS..... Environmental Liens Information Listing
LIENS 2..... CERCLA Lien Information

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System
ME SPILLS 90..... SPILLS 90 data from FirstSearch
ME SPILLS 80..... SPILLS 80 data from FirstSearch

Other Ascertainable Records

FUDS..... Formerly Used Defense Sites
DOD..... Department of Defense Sites
SCRD DRYCLEANERS..... State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR..... Financial Assurance Information
EPA WATCH LIST..... EPA WATCH LIST
2020 COR ACTION..... 2020 Corrective Action Program List

EXECUTIVE SUMMARY

TSCA.....	Toxic Substances Control Act
TRIS.....	Toxic Chemical Release Inventory System
SSTS.....	Section 7 Tracking Systems
ROD.....	Records Of Decision
RMP.....	Risk Management Plans
RAATS.....	RCRA Administrative Action Tracking System
PRP.....	Potentially Responsible Parties
PADS.....	PCB Activity Database System
ICIS.....	Integrated Compliance Information System
FTTS.....	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
MLTS.....	Material Licensing Tracking System
COAL ASH DOE.....	Steam-Electric Plant Operation Data
COAL ASH EPA.....	Coal Combustion Residues Surface Impoundments List
PCB TRANSFORMER.....	PCB Transformer Registration Database
RADINFO.....	Radiation Information Database
HIST FTTS.....	FIFRA/TSCA Tracking System Administrative Case Listing
DOT OPS.....	Incident and Accident Data
CONSENT.....	Superfund (CERCLA) Consent Decrees
INDIAN RESERV.....	Indian Reservations
FUSRAP.....	Formerly Utilized Sites Remedial Action Program
UMTRA.....	Uranium Mill Tailings Sites
LEAD SMELTERS.....	Lead Smelter Sites
US AIRS.....	Aerometric Information Retrieval System Facility Subsystem
US MINES.....	Mines Master Index File
ABANDONED MINES.....	Abandoned Mines
DOCKET HWC.....	Hazardous Waste Compliance Docket Listing
UXO.....	Unexploded Ordnance Sites
FUELS PROGRAM.....	EPA Fuels Program Registered Listing
PFAS NPL.....	Superfund Sites with PFAS Detections Information
PFAS FEDERAL SITES.....	Federal Sites PFAS Information
PFAS TSCA.....	PFAS Manufacture and Imports Information
PFAS RCRA MANIFEST.....	PFAS Transfers Identified In the RCRA Database Listing
PFAS ATSDR.....	PFAS Contamination Site Location Listing
PFAS WQP.....	Ambient Environmental Sampling for PFAS
PFAS NPDES.....	Clean Water Act Discharge Monitoring Information
PFAS ECHO.....	Facilities in Industries that May Be Handling PFAS Listing
PFAS ECHO FIRE TRAINING.....	Facilities in Industries that May Be Handling PFAS Listing
PFAS PART 139 AIRPORT.....	All Certified Part 139 Airports PFAS Information Listing
AQUEOUS FOAM NRC.....	Aqueous Foam Related Incidents Listing
ME PFAS.....	PFAS Contamination Site Location Listing
ME NPDES.....	Wastewater Facilities Listing
ME UIC.....	Underground Injection Control
MINES MRDS.....	Mineral Resources Data System

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Cleaner..... EDR Exclusive Historical Cleaners

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

ME RGA HWS..... Recovered Government Archive State Hazardous Waste Facilities List

EXECUTIVE SUMMARY

ME RGA LF..... Recovered Government Archive Solid Waste Facilities List
ME RGA LUST..... Recovered Government Archive Leaking Underground Storage Tank

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

A review of the SEMS-ARCHIVE list, as provided by EDR, and dated 01/25/2023 has revealed that there is 1 SEMS-ARCHIVE site within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BELFAST-MOOSEHEAD LA Site ID: 0101950 EPA Id: MED985467166	11 WATER STREET	ENE 1/4 - 1/2 (0.467 mi.)	69	358

Lists of Federal RCRA generators

RCRA-VSQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-VSQG list, as provided by EDR, and dated 11/21/2022 has revealed that there are

EXECUTIVE SUMMARY

3 RCRA-VSQG sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
AUTOZONE #3210 EPA ID:: MER000511691	281 MAIN STREET	SSW 0 - 1/8 (0.008 mi.)	A1	8
DUTCH CHEVROLET, BUI EPA ID:: MED018989285	6 BELMONT AVENUE	SW 0 - 1/8 (0.048 mi.)	A19	81
SHERWIN-WILLIAMS #51 EPA ID:: MER000506642	15A STARRETT DT	S 0 - 1/8 (0.050 mi.)	A21	96

Lists of state- and tribal hazardous waste facilities

ME SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Protection's Uncontrolled Hazardous Substance Sites Program List of Investigations.

A review of the ME SHWS list, as provided by EDR, and dated 10/10/2022 has revealed that there are 3 ME SHWS sites within approximately 1 mile of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
EM BEE CLEANERS Facility Id: REM01891 : INVESTIGATION STAGE : REMEDY IN PLACE: CLOSED	126 CHURCH STREET	E 1/2 - 1 (0.562 mi.)	75	395
FSS, INC. Facility Id: REM00447 : REMEDY IN PLACE: CLOSED	101 FRONT ST	ENE 1/2 - 1 (0.577 mi.)	76	398
BELFAST-MOOSEHEAD RA Facility Id: REM00445 : REMEDY IN PLACE: CLOSED	11 WATER STREET	ENE 1/2 - 1 (0.624 mi.)	78	411

Lists of state and tribal leaking storage tanks

ME LAST: A listing of leaking aboveground storage tanks.

A review of the ME LAST list, as provided by EDR, and dated 10/22/2022 has revealed that there are 15 ME LAST sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
C N BROWN BULK PLANT Spill Number: A-97-2003	268 MAIN ST	SSE 0 - 1/8 (0.016 mi.)	A5	24
C N BROWN; BELFAST H Spill Number: A-18-2000	BELMONT AVE	S 0 - 1/8 (0.022 mi.)	A11	49
C.N. BROWN Spill Number: A-470-1996	INT. RT 1 AND RT 3	SW 0 - 1/8 (0.073 mi.)	E25	115
TEXACO, XPRESS LUBE	35 STARRET DR.	S 0 - 1/8 (0.093 mi.)	D27	118

EXECUTIVE SUMMARY

Spill Number: A-585-2001				
CHARLES BOYNTON	11 BELMONT AVE	WSW 1/8 - 1/4 (0.190 mi.)	H39	166
Spill Number: A-260-2003				
CRONIN	216 MAIN STREET	E 1/8 - 1/4 (0.227 mi.)	47	212
Spill Number: A-523-2017				
DANWELL RESIDENCE	133 MILLER STREET	SE 1/4 - 1/2 (0.403 mi.)	59	289
Spill Number: A-230-2013				

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MCTAGGART APARTMENT	60 WALDO AVENUE	NE 1/4 - 1/2 (0.332 mi.)	J49	216
Spill Number: A-168-2013				
RSU 20 BELFAST AREA	98 WALDO AVE	NNE 1/4 - 1/2 (0.348 mi.)	K53	229
Spill Number: A-361-2007				
THE AMBASSADOR	6 CONGRESS STREET	E 1/4 - 1/2 (0.355 mi.)	54	242
Spill Number: A-479-2013				
BELFAST HEADSTART	275 HIGH STREET	NNE 1/4 - 1/2 (0.450 mi.)	66	346
Spill Number: A-592-2012				
WENTWORTH FAMILY QWI	142 WALDO AVENUE	N 1/4 - 1/2 (0.459 mi.)	O67	348
Spill Number: A-786-2009				
PELLERITI RENTAL PRO	38 FRANKLIN STREET	E 1/4 - 1/2 (0.473 mi.)	70	359
Spill Number: A-19-2017				
BELFAST FAMILY PLANN	147 WALDO AVENUE	N 1/4 - 1/2 (0.481 mi.)	O71	361
Spill Number: A-492-2014				
WALDO COUNTY JAIL	45 CONGRESS STREET	ESE 1/4 - 1/2 (0.484 mi.)	P73	387
Spill Number: A-18-2019				

ME LUST: The Leaking Underground Storage Tank Incident Reports contain an inventory of reported leaking underground storage tank incidents. The data come from the Department of Environmental Protection's Hazardous Material and Oil Spill System Database (H.O.S.S.).

A review of the ME LUST list, as provided by EDR, and dated 10/22/2022 has revealed that there are 20 ME LUST sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BELFAST TEXACO - WEB	BELMONT AVE	WNW 0 - 1/8 (0.015 mi.)	B2	11
Spill Value: Oil Incident				
Spill Number: A-293-2000				
BELFAST TEXACO; WEBB	BELMONT AVE	WNW 0 - 1/8 (0.015 mi.)	B3	14
Spill Value: Oil Incident				
Spill Number: A-253-1995				
C N BROWN BULK PLANT	268 MAIN ST	SSE 0 - 1/8 (0.016 mi.)	A5	24
Spill Value: Oil Incident				
Spill Number: A-88-2010				
Spill Number: A-499-2006				
MARITIME FARMS	262 MAIN STREET	SE 0 - 1/8 (0.020 mi.)	C6	37
Spill Value: Oil Incident				
Spill Number: A-485-2006				

EXECUTIVE SUMMARY

Spill Number: A-798-2011				
C.N. BROWN / BIG APP Spill Value: Oil Incident Spill Number: A-116-1997	ROUTE 1	S 0 - 1/8 (0.022 mi.)	A10	45
Not reported Spill Value: Non-Oil, Non-Hazardous Incident Spill Number: A-434-1990		SE 0 - 1/8 (0.024 mi.)	C12	51
Not reported Spill Value: Oil Incident Spill Number: B-59-1980		WSW 1/8 - 1/4 (0.214 mi.)	40	168
NICKERSON'S EXXON Spill Value: Oil Incident Spill Number: A-232-1998	ROUTE 3	WSW 1/4 - 1/2 (0.332 mi.)	I48	214
NICKERSONS EXXON Spill Value: Oil Incident Spill Number: A-576-2002	25 BELMONT AVE	WSW 1/4 - 1/2 (0.335 mi.)	I50	218
MARITIME ENERGY Spill Value: Oil Incident Spill Number: A-58-1993	BELMONT AVENUE STORE	WSW 1/4 - 1/2 (0.385 mi.)	L57	280
MARITIME FARMS Spill Value: Oil Incident Spill Number: A-11-1994	32 BELMONT AVENUE	WSW 1/4 - 1/2 (0.398 mi.)	L58	282
GEO S ROBINSON SCHOO Spill Value: Oil Incident Spill Number: A-590-1998	HIGH STREET	SE 1/4 - 1/2 (0.464 mi.)	68	356
Lower Elevation	Address	Direction / Distance	Map ID	Page
KNIGHT KATHLEEN Spill Value: Oil Incident Spill Number: A-535-1994	67 WALDO AVE	NE 1/4 - 1/2 (0.335 mi.)	J51	223
MSAD 34 (BELFAST HIG Spill Value: Oil Incident Spill Number: A-74-1993	P.O. BOX 363	NNE 1/4 - 1/2 (0.348 mi.)	K52	225
CONSOLIDATED COMMUNI Spill Value: Oil Incident Spill Number: A-464-2020	19 WALDO AVENUE	ENE 1/4 - 1/2 (0.412 mi.)	60	291
WATERFALL ARTS Spill Value: Oil Incident Spill Number: A-410-2017	256 HIGH ST	NE 1/4 - 1/2 (0.417 mi.)	M63	330
MSAD # 34/BELFAST HI Spill Value: Oil Incident Spill Number: A-354-1994	8 WALDO STREET	E 1/4 - 1/2 (0.433 mi.)	N64	341
RSU 20 BUS GARAGE Spill Value: Oil Incident Spill Number: A-182-2010	6A WALDO AVE	E 1/4 - 1/2 (0.433 mi.)	N65	344
WENTWORTH FAMILY QWI Spill Value: Oil Incident Spill Number: A-316-1997 Spill Number: A-235-2020	142 WALDO AVENUE	N 1/4 - 1/2 (0.459 mi.)	O67	348
WALDO COUNTY JAIL	45 CONGRESS STREET	ESE 1/4 - 1/2 (0.484 mi.)	P73	387

EXECUTIVE SUMMARY

Spill Value: Oil Incident
Spill Number: A-419-2000

Lists of state and tribal registered storage tanks

ME UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Protection's Underground Storage Tank Database.

A review of the ME UST list, as provided by EDR, and dated 11/01/2022 has revealed that there are 15 ME UST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
COASTAL SMOKESHOP-MA Tank Status: ACTIVE Pipe Status: ACTIVE Facility Id: 21109	262 MAIN ST	SE 0 - 1/8 (0.020 mi.)	C9	44
MARITIME FARMS 51 Tank Status: REMOVED Tank Status: ACTIVE Pipe Status: REMOVED Pipe Status: ACTIVE Facility Id: 3764	RT 3	SE 0 - 1/8 (0.025 mi.)	C13	54
BIG APPLE BELFAST Tank Status: REMOVED Pipe Status: REMOVED Facility Id: 15227	BELMONT & STARRETT D	SSE 0 - 1/8 (0.038 mi.)	A14	60
FLEET BANK Tank Status: REMOVED Pipe Status: REMOVED Facility Id: 8652	JCT RT 1 BY PASS & R	SW 0 - 1/8 (0.048 mi.)	A18	80
BENNNERS AUTO SVC Tank Status: REMOVED Pipe Status: REMOVED Facility Id: 10490	BELMONT AVE	ESE 0 - 1/8 (0.103 mi.)	F28	120
POULTRY BARNS Tank Status: REMOVED Pipe Status: REMOVED Facility Id: 16043	BELMONT AVE	ESE 0 - 1/8 (0.103 mi.)	F29	122
GRASS, MERLE A Tank Status: REMOVED Pipe Status: REMOVED Facility Id: 6252	BELMONT AVE	ESE 0 - 1/8 (0.103 mi.)	F30	124
KALLIS FORD Tank Status: REMOVED Pipe Status: REMOVED Facility Id: 623	BELMONT AVE	ESE 0 - 1/8 (0.103 mi.)	F31	125
SEACOAST GROCERY Tank Status: REMOVED	BELMONT AVE	ESE 0 - 1/8 (0.103 mi.)	F32	128

EXECUTIVE SUMMARY

Pipe Status: REMOVED Facility Id: 6151				
MOLLISONS INC Tank Status: REMOVED Pipe Status: REMOVED Facility Id: 1914	BELMONT AVE	ESE 0 - 1/8 (0.103 mi.)	F33	131
MAWHINNEY, DORIS Tank Status: REMOVED Pipe Status: REMOVED Facility Id: 11020	BELMONT AVE	ESE 0 - 1/8 (0.103 mi.)	F34	134
DUTCH CHEV OLDS BUIC Tank Status: REMOVED Tank Status: ABANDONED_IN_PLACE Pipe Status: REMOVED Pipe Status: ABANDONED_IN_PLACE Facility Id: 1513	JCT RTS 1 & 3	SW 1/8 - 1/4 (0.145 mi.)	G38	163
ATHENAHEALTH INC Tank Status: REMOVED Tank Status: PLANNED Pipe Status: REMOVED Pipe Status: PLANNED Facility Id: 20960	1 HATLEY RD	WSW 1/8 - 1/4 (0.222 mi.)	H42	183
MBNA BELFAST FLEET B Tank Status: ABANDONED_IN_PLACE Pipe Status: ABANDONED_IN_PLACE Facility Id: 19721	1 HATLEY RD	WSW 1/8 - 1/4 (0.222 mi.)	H44	194
ATHEANAHEALTH INC Tank Status: ACTIVE Pipe Status: ACTIVE Facility Id: 20961	3 HATLEY RD	WSW 1/8 - 1/4 (0.227 mi.)	H46	211

ME AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Protection's Aboveground Storage Tank Database.

A review of the ME AST list, as provided by EDR, has revealed that there are 10 ME AST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
C.N. BROWN COMPANY # Database: AST, Date of Government Version: 12/31/2021	268 MAIN ST	SSE 0 - 1/8 (0.016 mi.)	A4	21
COASTAL SMOKESHOP-MA Database: AST 2, Date of Government Version: 09/26/2022 Piping Status: ACTIVE Tank Status: ACTIVE Registration Number: 21109	262 MAIN ST	SE 0 - 1/8 (0.020 mi.)	C7	42
MARITIME FARMS 51 Database: AST 2, Date of Government Version: 09/26/2022 Piping Status: ACTIVE Tank Status: ACTIVE Registration Number: 3764	RT 3	SE 0 - 1/8 (0.025 mi.)	C13	54
HANNAFORD BELFAST #8 Database: AST, Date of Government Version: 12/31/2021	14 STARRETT DRIVE	S 0 - 1/8 (0.045 mi.)	A16	63

EXECUTIVE SUMMARY

Facility Id: FATR20184XVVMA00VDLX
 Facility Id: FATR20154XVVMA00VDLX
 Facility Id: FATR20144XVVMA00VDLX
 Facility Id: FATR20174XVVMA00VDLX
 Facility Id: FATR20164XVVMA00VDLX

**Additional key fields are available in the Map Findings section*

MAINE PROPANE ENERGY 15 STARRET DRIVE S 0 - 1/8 (0.049 mi.) A20 94

Database: AST, Date of Government Version: 12/31/2021

Facility Id: FATR2018BV0Z4T025LEP

Facility Id: FATR2014AHU6U600KK78

Facility Id: FATR2015AHU6U600KK78

Facility Id: FATR2017BV0Z4T025LEP

Facility Id: FATR2016BV0Z4T025LEP

R.H. RENY, INC. 1 BELMONT AVE

WSW 0 - 1/8 (0.116 mi.) E35 135

Database: AST, Date of Government Version: 12/31/2021

Facility Id: FATR20097215PZ015L5B

Facility Id: FATR20139UC3SK01FX73

Facility Id: FATR2018AJ2TA800HAK1

Facility Id: FATR2014AJ2TA800HAK1

Facility Id: FATR2017AJ2TA800HAK1

**Additional key fields are available in the Map Findings section*

DUTCH CHEVROLET BUIC 6 BELMONT AVE

WSW 1/8 - 1/4 (0.129 mi.) G37 149

Database: AST, Date of Government Version: 12/31/2021

Facility Id: FATR2018D83001002JD8

Facility Id: FATR20118F7JV5002A5K

Facility Id: FATR2021D83001002JD8

Facility Id: FATR201394TS9A002WPY

Facility Id: FATR2014AHPKET0024TF

**Additional key fields are available in the Map Findings section*

BANK OF AMERICA / MB 1 HATLEY ROAD

WSW 1/8 - 1/4 (0.222 mi.) H41 170

Database: AST, Date of Government Version: 12/31/2021

Facility Id: FATR200848JK2R00CMRR

Facility Id: FATR200948JK2R00CMRR

MBNA NEW ENGLAND BEL 1 HATLEY RD

WSW 1/8 - 1/4 (0.222 mi.) H43 187

Database: AST, Date of Government Version: 12/31/2021

Database: AST 2, Date of Government Version: 09/26/2022

Piping Status: PLANNED

Tank Status: PLANNED

Facility Status: OUTSIDE

Registration Number: 20960

ATHENAHEALTH, INC. 3 HATLEY RD

WSW 1/8 - 1/4 (0.227 mi.) H45 195

Database: AST, Date of Government Version: 12/31/2021

Facility Id: FATR20147R45EG002SMQ

Facility Id: FATR20139VJ3B3002MNZ

Facility Id: FATR2018D7MQA8002W7L

Facility Id: FATR20086GMZ57002VAM

Facility Id: FATR20107R45EG002SMQ

**Additional key fields are available in the Map Findings section*

EXECUTIVE SUMMARY

State and tribal institutional control / engineering control registries

ME INST CONTROL: Sites with Land Use Restrictions in place.

A review of the ME INST CONTROL list, as provided by EDR, and dated 10/10/2022 has revealed that there are 3 ME INST CONTROL sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BELFAST RITE AID Facility Status: REMEDY IN PLACE: CLOSED Facility Id: REM00974	256 MAIN STREET	ESE 0 - 1/8 (0.041 mi.)	C15	62
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
WATERFALL ARTS Facility Status: REMEDY IN PLACE: CLOSED Facility Id: REM02750	256 HIGH STREET	NE 1/4 - 1/2 (0.417 mi.)	M62	328
WALDO COUNT JAIL COM Facility Status: REMEDIATION STAGE Facility Id: REM01986	45/45A CONGRESS STRE	ESE 1/4 - 1/2 (0.484 mi.)	P74	392

Lists of state and tribal voluntary cleanup sites

ME VCP: A list of sites where the necessary investigation and/or remediation activities have been completed to the Department's satisfaction and the applicants to the VRAP have been issued final certification documents. The list does not include those sites that are currently participating in the VRAP but have not yet received certification.

A review of the ME VCP list, as provided by EDR, and dated 10/10/2022 has revealed that there are 4 ME VCP sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BELFAST RITE AID Facility Status: REMEDY IN PLACE: CLOSED Facility Id: REM00974	256 MAIN STREET	ESE 0 - 1/8 (0.041 mi.)	C15	62
EXXON STATION (29 BE Facility Status: REMEDIATION STAGE Facility Id: REM02201	29 BELMONT AVE	WSW 1/4 - 1/2 (0.363 mi.)	I56	279
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
WATERFALL ARTS Facility Status: REMEDY IN PLACE: CLOSED Facility Id: REM02750	256 HIGH STREET	NE 1/4 - 1/2 (0.417 mi.)	M62	328
WALDO COUNT JAIL COM Facility Status: REMEDIATION STAGE Facility Id: REM01986	45/45A CONGRESS STRE	ESE 1/4 - 1/2 (0.484 mi.)	P74	392

EXECUTIVE SUMMARY

Lists of state and tribal brownfield sites

ME BROWNFIELDS: A listing of brownfields site locations.

A review of the ME BROWNFIELDS list, as provided by EDR, and dated 10/10/2022 has revealed that there are 3 ME BROWNFIELDS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
EXXON STATION (29 BE Facility Status: REMEDIATION STAGE Facility Id: REM02201	29 BELMONT AVE	WSW 1/4 - 1/2 (0.363 mi.)	I56	279
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
WATERFALL ARTS Facility Status: REMEDY IN PLACE: CLOSED Facility Id: REM02750	256 HIGH STREET	NE 1/4 - 1/2 (0.417 mi.)	M62	328
WALDO COUNT JAIL COM Facility Status: REMEDIATION STAGE Facility Id: REM01986	45/45A CONGRESS STRE	ESE 1/4 - 1/2 (0.484 mi.)	P74	392

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: The EPA's listing of Brownfields properties from the Cleanups in My Community program, which provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

A review of the US BROWNFIELDS list, as provided by EDR, and dated 02/23/2022 has revealed that there are 4 US BROWNFIELDS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MERRILL'S POWER WASH ACRES property ID: 177501 Cleanup Completion Date: -	26 STARRETT DRIVE	S 0 - 1/8 (0.072 mi.)	D24	109
29 BELMONT AVE. (FOR ACRES property ID: 156921 Cleanup Completion Date: -	29 BELMONT AVENUE	WSW 1/4 - 1/2 (0.363 mi.)	I55	244
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
WATERFALL ARTS ACRES property ID: 229662 Cleanup Completion Date: -	256 HIGH STREET	NE 1/4 - 1/2 (0.417 mi.)	M61	294
OLD WALDO COUNTY JAI ACRES property ID: 157043 Cleanup Completion Date: 5/4/2018 Cleanup Completion Date: -	45 CONGRESS STREET	ESE 1/4 - 1/2 (0.484 mi.)	P72	364

EXECUTIVE SUMMARY

Local Lists of Hazardous waste / Contaminated Sites

ME ALLSITES: The Sites List Database is the public record of information regarding properties that have been, are now, or are planned to be addressed by the Division of Remediation of the Bureau of Remediation and Waste Management. This database is not intended to be a comprehensive, all-inclusive source of information regarding the properties listed therein.

A review of the ME ALLSITES list, as provided by EDR, and dated 10/10/2022 has revealed that there are 6 ME ALLSITES sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BELFAST RITE AID Status: REMEDY IN PLACE: CLOSED Facility ID: REM00974	256 MAIN STREET	ESE 0 - 1/8 (0.041 mi.)	C15	62
RITE AID #04149 Status: COMPLAINT INVESTIGATED Facility ID: REM03003	254 MAIN STREET	ESE 0 - 1/8 (0.050 mi.)	C22	102
DUTCH CHEVROLET BUIC Status: REMEDY IN PLACE: CLOSED Facility ID: REM02783	6 BELMONT AVE	WSW 1/8 - 1/4 (0.129 mi.)	G37	149
EXXON STATION (29 BE Status: REMEDIATION STAGE Facility ID: REM02201	29 BELMONT AVE	WSW 1/4 - 1/2 (0.363 mi.)	I56	279
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
WATERFALL ARTS Status: REMEDY IN PLACE: CLOSED Facility ID: REM02750	256 HIGH STREET	NE 1/4 - 1/2 (0.417 mi.)	M62	328
WALDO COUNT JAIL COM Status: REMEDIATION STAGE Facility ID: REM01986	45/45A CONGRESS STRE	ESE 1/4 - 1/2 (0.484 mi.)	P74	392

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 11/21/2022 has revealed that there are 2 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SHERWIN WILLIAMS CO EPA ID:: MED047365226	BELFAST SHPG CTR RT1	SW 0 - 1/8 (0.048 mi.)	A17	76
DBA RITE AID #04149 EPA ID:: MER000509919	254 MAIN STREET	ESE 0 - 1/8 (0.050 mi.)	C23	102

EXECUTIVE SUMMARY

ME MANIFEST: Hazardous waste manifest information

A review of the ME MANIFEST list, as provided by EDR, and dated 06/30/2018 has revealed that there is 1 ME MANIFEST site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
DUTCH CHEVROLET	6 BELMONT AVE	WSW 1/8 - 1/4 (0.129 mi.)	G36	148

RI MANIFEST: Hazardous waste manifest information

A review of the RI MANIFEST list, as provided by EDR, and dated 12/31/2020 has revealed that there are 2 RI MANIFEST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
DUTCH CHEVROLET, BUI EPA Id: MED018989285 Manifest Document Number: 000022233	6 BELMONT AVENUE	SW 0 - 1/8 (0.048 mi.)	A19	81
SHERWIN-WILLIAMS #51 EPA Id: MER000506642 Manifest Document Number: 005928819JJK	15A STARRETT DT	S 0 - 1/8 (0.050 mi.)	A21	96

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

A review of the EDR MGP list, as provided by EDR, has revealed that there is 1 EDR MGP site within approximately 1 mile of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BELFAST GAS LIGHT CO	MARKET STREET	ENE 1/2 - 1 (0.591 mi.)	77	411

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past

EXECUTIVE SUMMARY

sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there are 2 EDR Hist Auto sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MARITIME ENERGY	262 MAIN ST	SE 0 - 1/8 (0.020 mi.)	C8	44
XPRESS LUBE	30 STARRETT DR	S 0 - 1/8 (0.081 mi.)	D26	117

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 4 records.

<u>Site Name</u>	<u>Database(s)</u>
BELFAST ARMORY	ME LAST
CHRISTIES SERVICE STATION	ME LUST
SAMPSON SUPERMARKET BELFAST PLAZA	ME LUST
MARITIME FARMS 51	ME LUST

OVERVIEW MAP - 7273839.2S




-  Target Property
-  Sites at elevations higher than or equal to the target property
-  Sites at elevations lower than the target property
-  Manufactured Gas Plants
-  National Priority List Sites
-  Dept. Defense Sites
-  Indian Reservations BIA
-  Power transmission lines
-  Special Flood Hazard Area (1%)
-  0.2% Annual Chance Flood Hazard
-  National Wetland Inventory
-  State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: EMDC Belfast Fire Sta
 ADDRESS: 273 Main Street
 Belfast ME 04915
 LAT/LONG: 44.424651 / 69.019758

CLIENT: Campbell Environmental Group
 CONTACT: Danica Kay
 INQUIRY #: 7273839.2s
 DATE: March 08, 2023 1:34 pm

DETAIL MAP - 7273839.2S

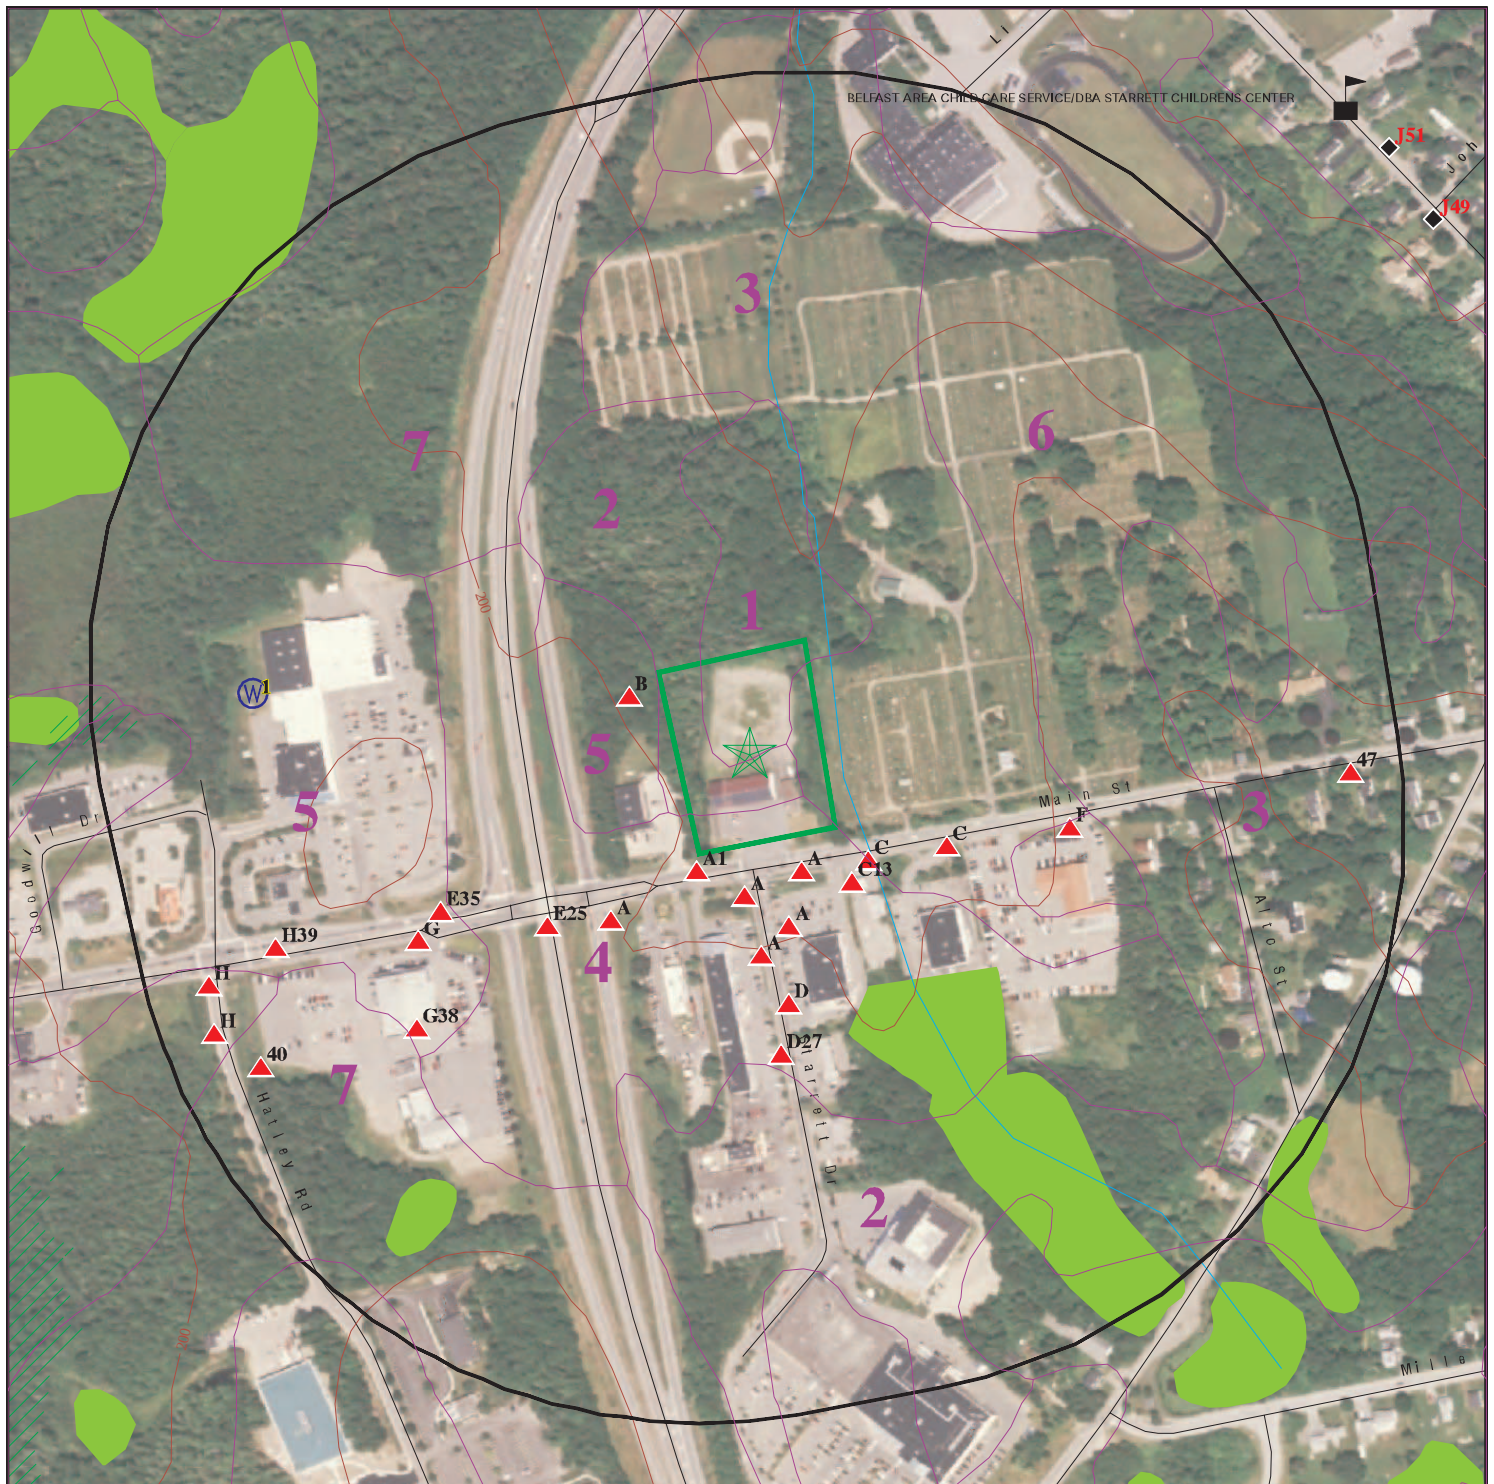

- Target Property
- Sites at elevations higher than or equal to the target property
- Sites at elevations lower than the target property
- Manufactured Gas Plants
- Sensitive Receptors
- National Priority List Sites
- Dept. Defense Sites

- Indian Reservations BIA
- Special Flood Hazard Area (1%)
- 0.2% Annual Chance Flood Hazard
- National Wetland Inventory
- State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: EMDC Belfast Fire Sta
 ADDRESS: 273 Main Street
 Belfast ME 04915
 LAT/LONG: 44.424651 / 69.019758

CLIENT: Campbell Environmental Group
 CONTACT: Danica Kay
 INQUIRY #: 7273839.2s
 DATE: March 08, 2023 1:37 pm

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
<i>Lists of Federal NPL (Superfund) sites</i>								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	1.000		0	0	0	0	NR	0
<i>Lists of Federal Delisted NPL sites</i>								
Delisted NPL	1.000		0	0	0	0	NR	0
<i>Lists of Federal sites subject to CERCLA removals and CERCLA orders</i>								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	0	0	NR	NR	0
<i>Lists of Federal CERCLA sites with NFRAP</i>								
SEMS-ARCHIVE	0.500		0	0	1	NR	NR	1
<i>Lists of Federal RCRA facilities undergoing Corrective Action</i>								
CORRACTS	1.000		0	0	0	0	NR	0
<i>Lists of Federal RCRA TSD facilities</i>								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
<i>Lists of Federal RCRA generators</i>								
RCRA-LQG	0.250		0	0	NR	NR	NR	0
RCRA-SQG	0.250		0	0	NR	NR	NR	0
RCRA-VSQG	0.250		3	0	NR	NR	NR	3
<i>Federal institutional controls / engineering controls registries</i>								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROLS	0.500		0	0	0	NR	NR	0
<i>Federal ERNS list</i>								
ERNS	TP		NR	NR	NR	NR	NR	0
<i>Lists of state- and tribal hazardous waste facilities</i>								
ME SHWS	1.000		0	0	0	3	NR	3
<i>Lists of state and tribal landfills and solid waste disposal facilities</i>								
ME SWF/LF	0.500		0	0	0	NR	NR	0
ME LCP	0.500		0	0	0	NR	NR	0
<i>Lists of state and tribal leaking storage tanks</i>								
ME LAST	0.500		4	2	9	NR	NR	15

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
ME LUST	0.500		6	1	13	NR	NR	20
INDIAN LUST	0.500		0	0	0	NR	NR	0
<i>Lists of state and tribal registered storage tanks</i>								
FEMA UST	0.250		0	0	NR	NR	NR	0
ME UST	0.250		11	4	NR	NR	NR	15
ME AST	0.250		6	4	NR	NR	NR	10
INDIAN UST	0.250		0	0	NR	NR	NR	0
<i>State and tribal institutional control / engineering control registries</i>								
ME INST CONTROL	0.500		1	0	2	NR	NR	3
<i>Lists of state and tribal voluntary cleanup sites</i>								
ME VCP	0.500		1	0	3	NR	NR	4
INDIAN VCP	0.500		0	0	0	NR	NR	0
<i>Lists of state and tribal brownfield sites</i>								
ME BROWNFIELDS	0.500		0	0	3	NR	NR	3
<u>ADDITIONAL ENVIRONMENTAL RECORDS</u>								
<i>Local Brownfield lists</i>								
US BROWNFIELDS	0.500		1	0	3	NR	NR	4
<i>Local Lists of Landfill / Solid Waste Disposal Sites</i>								
ME SWRCY	0.500		0	0	0	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
<i>Local Lists of Hazardous waste / Contaminated Sites</i>								
US HIST CDL	TP		NR	NR	NR	NR	NR	0
ME ALLSITES	0.500		2	1	3	NR	NR	6
ME DEL SHWS	1.000		0	0	0	0	NR	0
US CDL	TP		NR	NR	NR	NR	NR	0
<i>Local Land Records</i>								
ME LIENS	TP		NR	NR	NR	NR	NR	0
LIENS 2	TP		NR	NR	NR	NR	NR	0
<i>Records of Emergency Release Reports</i>								
HMIRS	TP		NR	NR	NR	NR	NR	0
ME SPILLS	TP		NR	NR	NR	NR	NR	0
ME SPILLS 90	TP		NR	NR	NR	NR	NR	0
ME SPILLS 80	TP		NR	NR	NR	NR	NR	0
<i>Other Ascertainable Records</i>								
RCRA NonGen / NLR	0.250		2	0	NR	NR	NR	2

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
FUDS	1.000		0	0	0	0	NR	0
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	TP		NR	NR	NR	NR	NR	0
EPA WATCH LIST	TP		NR	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
TSCA	TP		NR	NR	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
PRP	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
ICIS	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
COAL ASH DOE	TP		NR	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	TP		NR	NR	NR	NR	NR	0
RADINFO	TP		NR	NR	NR	NR	NR	0
HIST FTTS	TP		NR	NR	NR	NR	NR	0
DOT OPS	TP		NR	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	TP		NR	NR	NR	NR	NR	0
US AIRS	TP		NR	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
ABANDONED MINES	0.250		0	0	NR	NR	NR	0
FINDS	TP		NR	NR	NR	NR	NR	0
DOCKET HWC	TP		NR	NR	NR	NR	NR	0
UXO	1.000		0	0	0	0	NR	0
ECHO	TP		NR	NR	NR	NR	NR	0
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0
PFAS NPL	0.250		0	0	NR	NR	NR	0
PFAS FEDERAL SITES	0.250		0	0	NR	NR	NR	0
PFAS TSCA	0.250		0	0	NR	NR	NR	0
PFAS RCRA MANIFEST	0.250		0	0	NR	NR	NR	0
PFAS ATSDR	0.250		0	0	NR	NR	NR	0
PFAS WQP	0.250		0	0	NR	NR	NR	0
PFAS NPDES	0.250		0	0	NR	NR	NR	0
PFAS ECHO	0.250		0	0	NR	NR	NR	0
PFAS ECHO FIRE TRAINING	0.250		0	0	NR	NR	NR	0
PFAS PART 139 AIRPORT	0.250		0	0	NR	NR	NR	0
AQUEOUS FOAM NRC	0.250		0	0	NR	NR	NR	0
ME PFAS	0.250		0	0	NR	NR	NR	0
ME AIRS	TP		NR	NR	NR	NR	NR	0
ME DRYCLEANERS	0.250		0	0	NR	NR	NR	0
ME MANIFEST	0.250		0	1	NR	NR	NR	1

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
RI MANIFEST	0.250		2	0	NR	NR	NR	2
ME NPDES	TP		NR	NR	NR	NR	NR	0
ME TIER 2	TP		NR	NR	NR	NR	NR	0
ME UIC	TP		NR	NR	NR	NR	NR	0
MINES MRDS	TP		NR	NR	NR	NR	NR	0

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP	1.000		0	0	0	1	NR	1
EDR Hist Auto	0.125		2	NR	NR	NR	NR	2
EDR Hist Cleaner	0.125		0	NR	NR	NR	NR	0

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

ME RGA HWS	TP		NR	NR	NR	NR	NR	0
ME RGA LF	TP		NR	NR	NR	NR	NR	0
ME RGA LUST	TP		NR	NR	NR	NR	NR	0

- Totals --		0	41	13	37	4	0	95

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

	Site	Database(s)	EDR ID Number EPA ID Number
A1 SSW < 1/8 0.008 mi. 40 ft.	AUTOZONE #3210 281 MAIN STREET BELFAST, ME 04915 Site 1 of 12 in cluster A	RCRA-VSQG	1023677642 MER000511691
Relative: Higher	RCRA Listings:		
Actual: 198 ft.	Date Form Received by Agency:	20170215	
	Handler Name:	AUTOZONE #3210	
	Handler Address:	281 MAIN STREET	
	Handler City,State,Zip:	BELFAST, ME 04915	
	EPA ID:	MER000511691	
	Contact Name:	BRYAN BLAIR	
	Contact Address:	DEPT 8190, 123 SOUTH FRONT STREET	
	Contact City,State,Zip:	MEMPHIS, TN 38103	
	Contact Telephone:	901-495-7217	
	Contact Fax:	901-495-8399	
	Contact Email:	BRYAN.BLAIR@AUTOZONE.COM	
	Contact Title:	ENVIRONMENTAL SPECIALIST	
	EPA Region:	01	
	Land Type:	Private	
	Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator	
	Non-Notifier:	Not reported	
	Biennial Report Cycle:	Not reported	
	Accessibility:	Not reported	
	Active Site Indicator:	Handler Activities	
	State District Owner:	Not reported	
	State District:	Not reported	
	Mailing Address:	DEPT 8190, 123 SOUTH FRONT STREET	
	Mailing City,State,Zip:	MEMPHIS, TN 38103	
	Owner Name:	AUTOZONE INC	
	Owner Type:	Private	
	Operator Name:	AUTOZONE INC	
	Operator Type:	Private	
	Short-Term Generator Activity:	No	
	Importer Activity:	No	
	Mixed Waste Generator:	No	
	Transporter Activity:	No	
	Transfer Facility Activity:	No	
	Recycler Activity with Storage:	No	
	Small Quantity On-Site Burner Exemption:	No	
	Smelting Melting and Refining Furnace Exemption:	No	
	Underground Injection Control:	No	
	Off-Site Waste Receipt:	No	
	Universal Waste Indicator:	No	
	Universal Waste Destination Facility:	No	
	Federal Universal Waste:	No	
	Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported	
	Active Site Converter Treatment storage and Disposal Facility:	Not reported	
	Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported	
	Active Site State-Reg Handler:	---	
	Federal Facility Indicator:	Not reported	
	Hazardous Secondary Material Indicator:	NN	
	Sub-Part K Indicator:	Not reported	
	Commercial TSD Indicator:	No	
	Treatment Storage and Disposal Type:	Not reported	
	2018 GPRA Permit Baseline:	Not on the Baseline	
	2018 GPRA Renewals Baseline:	Not on the Baseline	
	Permit Renewals Workload Universe:	Not reported	

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AUTOZONE #3210 (Continued)

1023677642

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20170221
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE
Waste Code:	D003
Waste Description:	REACTIVE WASTE
Waste Code:	D005
Waste Description:	BARIUM
Waste Code:	D007
Waste Description:	CHROMIUM
Waste Code:	D008
Waste Description:	LEAD
Waste Code:	D018
Waste Description:	BENZENE
Waste Code:	D035
Waste Description:	METHYL ETHYL KETONE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AUTOZONE #3210 (Continued)

1023677642

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	AUTOZONE INC
Legal Status:	Private
Date Became Current:	20000821
Date Ended Current:	Not reported
Owner/Operator Address:	123 SOUTH FRONT STREET
Owner/Operator City,State,Zip:	MEMPHIS, TN 38103
Owner/Operator Telephone:	901-495-7217
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	AUTOZONE INC
Legal Status:	Private
Date Became Current:	20000821
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20170215
Handler Name:	AUTOZONE #3210
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Code:	441310
NAICS Description:	AUTOMOTIVE PARTS AND ACCESSORIES STORES

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

B2
WNW
< 1/8
0.015 mi.
77 ft.

BELFAST TEXACO - WEBBER OIL CO.
BELMONT AVE
BELFAST, ME

ME LUST **S106674413**
N/A

Site 1 of 2 in cluster B

Relative:
Higher

LUST:

Actual:
199 ft.

Event:

Name: BELFAST TEXACO - WEBBER OIL CO.
Address: BELMONT AVE
City,State,Zip: BELFAST, ME
Spill Number: A-293-2000
Spill Cause: Discharge - Deliberate/Other
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: True
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 08/05/2003
Modify By: EITGALLA
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Other
Inc Location: Terminal - Service Station
Inc Source: Storage Unit - Underground Storage Tank
Material Disposal Info: Thibodeau & Sons 513.99 tons Commercial Recycling 48.69 tons (from dry well)
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Status change from DR to DRV
Date Change: 06/20/2003
Changed By: EIFGEHRL

Description: Report Status change from DRV to DQA
Date Change: 07/24/2003
Changed By: EIPBLANC

Description: Report Status change from DQA to FR
Date Change: 08/05/2003
Changed By: EITGALLA

Description: Report Created with Report Status = DR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Other Contact
Potential RP: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST TEXACO - WEBBER OIL CO. (Continued)

S106674413

Name: Not reported
Title: Not reported
Company: JORD CONST LLC
Address: 262-C QUARRY RD
City,State: MILFORD,CT
Country: USA
Zipcode: 06460
Phone/Ext: /
Comments: Not reported

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: AUTOZONE
Address: BELMONT ST
City,State: BELFAST,ME
Country: Not reported
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: FRANCIS GEHRLING

File:
Spill Id: A-293-2000
Date Created: 08/05/2003
Created By: EILMOORE
Date Modified: 05/19/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 19-MAY-09.
Reconcile Date: 08/05/2003
File Reconciled By: Not reported

Media Affected:
Medium: Land

Medium: Groundwater

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 293
Spill Year: 2000
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 08/05/2003
Modify By: EITGALLA
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST TEXACO - WEBBER OIL CO. (Continued)

S106674413

Log Rep Dt Tm: 05/26/2000
Log Rep Prod Cd: 81
Log Rep Prod: WASTE OIL/USED MOTOR OIL
Log Emp Name: FRANCIS GEHRLING
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: CS
Material Recovered: Contaminated Soil
Material Amount: 562.68
Material Units: tons
Material Amt Qualifier: ACTUAL

Recovery Method: Excavation

Spill Point:
Date Reported: 5/26/2000
Notes: Not reported
Product: WASTE OIL/USED MOTOR OIL
Product Notes: Not reported
Latitude: 44.425003
Longitude: -69.020829

Product:
Product Code: WASTE OIL/USED MOTOR OIL
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: True

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: Not reported
Product Amt Qualifier: UNKNOWN
Primary Product: False

Attachments:
Description: 2 e-mails from Jon Andrews to Frank Gehrling
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 06/20/2003

Description: Fax from Commercial Paving 11 pages
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 06/20/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST TEXACO - WEBBER OIL CO. (Continued)

S106674413

Description: letter from Env. Management 7/14/2000 2 pages
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 06/20/2003

Description: invoice from Thibodeau #7774
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 06/20/2003

Description: fax from Mark Bourgeois of Env. Management to Jon Andrews 13 pages
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 06/20/2003

B3
WNW
< 1/8
0.015 mi.
77 ft.

BELFAST TEXACO; WEBBER OIL CO.
BELMONT AVE
BELFAST, ME

ME LUST **S106789060**
N/A

Site 2 of 2 in cluster B

Relative:
Higher

LUST:

Actual:
199 ft.

Event:

Name: BELFAST TEXACO; WEBBER OIL CO.
Address: BELMONT AVE
City,State,Zip: BELFAST, ME
Spill Number: A-253-1995
Spill Cause: Corrosion - Tank
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: DEP Personnel
Detection Method: Tank and/or Piping Removal
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: dragon
Lust Document Search: <https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?D>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST TEXACO; WEBBER OIL CO. (Continued)

S106789060

atabase=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Porta
I.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: BELFAST TEXACO; WEBBER OIL CO.
Address: PO BOX 929
City,State: BANGOR,ME
Country: Not reported
Zipcode: 04402-0929
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: MARY CORR

File:

Spill Id: A-253-1995
Date Created: 09/08/1995
Created By: SPILLS
Date Modified: 12/19/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 19-DEC-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Medium: Groundwater

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 253
Spill Year: 1995
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 06/12/1995

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST TEXACO; WEBBER OIL CO. (Continued)

S106789060

Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: MARY CORR
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 45
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Recovery Method: Excavation

Spill Point:

Date Reported: 6/12/1995 10:00:00 AM
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.425003
Longitude: -69.020829

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: 55
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: False

Event:

Name: BELFAST TEXACO; WEBBER OIL CO.
Address: BELMONT AVE
City,State,Zip: BELFAST, ME
Spill Number: A-253-1995
Spill Cause: Corrosion - Tank
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: False
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST TEXACO; WEBBER OIL CO. (Continued)

S106789060

Further Response Action: False
Reporter Type: DEP Personnel
Detection Method: Tank and/or Piping Removal
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: dragon
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Change:
Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:
Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: BELFAST TEXACO; WEBBER OIL CO.
Address: PO BOX 929
City,State: BANGOR,ME
Country: Not reported
Zipcode: 04402-0929
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: MARY CORR

File:
Spill Id: A-253-1995
Date Created: 09/08/1995
Created By: SPILLS
Date Modified: 12/19/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 19-DEC-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:
Medium: Land

Medium: Groundwater

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 253
Spill Year: 1995
Create Date: 12/07/2001
Created By: SPILLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST TEXACO; WEBBER OIL CO. (Continued)

S106789060

Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 06/12/1995
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: MARY CORR
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 45
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Recovery Method: Excavation

Spill Point:
Date Reported: 6/12/1995 10:00:00 AM
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.425003
Longitude: -69.020829

Product:
Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: 55
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: False

Event:
Name: BELFAST TEXACO; WEBBER OIL CO.
Address: BELMONT AVE
City,State,Zip: BELFAST, ME
Spill Number: A-253-1995
Spill Cause: Corrosion - Tank
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: False
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST TEXACO; WEBBER OIL CO. (Continued)

S106789060

Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: DEP Personnel
Detection Method: Tank and/or Piping Removal
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: dragon
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: BELFAST TEXACO; WEBBER OIL CO.
Address: PO BOX 929
City,State: BANGOR,ME
Country: Not reported
Zipcode: 04402-0929
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: MARY CORR

File:

Spill Id: A-253-1995
Date Created: 09/08/1995
Created By: SPILLS
Date Modified: 12/19/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 19-DEC-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Medium: Groundwater

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST TEXACO; WEBBER OIL CO. (Continued)

S106789060

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 253
Spill Year: 1995
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 06/12/1995
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: MARY CORR
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 45
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Recovery Method: Excavation

Spill Point:

Date Reported: 6/12/1995 10:00:00 AM
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.425003
Longitude: -69.020829

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: 55
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A4
SSE
< 1/8
0.016 mi.
83 ft.

C.N. BROWN COMPANY #3048
268 MAIN ST
BELFAST, ME

Site 2 of 12 in cluster A

ME AST
ME TIER 2

S108651769
N/A

Relative:
Higher

Actual:
194 ft.

AST:

Name: C.N. BROWN COMPANY #3048
Address: 268 MAIN ST
City,State,Zip: BELFAST
Facility ID: Not reported
Facility Status: Not reported
Facility Phone: Not reported
Facility Dept: BELFAST HEATING OIL #3048
Record Id: Not reported
CAS Number: 8008-20-6
Submitted By: STEPHAN LAWRENCE- RETAIL SALES MANAGER
Max Container is Holding: 58500
Max Amount Container: 58500
Location: BELMONT AVE, BEHIND STORE, TANK CLOSEST TO STARRET ST.
Mail Address: P.O. BOX 200
Mail City: SOUTH PARIS
Mail State: ME
Mail Zip: 04281
Lat/Long: 44.42380 / -69

Chemical Name: KEROSENE
Amount: 21281
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 335
CIEHS Chemical: Not reported
Report Year: 2006

Name: C.N. BROWN COMPANY #3048
Address: 268 MAIN ST
City,State,Zip: BELFAST

Chemical Name: #2 FUEL
Amount: 21281
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 335
CIEHS Chemical: Not reported
Report Year: 2006

Name: C.N. BROWN COMPANY #3048
Address: 268 MAIN ST
City,State,Zip: BELFAST

Chemical Name: #2 FUEL
Amount: 56550
Amount Unit: pounds

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C.N. BROWN COMPANY #3048 (Continued)

S108651769

Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 335
CIEHS Chemical: Not reported
Report Year: 2006

Name: C.N. BROWN COMPANY #3048
Address: 268 MAIN ST
City,State,Zip: BELFAST

Chemical Name: KEROSENE
Amount: 56550
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 335
CIEHS Chemical: Not reported
Report Year: 2006

TIER 2:

Name: C.N. BROWN COMPANY #3048
Address: 268 MAIN ST
City,State,Zip: BELFAST, ME
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
Facility Mailing Country: Not reported
Report Year: 2007
Submitted By: Not reported
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported
Facility Router Record ID: Not reported
Chemical Inventory Record ID: Not reported
Chemical Same As Last Year: Not reported
Chronic: Not reported
CICAS: Not reported
CI EHS Chemical: Not reported
CI Last Modified: Not reported
MSDS Number For Chemical: Not reported
CI Notes: Not reported
Days On Site: Not reported
Entered Chemical Name: Not reported
Fire: Not reported
Gas: Not reported
Liquid: Not reported
Maximum Amount: Not reported
Maximum Amount Code: Not reported
Maximum Amount Container: Not reported
Mixture: Not reported
Pressure: Not reported
Pure: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C.N. BROWN COMPANY #3048 (Continued)

S108651769

Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2007364TFE001LFW
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	P.O. BOX 200
Mail City:	SOUTH PARIS
Mail State:	ME
Mail Zip:	4281
Mail Country:	USA
Lat/Long Location Descr:	CE - Center of Facility
Lat/Long Method:	A1 - Address Matching (House Number)
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.4238
Longitude:	-69.02020
Name:	C.N. BROWN COMPANY #3048
Address:	268 MAIN ST
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	P.O. BOX 200
Facility Mailing City:	SOUTH PARIS
Facility Mailing State:	ME
Facility Mailing Zip:	04281
Facility Mailing Country:	USA
Report Year:	2006
Submitted By:	STEPHAN LAWRENCE- RETAIL SALES MANAGER
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/20/2007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C.N. BROWN COMPANY #3048 (Continued)

S108651769

Date TierII Received: Not reported
Facility Dept: BELFAST HEATING OIL #3048
Facility ID: FATR2006364TFE001LFW
Failed Validation: Not reported
Facility Date Modified: 4/18/2007
Facility Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Mail Country: Not reported
Lat/Long Location Descr: Not reported
Lat/Long Method: Not reported
Notes: Not reported

Validation Report: Not reported
Latitude: 44.4238
Longitude: -69.02020

**A5
SSE
< 1/8
0.016 mi.
83 ft.**

**C N BROWN BULK PLANT
268 MAIN ST
BELFAST, ME**

**ME LUST
ME LAST
ME SPILLS**

**S105112357
N/A**

Site 3 of 12 in cluster A

**Relative:
Higher**

LUST:

**Actual:
194 ft.**

Event:

Name: CN BROWN SERVICE STATION
Address: 268 MAIN ST
City,State,Zip: BELFAST, ME
Spill Number: A-88-2010
Spill Cause: Other - Unknown
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 02/18/2010
Create By: EIEWERLY
Modify Date: 10/05/2010
Modify By: EIKWALKE
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Site Assessment
Inc Location: Terminal - Service Station
Inc Source: Storage Unit - Underground Storage Tank
Material Disposal Info: Soil disposed of at Thibodeau's, Prospect
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Date Change: 02/18/2010
Changed By: EIEWERLY

Description: Report Status change from DR to DRV
Date Change: 10/05/2010
Changed By: EIDDAVIS

Description: Report Status change from DRV to DQA
Date Change: 10/05/2010
Changed By: EIPBLANC

Description: Report Status change from DQA to FR
Date Change: 10/05/2010
Changed By: EIKWALKE

Contact:
Contact Type: Subject/Spiller
Potential RP: True
Name: KEVIN MOORE
Title: Not reported
Company: CN BROWN
Address: PO BOX 200
City,State: SOUTH PARIS,ME
Country: USA
Zipcode: 04281
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: DANIEL E DAVIS

Media Affected:
Medium: Land

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 88
Spill Year: 2010
Create Date: 02/18/2010
Created By: EIEWERLY
Modify Date: 02/18/2010
Modify By: EIEWERLY
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 02/10/2010
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: DANIEL E DAVIS
Location: C.N. Brown station on Maine Street
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Notes: Contamination discovered during removal.

Material Recovered:

Material Recovered Type: CS
Material Recovered: Contaminated Soil
Material Amount: 249.5
Material Units: cu. yds.
Material Amt Qualifier: ESTIMATE

Recovery Method: Excavation

Spill Point:

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: Not reported
Product Amt Qualifier: UNKNOWN
Primary Product: True

Attachments:

Description: spill debris letter
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 10/05/2010

Event:

Name: BIG APPLE
Address: 268 MAIN ST
City,State,Zip: BELFAST, ME
Spill Number: A-499-2006
Spill Cause: Overfill
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 09/11/2006
Create By: EIEWERLY
Modify Date: 10/05/2010
Modify By: EIKWALKE
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Public Official
Detection Method: Visual Product
Inc Location: Terminal - Service Station
Inc Source: Storage Unit - Underground Storage Tank

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Material Disposal Info: Sorbents disposed of by the responsible party.
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 09/11/2006
Changed By: EIEWERLY

Description: Report Status change from DRV to DQA
Date Change: 09/21/2010
Changed By: EIPBLANC

Description: Report Status change from DQA to FR
Date Change: 10/05/2010
Changed By: EIKWALKE

Description: Report Status change from DR to DRV
Date Change: 02/04/2009
Changed By: EIDDAVIS

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: ABENAQUI CARRIERS
Address: PO BOX 517 38B SOUTH RD.
City,State: NORTH HAMPTON,NH
Country: USA
Zipcode: 03862
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: False
Name: JUANITA A CONNER-EHIOBOBO

Primary Employee: True
Name: DANIEL E DAVIS

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 499
Spill Year: 2006
Create Date: 09/11/2006
Created By: EIEWERLY
Modify Date: 09/11/2006
Modify By: EIEWERLY
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 05/29/2006
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: DANIEL E DAVIS
Location: 268 Main Street Big Apple #1039
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: 100 gallons to ground.

Material Recovered:

Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: UNKNOWN

Recovery Method: Sorbents

Spill Point:

Product:

Product Code: UNLEADED GASOLINE
Product Other: Not reported
Product Amt: 100
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

Attachments:

Description: Referral to JUANITA A CONNER-EHIOBO
Attach Type: Electronic Form
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 09/21/2010

LAST:

Event:

Name: C N BROWN BULK PLANT
Address: 268 MAIN ST
City,State,Zip: BELFAST, ME
Spill Number: A-97-2003
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: True
AST inside flag: False
Create Date: 03/05/2003
Create By: EIDDAVIS
Modify Date: 11/02/2004
Modify By: 11/02/2004
Report Status Code: FR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Report Status: Final Report
Spill Datetime: 03/03/2003
Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 2
Reporter Type: Subject/Spiller
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: BP
Inc Location: Terminal - Bulk Plant
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 07
Spill Cause: Mechanical Failure - Valve
Material Disposal Info: c.n.brown disposed of oily ice
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Status change from DQA to P
Date Change: 09/30/2004
Changed By: EITGALLA

Description: Report Status change from P to FR
Date Change: 11/02/2004
Changed By: EITGALLA

Description: Report Status change from DRV to DQA
Date Change: 07/26/2004
Changed By: EIPBLANC

Description: Report Created with Report Status = DR
Date Change: 03/05/2003
Changed By: EIDDAVIS

Description: Report Status change from DR to DRV
Date Change: 03/05/2003
Changed By: EIDDAVIS

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: C N BROWN
Address: PO BOX 200 164 MAIN ST EXT
City,State: SO PARIS,ME
Country: USA
Zipcode: 04281

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: DANIEL E DAVIS

File:
Spill Id: A-97-2003
Date Created: 11/04/2004
Created By: EIPLAMBE
Date Modified: 02/18/2005
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 18-FEB-05.
Reconcile Date: 11/04/2004
File Reconciled By: Not reported

Media Affected:
Medium: Engineered Containment

Medium: Land

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 97
Spill Year: 2003
Create Date: 03/05/2003
Created By: EIDDAVIS
Modify Date: 03/05/2003
Modify By: EIDDAVIS
Log Spill Type: Oil Incident
Log Spill Datetime: 03/03/2003
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 03/03/2003
Log Rep Prod Cd: 01
Log Rep Prod: #1 FUEL OIL - KEROSENE
Log Emp Name: DANIEL E DAVIS
Location: 268 main st - Belfast heating oil office - C.N.Brown
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: 1 gal to containment and ice.

Material Recovered:
Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: UNKNOWN

Spill Point:
Recovery Method: Excavation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Product:

Product Code: #1 FUEL OIL - KEROSENE
Product Other: Not reported
Product Amt: 1
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

SPILLS:

Event:

Name: BELFAST OIL CO.
Address: 268 MAIN ST.
City,State,Zip: BELFAST, ME
Spill Number: A-139-2001
Inc Tank Code: Not reported
Inc Tank: Not reported
Removal Flag: Not reported
Ust Registered Flag: Not reported
Ast Inside Flag: Not reported
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: FR
Report Status: Final Report
Actual Spill Datetime: 03/15/2001
Actual Spill Date Unknown: False
Actual Spill Time Unknown: False
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
MCD Value: 27010
Further Response Action: False
Spill Type Code: 0
Spill Type: Oil Incident
Reporter Type Code: 2
Reporter Type: Subject/Spiller
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: RD
Inc Location: Transportation - Road
Inc Source Code: Not reported
Inc Source: Not reported
Spill Cause Code: 17
Spill Cause: Accident - Human Error
Material Disposal Info: by oil co. staff
Spills Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Contact:

Contact Type:	Subject/Spiller
Potential RP:	False
Name:	Not reported
Title:	Not reported
Company:	BELFAST OIL CO.
Address:	268 MAIN ST.
City,State:	BELFAST,ME
Country:	Not reported
Zipcode:	Not reported
Phone/Ext:	/
Comments:	Not reported

Primary Employee:

Primary Employee:	True
Name:	JON ANDREWS

File:

Spill Id:	A-139-2001
Date Created:	05/29/2009
Created By:	IMAGING
Date Modified:	05/29/2009
Modified By:	IMAGING
File Num Sheets:	0
Notes:	Report scanned into the imaging system on 29-MAY-09.
Reconcile Date:	Not reported
File Reconciled By:	Not reported

Media Affected:

Medium:	Land

Log:

Spill Void Flag:	False
Spill Office:	Augusta
Spill Off Sequence:	139
Spill Year:	2001
Create Date:	12/07/2001
Created By:	SPILLS
Modify Date:	12/07/2001
Modify By:	SPILLS
Log Spill Type:	Oil Incident
Log Spill Datetime:	03/15/2001
Spill Time Unk:	False
Spill Dt Unknown:	False
Log Rep Dt Tm:	03/15/2001
Log Rep Prod Cd:	02
Log Rep Prod:	#2 FUEL OIL
Log Emp Name:	JON ANDREWS
Location:	Not reported
Log Location Town:	BELFAST
Log Tank Involved:	Unknown/Unspecified
Notes:	Not reported

Material Recovered:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: .2
Material Units: gals.
Material Amt Qualifier: ACTUAL

Recovery Method: Sorbents

Spill Point:

Product:

Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: .2
Product Amt Unit: gals.
Product Amt Qualifier: ACTUAL
Primary Product: False

Event:

Name: BIG APPLE
Address: 268 MAIN STREET
City,State,Zip: BELFAST, ME
Spill Number: A-708-2009
Inc Tank Code: N
Inc Tank: None
Removal Flag: False
Ust Registered Flag: True
Ast Inside Flag: False
Create Date: 11/17/2009
Create By: EIEWERLY
Modify Date: 01/29/2015
Modify By: EIRKROUT
Report Status: FR
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Actual Spill Time Unknown: True
Number Wells At Risk: Not reported
Number Wells Impacted: Not reported
Dtree Completed Flag: False
MCD Value: 27010
Further Response Action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 6
Reporter Type: Contractor/Consultant
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: SS
Inc Location: Terminal - Service Station
Inc Source Code: PV
Inc Source: Land Transportation - Passenger Vehicle
Spill Cause Code: 18
Spill Cause: Other - Unknown
Material Disposal Info: unknown
Spills Document Search: <https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?D>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

atabase=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 11/17/2009
Changed By: EIEWERLY

Description: Report Status change from DR to FR
Date Change: 01/29/2015
Changed By: EIRKROUT

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: UNKNOWN
Title: Not reported
Company: Not reported
Address: Not reported
City,State: ,
Country: Not reported
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: JON ANDREWS

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 708
Spill Year: 2009
Create Date: 11/17/2009
Created By: EIEWERLY
Modify Date: 11/17/2009
Modify By: EIEWERLY
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 11/10/2009
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: JON ANDREWS
Location: 268 Main Street Big Apple
Log Location Town: BELFAST
Log Tank Involved: None
Notes: Vehicle leak, 3 gallons to pavement.

Material Recovered:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: UNKNOWN

Recovery Method: Sorbents

Spill Point:

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: Not reported
Product Amt Qualifier: UNKNOWN
Primary Product: True

Event:

Name: C N BROWN STORE #1039
Address: 268 MAIN STREET
City,State,Zip: BELFAST, ME
Spill Number: A-347-2009
Inc Tank Code: N
Inc Tank: None
Removal Flag: False
Ust Registered Flag: True
Ast Inside Flag: False
Create Date: 06/19/2009
Create By: EIJFISH
Modify Date: 10/28/2011
Modify By: EIELEIGH
Report Status: FR
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Actual Spill Time Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
MCD Value: 27010
Further Response Action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 6
Reporter Type: Contractor/Consultant
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: CM
Inc Location: Business - Commercial
Inc Source Code: TX
Inc Source: Storage Unit - Box or Other General Use Container
Spill Cause Code: 20
Spill Cause: Discharge - Deliberate/Other
Material Disposal Info: Disposal of soil by CN Brown with other oily waste stream.
Spills Document Search: <https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?D>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

atabase=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Porta
I.DEP&Password=DEPPortal1

Change:

Description: Report Status change from DQA to FR
Date Change: 10/28/2011
Changed By: EIELEIGH

Description: Report Status change from DRV to DQA
Date Change: 02/17/2011
Changed By: EIPBLANC

Description: Report Created with Report Status = DR
Date Change: 06/19/2009
Changed By: EIJFISH

Description: Report Status change from DR to DRV
Date Change: 06/19/2009
Changed By: EIJFISH

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: C N BROWN
Address: PO BOX 200 164 MAIN ST EXT
City,State: SO PARIS,ME
Country: USA
Zipcode: 04281
Phone/Ext: /
Comments: Not reported

Contact Type: Other Contact
Potential RP: True
Name: UNKNOWN DUMPER
Title: Not reported
Company: Not reported
Address: Not reported
City,State: ,ME
Country: USA
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: JASON A FISH

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 347

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN BULK PLANT (Continued)

S105112357

Spill Year: 2009
Create Date: 06/19/2009
Created By: EIJFISH
Modify Date: 06/19/2009
Modify By: EIJFISH
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 06/17/2009
Log Rep Prod Cd: 81
Log Rep Prod: WASTE OIL/USED MOTOR OIL
Log Emp Name: JASON A FISH
Location: 268 Main Street Belfast
Log Location Town: BELFAST
Log Tank Involved: None
Notes: 5 gallon pail of used motor oil accidentally tipped over.

Material Recovered:
Material Recovered Type: CS
Material Recovered: Contaminated Soil
Material Amount: .5
Material Units: cu. yds.
Material Amt Qualifier: ESTIMATE

Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 80
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Recovery Method: Excavation

Recovery Method: Sorbents

Spill Point:

Product:
Product Code: WASTE OIL/USED MOTOR OIL
Product Other: Not reported
Product Amt: 5
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

C6
SE
< 1/8
0.020 mi.
108 ft.

**MARITIME FARMS
262 MAIN STREET
BELFAST, ME**

Site 1 of 9 in cluster C

**ME LUST S110648138
N/A**

Relative:
Higher

LUST:

Actual:
193 ft.

Event:

Name: MARITIME FARMS
Address: 262 MAIN STREET
City,State,Zip: BELFAST, ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S110648138

Spill Number: A-485-2006
Spill Cause: Accident - Poor Workmanship
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 08/29/2006
Create By: EIEWERLY
Modify Date: 10/07/2010
Modify By: EIKWALKE
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Citizen Complaint
Detection Method: Other
Inc Location: Terminal - Service Station
Inc Source: Storage Unit - Underground Storage Tank
Material Disposal Info: Soils to Thibodeau's, water to Clean Harbors
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 08/29/2006
Changed By: EIEWERLY

Description: Report Status change from DRV to DQA
Date Change: 09/21/2010
Changed By: EIPBLANC

Description: Report Status change from DQA to FR
Date Change: 10/07/2010
Changed By: EIKWALKE

Description: Report Status change from DR to DRV
Date Change: 02/04/2009
Changed By: EIDDAVIS

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: MARITIME ENERGY
Address: PO BOX 485 234 PARK STREET
City,State: ROCKLAND,ME
Country: USA
Zipcode: 04841-0485
Phone/Ext: /
Comments: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S110648138

Primary Employee:
Primary Employee: True
Name: DANIEL E DAVIS

Media Affected:
Medium: Land

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 485
Spill Year: 2006
Create Date: 08/29/2006
Created By: EIEWERLY
Modify Date: 08/29/2006
Modify By: EIEWERLY
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 08/20/2006
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: DANIEL E DAVIS
Location: Maritime Energy 51
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: UST

Material Recovered:
Material Recovered Type: CS
Material Recovered: Contaminated Soil
Material Amount: 279
Material Units: cu. yds.
Material Amt Qualifier: ESTIMATE

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 83422
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Recovery Method: Excavation

Recovery Method: Pumps

Spill Point:
Date Reported: 8/20/2006
Notes: UST
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.423798
Longitude: -69.018819

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S110648138

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: Not reported
Product Amt Qualifier: UNKNOWN
Primary Product: True

Attachments:

Description: decision tree
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 08/20/2008

Description: clean up action agreement
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 08/20/2008

Description: soil letter
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 08/20/2008

Event:

Name: MARITIME FARMS 51
Address: 262 MAIN STREET
City,State,Zip: BELFAST, ME
Spill Number: A-798-2011
Spill Cause: Overfill
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/13/2011
Create By: EIEWERLY
Modify Date: 09/26/2012
Modify By: EIDDAVIS
Report Status: Final Report
Actual Spill Datetime: 12/11/2011
Actual Spill Date Unknown: False
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Other Involved Party
Detection Method: Visual Product
Inc Location: Terminal - Service Station

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S110648138

Inc Source: Land Transportation - Passenger Vehicle
Material Disposal Info: disposal of sorbent and speedi dri by Maritime Energy
Lust Document Search: [https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal](https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1)
I.DEF&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 12/13/2011
Changed By: EIEWERLY

Description: Report Status change from DR to DRV
Date Change: 05/01/2012
Changed By: EIGWALL

Description: Report Status change from DRV to FR
Date Change: 09/26/2012
Changed By: EIDDAVIS

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: UNKNOWN CUSTOMER
Title: Not reported
Company: Not reported
Address: Not reported
City,State: ,ME
Country: USA
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Contact Type: Other Contact
Potential RP: False
Name: Not reported
Title: Not reported
Company: BELFAST FIRE DEPT.
Address: 131 CHURCH STREET
City,State: BELFAST,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: GLEN WALL

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 798
Spill Year: 2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S110648138

Create Date: 12/13/2011
Created By: EIEWERLY
Modify Date: 05/01/2012
Modify By: EIGWALL
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 12/12/2011
Log Rep Prod Cd: 23
Log Rep Prod: UNLEADED GASOLINE
Log Emp Name: GLEN WALL
Location: 262 Main Street/Route 3 Maritime Farms 51
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: 5-10 gallons onto pavement and concrete at pump island Customer left nozzle unattended.

Material Recovered:
Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 40
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Recovery Method: Sorbents

Spill Point:

Product:
Product Code: UNLEADED GASOLINE
Product Other: Not reported
Product Amt: 8
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

C7
SE
< 1/8
0.020 mi.
108 ft.

COASTAL SMOKESHOP-MARITIME FARMS
262 MAIN ST
BELFAST, ME
Site 2 of 9 in cluster C

ME AST A100321884
N/A

Relative:
Higher
Actual:
193 ft.

AST 2:
Name: COASTAL SMOKESHOP-MARITIME FARMS
Address: 262 MAIN ST
City: BELFAST
Registration Number: 21109
Facility Location: BELFAST
Facility Telephone Number: 2075960986
Facility Use Code: RETAIL OIL
Owner Name: MARITIME ENERGY
Owner Contact: CHARON CURTIS
Owner Delivery Address: PO BOX 485
Owner Town: ROCKLAND
Owner State: ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COASTAL SMOKESHOP-MARITIME FARMS (Continued)

A100321884

Owner Zip: 04841
Owner Zip Plus: Not reported
Owner Telephone Number: 2075960986
Operator Name: MARITIME ENERGY
Operator Contact: CHARON CURTIS
Operator Delivery Address: PO BOX 485
Operator Town: ROCKLAND
Operator State: ME
Operator Zip: 04841
Operator Zip Plus: Not reported
Operator Telephone Number: 2075960986
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Nearby Water Other Owner: No
Nearby Water Other Owner Label: Not reported
Latitude: 44.42348712
Longitude: -69.01867763

Tank Number: 1
Tank Status: ACTIVE
Tank Status Label: ACTIVE
Status Date: 06/24/2008
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Date Installed: 10/21/2005
Tank Type: ABOVEGROUND
Substance: #1 FUEL OIL - KEROSENE
Tank Volume GI: 500
Tank Material: STEEL - BARE OR ASPHALT COATED.
Tank Leak Detection: NONE
Tank Leak Detection Label: NONE
Chamber Number: 1
Overfill Protection: LEVEL_GAUGE
Registration Date: 03/17/2006
Fed Regulated: No
Chamber Volume GI: 500
Chamber Pump Type Label: TANK MOUNTED
Chamber Pump Type Desc: TANK MOUNTED AST PUMP NO PIPING
Date Piping Installed: 10/20/2005
Piping Type: ABOVEGROUND
Piping Material: STEEL - BARE OR ASPHALT COATED.
Piping Status: ACTIVE
Piping Status Date: 10/20/2005
Piping Leak Detection: NONE
Pipe Leak Detection Label: NONE
Piping Status Label: ACTIVE
Overfill Protection Label: LEVEL GAUGE

C8	MARITIME ENERGY			EDR Hist Auto	1021393381
SE	262 MAIN ST				N/A
< 1/8	BELFAST, ME 04915				
0.020 mi.					
108 ft.	Site 3 of 9 in cluster C				
Relative:	EDR Hist Auto				
Higher					
Actual:	Year:	Name:	Type:		
193 ft.	2000	MARITIME ENERGY	Gasoline Service Stations, NEC		
	2001	MARITIME ENERGY	Gasoline Service Stations, NEC		
	2002	MARITIME ENERGY	Gasoline Service Stations, NEC		
	2003	MARITIME ENERGY	Gasoline Service Stations, NEC		

C9	COASTAL SMOKESHOP-MARITIME FARMS	ME UST	U004140403
SE	262 MAIN ST		N/A
< 1/8	BELFAST, ME		
0.020 mi.			
108 ft.	Site 4 of 9 in cluster C		
Relative:	UST:		
Higher	Name:	COASTAL SMOKESHOP-MARITIME FARMS	
	Address:	262 MAIN ST	
Actual:	City:	BELFAST	
193 ft.	Facility ID:	21109	
	Facility Location2:	BELFAST	
	Facility Code:	RETAIL OIL	
	Fed Reg Ind:	No	
	Owner Name:	MARITIME ENERGY	
	Owner Contact:	CHARON CURTIS	
	Owner Delivery Address:	PO BOX 485	
	Owner City/State/Zip:	ROCKLAND, ME 04841	
	Owner Telephone:	2075960986	
	Operator Contact:	CHARON CURTIS	
	On Aquifer:	No	
	On Aquifer Label:	Not reported	
	Near Public Water:	No	
	Near Public Water Label:	Not reported	
	Near Private Water:	No	
	Near Private Water Label:	Not reported	
	Near Other Water:	No	
	Nearby Water Other Owner Label:	Not reported	
	Latitude:	44.42348	
	Longitude:	-69.01867	
	Owner/Operator Name:	MARITIME ENERGY	
	Owner/Operator Address:	PO BOX 485	
	Owner/Operator City,St,Zip:	ROCKLAND, ME 04841	
	Owner/Operator Phone:	2075960986	
	Tank Number:	1	
	Tank Status:	ACTIVE	
	Tank Status Label:	ACTIVE	
	Tank Status Date:	24-JUN-08	
	Tank Sub Status:	Not reported	
	Tank Sub Status Label:	Not reported	
	Installation Date:	21-OCT-05	
	Product Type:	#1 FUEL OIL - KEROSENE	
	Tank Volume in Gallons:	500	
	Tank Above/Below:	ABOVEGROUND	
	Tank Material:	STEEL - BARE OR ASPHALT COATED.	

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COASTAL SMOKESHOP-MARITIME FARMS (Continued)

U004140403

Reg Date: 17-MAR-06
Tank Leak Detection Label: NONE
Chamber ID: 1
Chamber Pump Type Label: TANK MOUNTED
Chamber Pump Type Desc: TANK MOUNTED AST PUMP NO PIPING
Pipe Status: ACTIVE
Pipe Status Date: 20-OCT-05
Pipe Date Installed: 10/20/2005
Pipe Material Label: STEEL - BARE OR ASPHALT COATED.
Pipe Status Label: ACTIVE
Pipe Leak Detection: NONE
Pipe Leak Detection Label: NONE
Overfill: LEVEL_GAUGE
Overfill Protection Label: LEVEL GAUGE

A10
South
< 1/8
0.022 mi.
115 ft.

C.N. BROWN / BIG APPLE
ROUTE 1
BELFAST, ME
Site 4 of 12 in cluster A

ME LUST S106795357
N/A

Relative:
Higher

LUST:

Actual:
198 ft.

Event:

Name: C.N. BROWN / BIG APPLE
Address: ROUTE 1
City,State,Zip: BELFAST, ME
Spill Number: A-116-1997
Spill Cause: Overfill
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: Not reported
Number Wells Impacted: Not reported
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Tank and/or Piping Removal
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: D-Tree=BL2. Soil taken to Thibedeau Paving for processing.
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C.N. BROWN / BIG APPLE (Continued)

S106795357

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: C.N. BROWN
Address: P.O. BOX 200
City,State: SOUTH PARIS,ME
Country: Not reported
Zipcode: 04281
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: FRANCIS GEHRLING

File:

Spill Id: A-116-1997
Date Created: 08/27/1997
Created By: SPILLS
Date Modified: 03/23/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 23-MAR-09.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 116
Spill Year: 1997
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 04/14/1997
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: FRANCIS GEHRLING
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C.N. BROWN / BIG APPLE (Continued)

S106795357

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: gals.
Material Amt Qualifier: UNKNOWN

Recovery Method: Excavation

Spill Point:
Date Reported: 4/14/1997
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.433865
Longitude: -68.99918

Product:
Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: False

Event:
Name: C.N. BROWN / BIG APPLE
Address: ROUTE 1
City,State,Zip: BELFAST, ME
Spill Number: A-116-1997
Spill Cause: Overfill
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: Not reported
Number Wells Impacted: Not reported
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Tank and/or Piping Removal
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: D-Tree=BL2. Soil taken to Thibedeau Paving for processing.
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C.N. BROWN / BIG APPLE (Continued)

S106795357

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: C.N. BROWN
Address: P.O. BOX 200
City,State: SOUTH PARIS,ME
Country: Not reported
Zipcode: 04281
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: FRANCIS GEHRLING

File:

Spill Id: A-116-1997
Date Created: 08/27/1997
Created By: SPILLS
Date Modified: 03/23/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 23-MAR-09.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 116
Spill Year: 1997
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 04/14/1997
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: FRANCIS GEHRLING
Location: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C.N. BROWN / BIG APPLE (Continued)

S106795357

Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: gals.
Material Amt Qualifier: UNKNOWN

Recovery Method: Excavation

Spill Point:
Date Reported: 4/14/1997
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.433865
Longitude: -68.99918

Product:
Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: False

A11
South
< 1/8
0.022 mi.
115 ft.

C N BROWN; BELFAST HEATING OIL OFFICE
BELMONT AVE
BELFAST, ME
Site 5 of 12 in cluster A

ME LAST **S104219168**
N/A

Relative:
Higher

Actual:
198 ft.

LAST:
Event:
Name: C N BROWN; BELFAST HEATING OIL OFFICE
Address: BELMONT AVE
City,State,Zip: BELFAST, ME
Spill Number: A-18-2000
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: False
AST inside flag: False
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: 12/07/2001
Report Status Code: FR
Report Status: Final Report
Spill Datetime: Not reported
Spill Date Unknown: True
Spill Time Unknown: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN; BELFAST HEATING OIL OFFICE (Continued)

S104219168

Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: 0
Spill Type: Oil Incident
Reporter Type Code: 2
Reporter Type: Subject/Spiller
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: BP
Inc Location: Terminal - Bulk Plant
Inc Source Code: Not reported
Inc Source: Not reported
Spill Cause Code: 18
Spill Cause: Other - Unknown
Material Disposal Info: Not reported
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: C N BROWN
Address: PO BOX 200
City,State: SOUTH PARIS,ME
Country: Not reported
Zipcode: 04281
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: MARY CORR

File:

Spill Id: A-18-2000
Date Created: 02/21/2001
Created By: SPILLS
Date Modified: 05/13/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 13-MAY-09.
Reconcile Date: Not reported
File Reconciled By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C N BROWN; BELFAST HEATING OIL OFFICE (Continued)

S104219168

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 18
Spill Year: 2000
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 01/10/2000
Log Rep Prod Cd: 07
Log Rep Prod: UNSPECIFIED FUEL OIL
Log Emp Name: MARY CORR
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: Not reported

Material Recovered:

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: gals.
Material Amt Qualifier: UNKNOWN

Spill Point:

Recovery Method: Sorbents

Product:

Product Code: UNSPECIFIED FUEL OIL
Product Other: Not reported
Product Amt: 1
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: False

C12
SE
< 1/8
0.024 mi.
129 ft.

BELFAST, ME

Site 5 of 9 in cluster C

Relative:
Higher

LUST:

Actual:
192 ft.

Event:

Name: Not reported
Address: Not reported
City,State,Zip: BELFAST, ME

ME LUST S109800002
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S109800002

Spill Number: A-434-1990
Spill Cause: Corrosion - Tank
Spill Type: Non-Oil, Non-Hazardous Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: UST Tank Anomaly
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: Not reported
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: BELMONT AVENUE CAR WASH
Address: BELMONT AVE.
City,State: BELFAST,ME
Country: Not reported
Zipcode: 04217
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: DENNIS PHILLIPS

File:

Spill Id: A-434-1990
Date Created: 07/06/2000
Created By: SPILLS
Date Modified: 08/28/2008
Modified By: IMAGING
File Num Sheets: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S109800002

Notes: Report scanned into the imaging system on 28-AUG-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:
Medium: None

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 434
Spill Year: 1990
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Non-Oil, Non-Hazardous Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 08/29/1990
Log Rep Prod Cd: 30
Log Rep Prod: UNSPECIFIED MOTOR FUEL
Log Emp Name: DENNIS PHILLIPS
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: gals.
Material Amt Qualifier: UNKNOWN

Recovery Method: Not reported

Spill Point:
Date Reported: 8/29/1990
Notes: Not reported
Product: UNSPECIFIED MOTOR FUEL
Product Notes: Not reported
Latitude: 44.423827
Longitude: -69.018853

Product:
Product Code: UNSPECIFIED MOTOR FUEL
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C13
SE
< 1/8
0.025 mi.
132 ft.

MARITIME FARMS 51
RT 3
BELFAST, ME
Site 6 of 9 in cluster C

ME UST
ME AST
U003097465
N/A

Relative:
Higher

UST:

Actual:
192 ft.

Name: MARITIME FARMS 51
Address: RT 3
City: BELFAST
Facility ID: 3764
Facility Location2: BELFAST
Facility Code: RETAIL OIL
Fed Reg Ind: Yes
Owner Name: MARITIME ENERGY
Owner Contact: CHARON CURTIS
Owner Delivery Address: PO BOX 485
Owner City/State/Zip: ROCKLAND, ME 04841
Owner Telephone: 2075960986
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: WARE, SUSAN
Owner/Operator Address: PO BOX 485
Owner/Operator City,St,Zip: ROCKLAND, ME 04841
Owner/Operator Phone: Not reported

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-AUG-90
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-JAN-80
Product Type: LEADED GASOLINE
Tank Volume in Gallons: 4000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL WITH CATHODIC PROTECTION.
Reg Date: 07-AUG-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-AUG-90
Pipe Date Installed: Not reported
Pipe Material Label: STEEL WITH CATHODIC PROTECTION.
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS 51 (Continued)

U003097465

Overfill Protection Label:	UNKNOWN
Tank Number:	2
Tank Status:	REMOVED
Tank Status Label:	REMOVED
Tank Status Date:	01-APR-94
Tank Sub Status:	Not reported
Tank Sub Status Label:	Not reported
Installation Date:	01-JAN-84
Product Type:	UNLEADED GASOLINE
Tank Volume in Gallons:	4000
Tank Above/Below:	BELOWGROUND
Tank Material:	STEEL WITH CATHODIC PROTECTION.
Reg Date:	07-AUG-86
Tank Leak Detection Label:	UNKNOWN
Chamber ID:	1
Chamber Pump Type Label:	UNKNOWN
Chamber Pump Type Desc:	UNKNOWN
Pipe Status:	REMOVED
Pipe Status Date:	01-APR-94
Pipe Date Installed:	Not reported
Pipe Material Label:	STEEL WITH CATHODIC PROTECTION.
Pipe Status Label:	REMOVED
Pipe Leak Detection:	UNKNOWN
Pipe Leak Detection Label:	UNKNOWN
Overfill:	UNKNOWN
Overfill Protection Label:	UNKNOWN
Tank Number:	3
Tank Status:	REMOVED
Tank Status Label:	REMOVED
Tank Status Date:	01-APR-94
Tank Sub Status:	Not reported
Tank Sub Status Label:	Not reported
Installation Date:	01-JAN-84
Product Type:	UNLEADED GASOLINE
Tank Volume in Gallons:	4000
Tank Above/Below:	BELOWGROUND
Tank Material:	STEEL WITH CATHODIC PROTECTION.
Reg Date:	07-AUG-86
Tank Leak Detection Label:	UNKNOWN
Chamber ID:	1
Chamber Pump Type Label:	UNKNOWN
Chamber Pump Type Desc:	UNKNOWN
Pipe Status:	REMOVED
Pipe Status Date:	01-APR-94
Pipe Date Installed:	Not reported
Pipe Material Label:	STEEL WITH CATHODIC PROTECTION.
Pipe Status Label:	REMOVED
Pipe Leak Detection:	UNKNOWN
Pipe Leak Detection Label:	UNKNOWN
Overfill:	UNKNOWN
Overfill Protection Label:	UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS 51 (Continued)

U003097465

Tank Number:	4
Tank Status:	REMOVED
Tank Status Label:	REMOVED
Tank Status Date:	01-APR-94
Tank Sub Status:	Not reported
Tank Sub Status Label:	Not reported
Installation Date:	01-JAN-75
Product Type:	PREMIUM UNLEADED
Tank Volume in Gallons:	2000
Tank Above/Below:	BELOWGROUND
Tank Material:	STEEL WITH CATHODIC PROTECTION.
Reg Date:	07-AUG-86
Tank Leak Detection Label:	UNKNOWN
Chamber ID:	1
Chamber Pump Type Label:	UNKNOWN
Chamber Pump Type Desc:	UNKNOWN
Pipe Status:	REMOVED
Pipe Status Date:	01-APR-94
Pipe Date Installed:	Not reported
Pipe Material Label:	STEEL WITH CATHODIC PROTECTION.
Pipe Status Label:	REMOVED
Pipe Leak Detection:	UNKNOWN
Pipe Leak Detection Label:	UNKNOWN
Overfill:	UNKNOWN
Overfill Protection Label:	UNKNOWN
Tank Number:	5
Tank Status:	REMOVED
Tank Status Label:	REMOVED
Tank Status Date:	27-NOV-06
Tank Sub Status:	SA_APPROVED
Tank Sub Status Label:	SA APPROVED
Installation Date:	01-MAY-94
Product Type:	UNLEADED GASOLINE
Tank Volume in Gallons:	6000
Tank Above/Below:	BELOWGROUND
Tank Material:	JACKETED TANK - DOUBLE-WALLED
Reg Date:	07-AUG-86
Tank Leak Detection Label:	SECONDARY CONTAINMENT / CONT ELEC MON
Chamber ID:	1
Chamber Pump Type Label:	PRESSURIZED
Chamber Pump Type Desc:	PRESSURIZED
Pipe Status:	REMOVED
Pipe Status Date:	09-NOV-06
Pipe Date Installed:	Not reported
Pipe Material Label:	FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label:	REMOVED
Pipe Leak Detection:	SEC_CONT_CONTIN_ELEC_MON
Pipe Leak Detection Label:	SECONDARY CONTAINMENT / CONT ELEC MON
Overfill:	DROP_TUBE
Overfill Protection Label:	DROP TUBE
Tank Number:	6
Tank Status:	REMOVED
Tank Status Label:	REMOVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS 51 (Continued)

U003097465

Tank Status Date: 27-NOV-06
Tank Sub Status: **SA_APPROVED**
Tank Sub Status Label: SA APPROVED
Installation Date: 01-MAY-94
Product Type: UNLEADED PLUS
Tank Volume in Gallons: 4000
Tank Above/Below: BELOWGROUND
Tank Material: JACKETED TANK - DOUBLE-WALLED
Reg Date: 07-AUG-86
Tank Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Chamber ID: 1
Chamber Pump Type Label: PRESSURIZED
Chamber Pump Type Desc: PRESSURIZED
Pipe Status: **REMOVED**
Pipe Status Date: 09-NOV-06
Pipe Date Installed: Not reported
Pipe Material Label: FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label: REMOVED
Pipe Leak Detection: SEC_CONT_CONTIN_ELEC_MON
Pipe Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Overfill: DROP_TUBE
Overfill Protection Label: DROP TUBE

Tank Number: 7
Tank Status: **REMOVED**
Tank Status Label: REMOVED
Tank Status Date: 27-NOV-06
Tank Sub Status: **SA_APPROVED**
Tank Sub Status Label: SA APPROVED
Installation Date: 01-MAY-94
Product Type: PREMIUM UNLEADED
Tank Volume in Gallons: 4000
Tank Above/Below: BELOWGROUND
Tank Material: JACKETED TANK - DOUBLE-WALLED
Reg Date: 07-AUG-86
Tank Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Chamber ID: 1
Chamber Pump Type Label: PRESSURIZED
Chamber Pump Type Desc: PRESSURIZED
Pipe Status: **REMOVED**
Pipe Status Date: 09-NOV-06
Pipe Date Installed: Not reported
Pipe Material Label: FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label: REMOVED
Pipe Leak Detection: SEC_CONT_CONTIN_ELEC_MON
Pipe Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Overfill: DROP_TUBE
Overfill Protection Label: DROP TUBE

Tank Number: 8
Tank Status: **ACTIVE**
Tank Status Label: ACTIVE
Tank Status Date: 10-DEC-06
Tank Sub Status: **IN_SERVICE**
Tank Sub Status Label: IN SERVICE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS 51 (Continued)

U003097465

Installation Date: 10-DEC-06
Product Type: UNLEADED GASOLINE
Tank Volume in Gallons: 6000
Tank Above/Below: BELOWGROUND
Tank Material: JACKETED TANK - DOUBLE-WALLED
Reg Date: 07-AUG-86
Tank Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Chamber ID: 1
Chamber Pump Type Label: PRESSURIZED
Chamber Pump Type Desc: PRESSURIZED
Pipe Status: ACTIVE
Pipe Status Date: 10-DEC-06
Pipe Date Installed: 12/10/2006
Pipe Material Label: FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label: ACTIVE
Pipe Leak Detection: SEC_CONT_CONTIN_ELEC_MON
Pipe Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Overfill: DROP_TUBE
Overfill Protection Label: DROP TUBE

Tank Number: 8
Tank Status: ACTIVE
Tank Status Label: ACTIVE
Tank Status Date: 10-DEC-06
Tank Sub Status: IN_SERVICE
Tank Sub Status Label: IN SERVICE
Installation Date: 10-DEC-06
Product Type: PREMIUM UNLEADED
Tank Volume in Gallons: 6000
Tank Above/Below: BELOWGROUND
Tank Material: JACKETED TANK - DOUBLE-WALLED
Reg Date: 07-AUG-86
Tank Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Chamber ID: 2
Chamber Pump Type Label: PRESSURIZED
Chamber Pump Type Desc: PRESSURIZED
Pipe Status: ACTIVE
Pipe Status Date: 10-DEC-06
Pipe Date Installed: 12/10/2006
Pipe Material Label: FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label: ACTIVE
Pipe Leak Detection: SEC_CONT_CONTIN_ELEC_MON
Pipe Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Overfill: DROP_TUBE
Overfill Protection Label: DROP TUBE

Tank Number: 9
Tank Status: ACTIVE
Tank Status Label: ACTIVE
Tank Status Date: 23-MAR-06
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 23-MAR-06
Product Type: #1 FUEL OIL - KEROSENE
Tank Volume in Gallons: 500

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS 51 (Continued)

U003097465

Tank Above/Below: ABOVEGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 07-AUG-86
Tank Leak Detection Label: NONE
Chamber ID: 1
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Pipe Status: ACTIVE
Pipe Status Date: 23-MAR-06
Pipe Date Installed: 03/23/2006
Pipe Material Label: STEEL - BARE OR ASPHALT COATED.
Pipe Status Label: ACTIVE
Pipe Leak Detection: NONE
Pipe Leak Detection Label: NONE
Overfill: NONE
Overfill Protection Label: NONE

AST 2:

Name: MARITIME FARMS 51
Address: RT 3
City: BELFAST
Registration Number: 3764
Facility Location: BELFAST
Facility Telephone Number: 2073383041
Facility Use Code: RETAIL OIL
Owner Name: MARITIME ENERGY
Owner Contact: CHARON CURTIS
Owner Delivery Address: PO BOX 485
Owner Town: ROCKLAND
Owner State: ME
Owner Zip: 04841
Owner Zip Plus: Not reported
Owner Telephone Number: 2075960986
Operator Name: WARE, SUSAN
Operator Contact: Not reported
Operator Delivery Address: PO BOX 485
Operator Town: ROCKLAND
Operator State: ME
Operator Zip: 04841
Operator Zip Plus: Not reported
Operator Telephone Number: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Nearby Water Other Owner: No
Nearby Water Other Owner Label: Not reported
Latitude: 44.42348712
Longitude: -69.01867763

Tank Number: 9
Tank Status: ACTIVE
Tank Status Label: ACTIVE
Status Date: 03/23/2006
Tank Sub Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS 51 (Continued)

U003097465

Tank Sub Status Label: Not reported
Date Installed: 03/23/2006
Tank Type: ABOVEGROUND
Substance: #1 FUEL OIL - KEROSENE
Tank Volume Gl: 500
Tank Material: STEEL - BARE OR ASPHALT COATED.
Tank Leak Detection: NONE
Tank Leak Detection Label: NONE
Chamber Number: 1
Overfill Protection: NONE
Registration Date: 08/07/1986
Fed Regulated: No
Chamber Volume Gl: 500
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Date Piping Installed: 03/23/2006
Piping Type: ABOVEGROUND
Piping Material: STEEL - BARE OR ASPHALT COATED.
Piping Status: ACTIVE
Piping Status Date: 03/23/2006
Piping Leak Detection: NONE
Pipe Leak Detection Label: NONE
Piping Status Label: ACTIVE
Overfill Protection Label: NONE

**A14
SSE
< 1/8
0.038 mi.
203 ft.**

**BIG APPLE BELFAST
BELMONT & STARRETT DRS
BELFAST, ME**

**ME UST U000235906
N/A**

Site 6 of 12 in cluster A

**Relative:
Higher**

UST:

**Actual:
200 ft.**

Name: BIG APPLE BELFAST
Address: BELMONT & STARRETT DRS
City: BELFAST
Facility ID: 15227
Facility Location2: BELFAST
Facility Code: RETAIL OIL
Fed Reg Ind: Yes
Owner Name: CN BROWN CO
Owner Contact: KEVIN KNIGHTLY
Owner Delivery Address: PO BOX 200
Owner City/State/Zip: SOUTH PARIS, ME 04281
Owner Telephone: 2077439212
Operator Contact: KEVIN KNIGHTLY
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: 44.42354
Longitude: -69.01941
Owner/Operator Name: CN BROWN CO
Owner/Operator Address: PO BOX 200
Owner/Operator City,St,Zip: SOUTH PARIS, ME 04281

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIG APPLE BELFAST (Continued)

U000235906

Owner/Operator Phone: 2077439212

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 12-FEB-10
Tank Sub Status: SA_APPROVED
Tank Sub Status Label: SA APPROVED
Installation Date: 01-MAY-89
Product Type: UNLEADED GASOLINE
Tank Volume in Gallons: 10000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL WITH CATHODIC PROTECTION.
Reg Date: 22-SEP-88
Tank Leak Detection Label: AUTOMATIC TANK GAUGE
Chamber ID: 1
Chamber Pump Type Label: PRESSURIZED
Chamber Pump Type Desc: PRESSURIZED
Pipe Status: REMOVED
Pipe Status Date: 12-FEB-10
Pipe Date Installed: 05/01/1989
Pipe Material Label: F/GLASS - PETROLEUM
Pipe Status Label: REMOVED
Pipe Leak Detection: INLINE_LEAK_DETECTOR
Pipe Leak Detection Label: INLINE LEAK DETECTOR
Overfill: DROP_TUBE
Overfill Protection Label: DROP TUBE

Tank Number: 2
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 12-FEB-10
Tank Sub Status: SA_APPROVED
Tank Sub Status Label: SA APPROVED
Installation Date: 01-MAY-89
Product Type: UNLEADED GASOLINE
Tank Volume in Gallons: 10000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL WITH CATHODIC PROTECTION.
Reg Date: 22-SEP-88
Tank Leak Detection Label: AUTOMATIC TANK GAUGE
Chamber ID: 1
Chamber Pump Type Label: PRESSURIZED
Chamber Pump Type Desc: PRESSURIZED
Pipe Status: REMOVED
Pipe Status Date: 12-FEB-10
Pipe Date Installed: 05/01/1989
Pipe Material Label: F/GLASS - PETROLEUM
Pipe Status Label: REMOVED
Pipe Leak Detection: INLINE_LEAK_DETECTOR
Pipe Leak Detection Label: INLINE LEAK DETECTOR
Overfill: DROP_TUBE
Overfill Protection Label: DROP TUBE

Tank Number: 3

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIG APPLE BELFAST (Continued)

U000235906

Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 12-FEB-10
Tank Sub Status: SA_APPROVED
Tank Sub Status Label: SA APPROVED
Installation Date: 01-MAY-89
Product Type: PREMIUM UNLEADED
Tank Volume in Gallons: 10000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL WITH CATHODIC PROTECTION.
Reg Date: 22-SEP-88
Tank Leak Detection Label: AUTOMATIC TANK GAUGE
Chamber ID: 1
Chamber Pump Type Label: PRESSURIZED
Chamber Pump Type Desc: PRESSURIZED
Pipe Status: REMOVED
Pipe Status Date: 12-FEB-10
Pipe Date Installed: 05/01/1989
Pipe Material Label: F/GLASS - PETROLEUM
Pipe Status Label: REMOVED
Pipe Leak Detection: INLINE_LEAK_DETECTOR
Pipe Leak Detection Label: INLINE LEAK DETECTOR
Overfill: VENT BALL
Overfill Protection Label: VENT BALL

C15
ESE
< 1/8
0.041 mi.
215 ft.

BELFAST RITE AID
256 MAIN STREET
BELFAST, ME

Site 7 of 9 in cluster C

ME INST CONTROL **S118954723**
ME VCP **N/A**
ME ALLSITES

Relative:
Higher

Actual:
197 ft.

INST CONTROL:
Name: BELFAST RITE AID
Address: 256 MAIN STREET
City,State,Zip: BELFAST, ME
Facility ID: REM00974
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.42376 / -69.01789
Institutional Control?: TRUE
Alias: Not reported
Acres: Not reported
Sub Status: Not reported
Status Date: Not reported

VCP:
Name: BELFAST RITE AID
Address: 256 MAIN STREET
City,State,Zip: BELFAST, ME
Facility ID: REM00974
Facility status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.42376 / -69.01789
Institutional Control?: TRUE
Alias: MAINE STREET RARED CO
Acres: 2
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST RITE AID (Continued)

S118954723

Status Date: 07/20/2016

ALLSITES:

Name: BELFAST RITE AID
Address: 256 MAIN STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.42376 / -69.01789
Institutional Control?: TRUE
Alias: MAINE STREET RARED CO
Acres: 2
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 07/20/2016

A16
South
< 1/8
0.045 mi.
237 ft.

HANNAFORD BELFAST #8241
14 STARRETT DRIVE
BELFAST, ME

ME AST **S108053261**
ME TIER 2 **N/A**

Site 7 of 12 in cluster A

Relative:
Higher
Actual:
200 ft.

AST:

Name: BELFAST HANNAFORD #8241
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME 04915
Facility ID: FATR20214XVVMA00VDLX
Facility Status: Not reported
Facility Phone: Not reported
Facility Dept: Energy
Record Id: Not reported
CAS Number: Not reported
Submitted By: Not reported
Max Container is Holding: 3360
Max Amount Container: 16800
Location: behind the store
Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Lat/Long: 44.4199 / -69.0181

Chemical Name: PROPANE
Amount: 16800
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2021

Name: BELFAST HANNAFORD #8241
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Amount: 16800
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2020

Name: BELFAST HANNAFORD #8241
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 16800
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2019

Name: HANNAFORD BELFAST #8241
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 16800
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2018

Name: HANNAFORD BELFAST #8241
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 16800
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2017

Name: HANNAFORD BELFAST #8241
Address: 14 STARRETT DRIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 16800
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2016

Name: HANNAFORD BELFAST #8241
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 16800
Amount Unit: pounds
Type Code: Above
Pressure Code: Great
Temperature Code: Ambie
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2015

Name: HANNAFORD BELFAST #8241
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 16800
Amount Unit: pounds
Type Code: Above
Pressure Code: Great
Temperature Code: Ambie
Max Amount Code: 6
Days On Site: 365
CIEHS Chemical: No
Report Year: 2014

Name: HANNAFORD - BELFAST #8241
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 16800
Amount Unit: pounds
Type Code: Above
Pressure Code: Great
Temperature Code: Ambie
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2013

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Name: HANNAFORD BELFAST
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 16800
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2012

[Click this hyperlink](#) while viewing on your computer to access
5 additional ME_AST: record(s) in the EDR Site Report.

TIER 2:

Name: HANNAFORD BELFAST HANNAFORD #8241
Address: 14 STARRETT DRIVE
City,State,Zip: BELFAST, ME
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
Facility Mailing Country: Not reported
Report Year: 2010
Submitted By: Harrison Horning, Director, Facilities & Energy
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported
Facility Router Record ID: Not reported
Chemical Inventory Record ID: Not reported
Chemical Same As Last Year: T
Chronic: Not reported
CICAS: Not reported
CI EHS Chemical: Not reported
CI Last Modified: Not reported
MSDS Number For Chemical: Not reported
CI Notes: Not reported
Days On Site: Not reported
Entered Chemical Name: Not reported
Fire: Not reported
Gas: Not reported
Liquid: Not reported
Maximum Amount: Not reported
Maximum Amount Code: Not reported
Maximum Amount Container: Not reported
Mixture: Not reported
Pressure: Not reported
Pure: Not reported
Reactive: Not reported
Solid: Not reported
Date Signed: 2/22/2011
Date TierII Received: Not reported
Facility Dept: Energy

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Facility ID:	FATR20104XVVMMA00VDLX
Failed Validation:	Not reported
Facility Date Modified:	09/12/2011
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	BELFAST HANNAFORD
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2009
Submitted By:	Harrison Horning, Director, Facilities & Energy
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/10/2010
Date TierII Received:	Not reported
Facility Dept:	Energy
Facility ID:	FATR20094XVVMMA00VDLX
Failed Validation:	Not reported
Facility Date Modified:	3/4/2010

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	This facility passed all validation checks.
Latitude:	Not reported
Longitude:	Not reported
Name:	HANNAFORD BELFAST #8241
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2017
Submitted By:	Harrison Horning, Director, Facilities & Energy
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	1/15/2018
Date TierII Received:	Not reported
Facility Dept:	Energy
Facility ID:	FATR20174XVMA00VDLX
Failed Validation:	Not reported
Facility Date Modified:	09/13/2018
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.41989
Longitude:	-69.01810
Name:	BELFAST HANNAFORD
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2007
Submitted By:	Not reported
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20074XVVMMA00VDLX
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	HANNAFORD - BELFAST #8241
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2013
Submitted By:	Harrison Horning, Director, Facilities & Energy
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	1/9/2014
Date TierII Received:	Not reported
Facility Dept:	Energy
Facility ID:	FATR20134XVVM00VDLX
Failed Validation:	Not reported
Facility Date Modified:	08/26/2014
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Validation Report:	Not reported
Latitude:	44.42311
Longitude:	-69.01946
Name:	BELFAST HANNAFORD
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2006
Submitted By:	Harrison Horning, Energy Manager
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/9/2007
Date TierII Received:	Not reported
Facility Dept:	Energy
Facility ID:	FATR20064XVMA00VDLX
Failed Validation:	Not reported
Facility Date Modified:	4/18/2007
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Name:	HANNAFORD BELFAST #8241
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	P.O. Box 8094
Facility Mailing City:	Portland
Facility Mailing State:	ME
Facility Mailing Zip:	04101
Facility Mailing Country:	USA
Report Year:	2011
Submitted By:	Harrison Horning, Director, Facilities & Energy
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	1/24/2012
Date TierII Received:	Not reported
Facility Dept:	Energy
Facility ID:	FATR20114XVVMA00VDLX
Failed Validation:	Not reported
Facility Date Modified:	11/02/2012
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	HANNAFORD BELFAST #8241
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME 04915

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2016
Submitted By:	Harrison Horning, Director, Facilities & Energy
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	1/23/2017
Date TierII Received:	Not reported
Facility Dept:	Energy
Facility ID:	FATR20164XVVMMA00VDLX
Failed Validation:	Not reported
Facility Date Modified:	08/28/2017
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42312
Longitude:	-69.01947
Name:	HANNAFORD BELFAST
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	P. O. Box 8094
Facility Mailing City:	Portland
Facility Mailing State:	ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Facility Mailing Zip:	04101
Facility Mailing Country:	USA
Report Year:	2012
Submitted By:	Harrison Horning, Director, Facilities & Energy
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	1/16/2013
Date TierII Received:	Not reported
Facility Dept:	Energy
Facility ID:	FATR20124XVVMA00VDLX
Failed Validation:	Not reported
Facility Date Modified:	08/14/2013
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	BELFAST HANNAFORD
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Submitted By:	Harrison Horning, Director, Facilities & Energy
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/3/2009
Date TierII Received:	Not reported
Facility Dept:	Energy
Facility ID:	FATR20084XVMA00VDLX
Failed Validation:	T
Facility Date Modified:	2/17/2009
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	A SIC code must be reported.
Latitude:	Not reported
Longitude:	Not reported
Name:	HANNAFORD BELFAST #8241
Address:	14 STARRETT DRIVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2014
Submitted By:	Harrison Horning, Director, Facilities & Energy
Acute/Chronic:	Not reported
Average Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNAFORD BELFAST #8241 (Continued)

S108053261

Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	1/29/2015
Date TierII Received:	Not reported
Facility Dept:	Energy
Facility ID:	FATR20144XVVMMA00VDLX
Failed Validation:	Not reported
Facility Date Modified:	11/10/2015
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42312
Longitude:	-69.01947

A17
SW
< 1/8
0.048 mi.
255 ft.

SHERWIN WILLIAMS CO THE
BELFAST SHPG CTR RT1&3 BOX 381
BELFAST, ME 04915

RCRA NonGen / NLR **1000370680**
MED047365226

Site 8 of 12 in cluster A

Relative:
Higher

RCRA Listings:

Actual:
202 ft.

Date Form Received by Agency:	19800818
Handler Name:	SHERWIN WILLIAMS CO THE
Handler Address:	BELFAST SHPG CTR RT1&3 BOX 381
Handler City,State,Zip:	BELFAST, ME 04915
EPA ID:	MED047365226
Contact Name:	B H
Contact Address:	BELFAST SHPG CTR RT1&3 BOX 381
Contact City,State,Zip:	BELFAST, ME 04915
Contact Telephone:	216-566-3096

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHERWIN WILLIAMS CO THE (Continued)

1000370680

Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	01
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	Not reported
State District:	Not reported
Mailing Address:	BELFAST SHPG CTR RT1&3 BOX 381
Mailing City,State,Zip:	BELFAST, ME 04915
Owner Name:	THE SHERWIN WILLIAMS CO
Owner Type:	Private
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHERWIN WILLIAMS CO THE (Continued)

1000370680

Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20000902
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code: D000
Waste Description: Not Defined

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: D002
Waste Description: CORROSIVE WASTE

Waste Code: D003
Waste Description: REACTIVE WASTE

Waste Code: F002
Waste Description: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F003
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F005
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHERWIN WILLIAMS CO THE (Continued)

1000370680

2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F017

Waste Description: Not Defined

Waste Code: F018

Waste Description: Not Defined

Waste Code: P090

Waste Description: Not Defined

Waste Code: U002

Waste Description: 2-PROPANONE (I) (OR) ACETONE (I)

Waste Code: U031

Waste Description: 1-BUTANOL (I) (OR) N-BUTYL ALCOHOL (I)

Waste Code: U112

Waste Description: ACETIC ACID, ETHYL ESTER (I) (OR) ETHYL ACETATE (I)

Waste Code: U150

Waste Description: L-PHENYLALANINE, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) MELPHALAN

Waste Code: U154

Waste Description: METHANOL (I) (OR) METHYL ALCOHOL (I)

Waste Code: U159

Waste Description: 2-BUTANONE (I,T) (OR) METHYL ETHYL KETONE (MEK) (I,T)

Waste Code: U161

Waste Description: 4-METHYL-2-PENTANONE (I) (OR) METHYL ISOBUTYL KETONE (I) (OR) PENTANOL, 4-METHYL-

Waste Code: U220

Waste Description: BENZENE, METHYL- (OR) TOLUENE

Waste Code: U239

Waste Description: BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)

Handler - Owner Operator:

Owner/Operator Indicator: Owner

Owner/Operator Name: THE SHERWIN WILLIAMS CO

Legal Status: Private

Date Became Current: Not reported

Date Ended Current: Not reported

Owner/Operator Address: OWNERSTREET

Owner/Operator City,State,Zip: OWNERCITY, ME 99999

Owner/Operator Telephone: 207-555-1212

Owner/Operator Telephone Ext: Not reported

Owner/Operator Fax: Not reported

Owner/Operator Email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHERWIN WILLIAMS CO THE (Continued)

1000370680

Historic Generators:

Receive Date: 19800818
Handler Name: SHERWIN WILLIAMS CO THE
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

**A18
SW
< 1/8
0.048 mi.
255 ft.**

**FLEET BANK
JCT RT 1 BY PASS & RT 3
BELFAST, ME**

**ME UST U002161058
N/A**

Site 9 of 12 in cluster A

**Relative:
Higher
Actual:
202 ft.**

UST:

Name: FLEET BANK
Address: JCT RT 1 BY PASS & RT 3
City: BELFAST
Facility ID: 8652
Facility Location2: BELFAST
Facility Code: COMMERCIAL
Fed Reg Ind: No
Owner Name: BANGOR SAVINGS BANK
Owner Contact: Not reported
Owner Delivery Address: PO BOX 930
Owner City/State/Zip: BANGOR, ME 04402 0930
Owner Telephone: 2079425211
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: MERRILL TRUST CO THE
Owner/Operator Address: 56 CHURCH ST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FLEET BANK (Continued)

U002161058

Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073381250

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-JAN-88
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-SEP-72
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 550
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 17-OCT-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-JAN-88
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

A19
SW
< 1/8
0.048 mi.
255 ft.

DUTCH CHEVROLET, BUICK, INC.
6 BELMONT AVENUE
BELFAST, ME 04915

RCRA-VSQG **1000169291**
RI MANIFEST **MED018989285**

Site 10 of 12 in cluster A

Relative:
Higher

Actual:
202 ft.

RCRA Listings:
Date Form Received by Agency: 20170622
Handler Name: DUTCH CHEVROLET, BUICK, INC.
Handler Address: 6 BELMONT AVENUE
Handler City,State,Zip: BELFAST, ME 04915
EPA ID: MED018989285
Contact Name: GREGORY A DUTCH
Contact Address: BELMONT AVENUE
Contact City,State,Zip: BELFAST, ME 04915
Contact Telephone: 207-338-1470
Contact Fax: 207-338-1283
Contact Email: GREGD@DUTCHCHEVY.COM
Contact Title: OWNER/PRESIDENT
EPA Region: 01
Land Type: Private
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: Not reported
Accessibility: Not reported
Active Site Indicator: Handler Activities
State District Owner: Not reported
State District: Not reported
Mailing Address: BELMONT AVENUE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Mailing City,State,Zip:	BELFAST, ME 04915
Owner Name:	DUTCH CHEVROLET, BUICK, INC.
Owner Type:	Private
Operator Name:	DUTCH CHEVROLET, BUICK, INC.
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20170622
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined

Waste Code:	D001
Waste Description:	IGNITABLE WASTE

Waste Code:	F003
Waste Description:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code:	F005
Waste Description:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	DUTCH CHEVROLET, BUICK, INC.
Legal Status:	Private
Date Became Current:	19560101
Date Ended Current:	Not reported
Owner/Operator Address:	6 BELMONT AVENUE
Owner/Operator City,State,Zip:	BELFAST, ME 04915
Owner/Operator Telephone:	207-338-1470
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	207-338-1283
Owner/Operator Email:	GREGD@DUTCHCHEVY.COM

Owner/Operator Indicator:	Operator
Owner/Operator Name:	DUTCH CHEVROLET, BUICK, INC.
Legal Status:	Private
Date Became Current:	19560101
Date Ended Current:	Not reported
Owner/Operator Address:	6 BELMONT AVENUE
Owner/Operator City,State,Zip:	BELFAST, ME 04915
Owner/Operator Telephone:	207-338-1470
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	207-338-1283

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Owner/Operator Email: GREGD@DUTHCHEVY.COM

Owner/Operator Indicator: Owner
Owner/Operator Name: BRYANT, GREGORY AND TIM DUTCH
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: OWNERSTREET
Owner/Operator City,State,Zip: OWNERCITY, ME 99999
Owner/Operator Telephone: 207-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19860909
Handler Name: DUTCH CHEVROLET OLDS BUICK PONTIAC INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20170622
Handler Name: DUTCH CHEVROLET, BUICK, INC.
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920228
Handler Name: DUTCH CHEVROLET OLDS BUICK PONTIAC INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 44111

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

NAICS Description:	NEW CAR DEALERS
NAICS Code:	441110
NAICS Description:	NEW CAR DEALERS
NAICS Code:	811111
NAICS Description:	GENERAL AUTOMOTIVE REPAIR
NAICS Code:	811121
NAICS Description:	AUTOMOTIVE BODY, PAINT, AND INTERIOR REPAIR AND MAINTENANCE

Facility Has Received Notices of Violation:

Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Listing - General
Date Violation was Determined:	20090312
Actual Return to Compliance Date:	20090507
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20090407
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	20090507
Disposition Status:	AS
Disposition Status Description:	ACTION SATISFIED (CASE CLOSED)
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	RMCME
Enforcement Responsible Sub-Organization:	A
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Universal Waste - Large Quantity Handlers
Date Violation was Determined:	20090312
Actual Return to Compliance Date:	20090507
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20090407
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	20090507
Disposition Status:	AS
Disposition Status Description:	ACTION SATISFIED (CASE CLOSED)
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	RMCME
Enforcement Responsible Sub-Organization:	A
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - Container Use and Management
Date Violation was Determined:	20090312
Actual Return to Compliance Date:	20090507
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20090407
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	20090507
Disposition Status:	AS
Disposition Status Description:	ACTION SATISFIED (CASE CLOSED)
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	RMCME
Enforcement Responsible Sub-Organization:	A
SEP Sequence Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - Pre-transport
Date Violation was Determined:	20090312
Actual Return to Compliance Date:	20090507
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20090407
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	20090507
Disposition Status:	AS
Disposition Status Description:	ACTION SATISFIED (CASE CLOSED)
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	RMCME
Enforcement Responsible Sub-Organization:	A
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Listing - Characteristics
Date Violation was Determined:	20090312
Actual Return to Compliance Date:	20090507
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20090407
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	20090507
Disposition Status:	AS
Disposition Status Description:	ACTION SATISFIED (CASE CLOSED)
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	RMCME
Enforcement Responsible Sub-Organization:	A
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Listing - Characteristics
Date Violation was Determined:	20090312
Actual Return to Compliance Date:	20090507
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20090407
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	20090507
Disposition Status:	AS
Disposition Status Description:	ACTION SATISFIED (CASE CLOSED)
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	RMCME
Enforcement Responsible Sub-Organization:	A
SEP Sequence Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	20090312
Actual Return to Compliance Date:	20090507
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20090407
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	20090507
Disposition Status:	AS
Disposition Status Description:	ACTION SATISFIED (CASE CLOSED)
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	RMCME
Enforcement Responsible Sub-Organization:	A
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Listing - Characteristics
Date Violation was Determined:	20090312
Actual Return to Compliance Date:	20090507
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20090407
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	20090507
Disposition Status:	AS
Disposition Status Description:	ACTION SATISFIED (CASE CLOSED)
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	RMCME
Enforcement Responsible Sub-Organization:	A
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Evaluation Action Summary:

Evaluation Date:	20090312
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	RMCME
Evaluation Responsible Sub-Organization:	A
Actual Return to Compliance Date:	20090507
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Evaluation Date:	20090312
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	RMCME
Evaluation Responsible Sub-Organization:	A
Actual Return to Compliance Date:	20090507
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Evaluation Date: 20090312
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: RMCME
Evaluation Responsible Sub-Organization: A
Actual Return to Compliance Date: 20090507
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20090312
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: RMCME
Evaluation Responsible Sub-Organization: A
Actual Return to Compliance Date: 20090507
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20090312
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: RMCME
Evaluation Responsible Sub-Organization: A
Actual Return to Compliance Date: 20090507
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20090312
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: RMCME
Evaluation Responsible Sub-Organization: A
Actual Return to Compliance Date: 20090507
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20090312
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: RMCME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Evaluation Responsible Sub-Organization:	A
Actual Return to Compliance Date:	20090507
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20090312
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	RMCME
Evaluation Responsible Sub-Organization:	A
Actual Return to Compliance Date:	20090507
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

RI MANIFEST:

Name:	DUTCH CHEVROLET
Address:	JUNCTION RTES 1 & 3
City,State,Zip:	BELFAST, ME 04915
EPA Id:	MED018989285
GEN Cert Date:	7/17/2007
Manifest Document Number:	000022233
Waste Description:	RQ, WASTE FLAMMABLESOLIDS, NOS, 4.1
TSDf Id:	RID084802842
TSDf Name:	United Oil Recovery Inc
Qty:	350
WT/Vol Units:	P
TSDf Date:	7/26/2007
Transporter 2 Id:	Not reported
Item Number:	a
Transporter 2 Name:	Not reported
Transporter Name 2:	UNITED INDUSTRIAL SERVICES
Transporter EPAID:	CTD021816889
Transporter Receipt Date:	7/17/2007
Number Of Containers:	1
Container Type:	DM
Waste Code1:	D035
Waste Code2:	F003
Waste Code3:	F005
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Fee Exempt Code:	Not reported
Comment:	Not reported
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
Quarter:	Not reported
Transporter Contact Name:	Not reported
Transporter Contact Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Filing Date: Not reported
Total Fee: Not reported
Billing Name: Not reported
Paid Date: Not reported
Paid Time: Not reported
Facility Receipt Date: Not reported
Fee: Not reported
Manifest Created Date: Not reported
Manifest Updated Date: Not reported

RI MANIFEST:

Transporter Receipt Date: 7/17/2007
Number Of Containers: 1
Container Type: DM
Waste Code1: D035
Waste Code2: F003
Waste Code3: F005
Waste Code4: Not reported
Waste Code5: Not reported
Waste Code6: Not reported
Comment: Not reported
Fee Exempt Code: Not reported
TSDF Name: United Oil Recovery Inc
TSDF Id: RID084802842
Transporter Name 2: Not reported
Company Permit Number: Not reported
Year: Not reported
EPA ID: MED018989285
Manifest Docket Number: 000022233
Quarter: Not reported
Waste Description: RQ, WASTE FLAMMABLESOLIDS, NOS, 4.1
Transporter Contact Name: Not reported
Quantity: 350
Transporter Contact Email: Not reported
WT/Vol Units: P
Filing Date: Not reported
Total Fee: Not reported
Item Number: a
Transporter Name: UNITED INDUSTRIAL SERVICES
Billing Name: Not reported
Transporter EPA ID: CTD021816889
Date Paid: Not reported
Time Paid: Not reported
GEN Cert Date: 7/17/2007
Facility Receipt Date: Not reported
Fee: Not reported
Transporter 2 Receipt Date: Not reported
Manifest Created Date: Not reported
TSDF Receipt Date: 7/26/2007
Transporter 2 ID: Not reported
Manifest Updated Date: Not reported

Transporter Receipt Date: 7/17/2007
Number Of Containers: 1
Container Type: DM
Waste Code1: D035
Waste Code2: F003
Waste Code3: F005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET, BUICK, INC. (Continued)

1000169291

Waste Code4: Not reported
Waste Code5: Not reported
Waste Code6: Not reported
Comment: Not reported
Fee Exempt Code: Not reported
TSDF Name: United Oil Recovery Inc
TSDF Id: RID084802842
Transporter Name 2: Not reported
Company Permit Number: Not reported
Year: Not reported
EPA ID: MED018989285
Manifest Docket Number: 000022233
Quarter: Not reported
Waste Description: RQ, WASTE FLAMMABLESOLIDS, NOS, 4.1
Transporter Contact Name: Not reported
Quantity: 350
Transporter Contact Email: Not reported
WT/Vol Units: P
Filing Date: Not reported
Total Fee: Not reported
Item Number: a
Transporter Name: UNITED INDUSTRIAL SERVICES
Billing Name: Not reported
Transporter EPA ID: CTD021816889
Date Paid: Not reported
Time Paid: Not reported
GEN Cert Date: 7/17/2007
Facility Receipt Date: Not reported
Fee: Not reported
Transporter 2 Receipt Date: Not reported
Manifest Created Date: Not reported
TSDF Receipt Date: 7/26/2007
Transporter 2 ID: Not reported
Manifest Updated Date: Not reported

A20
South
< 1/8
0.049 mi.
258 ft.

MAINE PROPANE ENERGY METERED ACCOUNTS AT THE BELFA
15 STARRET DRIVE
BELFAST, ME 04915

ME AST **A100413108**
N/A

Site 11 of 12 in cluster A

Relative:
Higher

AST:

Actual:
200 ft.

Name: MAINE PROPANE ENERGY METERED ACCOUNTS
Address: 15 STARRET DR
City,State,Zip: BELFAST, ME 04915
Facility ID: FATR2018BV0Z4T025LEP
Facility Status: Not reported
Facility Phone: Not reported
Facility Dept: Metered Accounts at the Belfast Strip Mall
Record Id: Not reported
CAS Number: 74-98-6
Submitted By: Robert E. Cort
Max Container is Holding: 10152
Max Amount Container: 3384
Location: 15 Starret Dr
Mail Address: Not reported
Mail City: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAINE PROPANE ENERGY METERED ACCOUNTS AT THE BELFAST STRIP M (Continued)

A100413108

Mail State: Not reported
Mail Zip: Not reported
Lat/Long: 44.42156 / -69.01922

Chemical Name: Liquified Petroleum Gas
Amount: 10152
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2018

Name: MAINE PROPANE ENERGY METERED ACCOUNTS
Address: 15 STARRET DR
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 10152
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2017

Name: MAINE PROPANE ENERGY METERED ACCOUNTS
Address: 15 STARRET DR
City,State,Zip: BELFAST, ME 04915

Chemical Name: Liquified Petroleum Gas
Amount: 10152
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2016

Name: MAINE PROPANE ENERGY METERED ACCOUNTS
Address: 15 STARRET DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: LIQUEFIED PETROLEUM GAS
Amount: 10152
Amount Unit: pounds
Type Code: Above
Pressure Code: Great
Temperature Code: Ambie
Max Amount Code: 06
Days On Site: 365

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAINE PROPANE ENERGY METERED ACCOUNTS AT THE BELFAST STRIP M (Continued)

A100413108

CIEHS Chemical: No
Report Year: 2015

Name: MAINE PROPANE ENERGY METERED ACCOUNTS AT THE BELFAST STRIP MALL
Address: 15 STARRET DRIVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: LIQUEFIED PETROLEUM GAS
Amount: 10152
Amount Unit: pounds
Type Code: Above
Pressure Code: Great
Temperature Code: Ambie
Max Amount Code: 6
Days On Site: 365
CIEHS Chemical: No
Report Year: 2014

A21
South
< 1/8
0.050 mi.
262 ft.

SHERWIN-WILLIAMS #5198
15A STARRETT DT
BELFAST, ME 04915

RCRA-VSQG 1011489099
RI MANIFEST MER000506642

Site 12 of 12 in cluster A

Relative:
Higher

Actual:
200 ft.

RCRA Listings:
Date Form Received by Agency: 20110309
Handler Name: SHERWIN-WILLIAMS #5198
Handler Address: 15A STARRETT DT
Handler City,State,Zip: BELFAST, ME 04915
EPA ID: MER000506642
Contact Name: SHAY A ROSEMAN
Contact Address: PROSPECT AVE NW 333R
Contact City,State,Zip: CLEVELAND, OH 44115
Contact Telephone: 216-566-1710
Contact Fax: 216-566-1745
Contact Email: SHAY.ROSEMAN@SHERWIN.COM
Contact Title: SAFETY AND ENVIRONMENTAL SPECIALIST
EPA Region: 01
Land Type: Private
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: Not reported
Accessibility: Not reported
Active Site Indicator: Handler Activities
State District Owner: Not reported
State District: Not reported
Mailing Address: PROSPECT AVE NW 333R
Mailing City,State,Zip: CLEVELAND, OH 44115
Owner Name: THE SHERWIN WILLIAMS COMPANY
Owner Type: Private
Operator Name: SHERWIN WILLIAMS COMPANY
Operator Type: Private
Short-Term Generator Activity: No
Importer Activity: No
Mixed Waste Generator: No
Transporter Activity: No
Transfer Facility Activity: No
Recycler Activity with Storage: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHERWIN-WILLIAMS #5198 (Continued)

1011489099

Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20110403
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D035
Waste Description:	METHYL ETHYL KETONE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHERWIN-WILLIAMS #5198 (Continued)

1011489099

Waste Code: F003
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: THE SHERWIN WILLIAMS COMPANY
Legal Status: Private
Date Became Current: 19981016
Date Ended Current: Not reported
Owner/Operator Address: 101 PROSPECT AVE N.W.
Owner/Operator City,State,Zip: CLEVELAND, OH 44115
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SHERWIN WILLIAMS COMPANY
Legal Status: Private
Date Became Current: 19981016
Date Ended Current: Not reported
Owner/Operator Address: 15A STARRETT DT
Owner/Operator City,State,Zip: BELFAST, ME 04915
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SHERWIN WILLIAMS COMPANY
Legal Status: Private
Date Became Current: 20031117
Date Ended Current: Not reported
Owner/Operator Address: 15A STARRETT DT
Owner/Operator City,State,Zip: BELFAST, ME 04915
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: THE SHERWIN WILLIAMS COMPANY
Legal Status: Private
Date Became Current: 20031117
Date Ended Current: Not reported
Owner/Operator Address: 101 PROSPECT AVE N.W.
Owner/Operator City,State,Zip: CLEVELAND, OH 44115
Owner/Operator Telephone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHERWIN-WILLIAMS #5198 (Continued)

1011489099

Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20080508
Handler Name: SHERWIN WILLIAMS STORE #5198
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20110309
Handler Name: SHERWIN-WILLIAMS #5198
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 44412
NAICS Description: PAINT AND WALLPAPER RETAILERS

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

RI MANIFEST:

Name: SHERWIN WILLIAMS #5198
Address: 15A STARRETT DT
City,State,Zip: BELFAST, ME 04915
EPA Id: MER000506642
GEN Cert Date: 10/30/2009
Manifest Document Number: 005928819JJK
Waste Description: SOLVENT BASED PAINT
TSDF Id: RID040098352
TSDF Name: Northland Environmental
Qty: 903
WT/Vol Units: P
TSDF Date: 10/30/2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHERWIN-WILLIAMS #5198 (Continued)

1011489099

Transporter 2 Id:	Not reported
Item Number:	48756
Transporter 2 Name:	Not reported
Transporter Name 2:	21ST CENTURY ENV MGT LLC, OF RI
Transporter EPAID:	RID980906986
Transporter Receipt Date:	10/30/2009
Number Of Containers:	Not reported
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Fee Exempt Code:	Not reported
Comment:	Not reported
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
Quarter:	Not reported
Transporter Contact Name:	Not reported
Transporter Contact Email:	Not reported
Filing Date:	Not reported
Total Fee:	Not reported
Billing Name:	Not reported
Paid Date:	Not reported
Paid Time:	Not reported
Facility Receipt Date:	Not reported
Fee:	Not reported
Manifest Created Date:	Not reported
Manifest Updated Date:	Not reported

RI MANIFEST:

Transporter Receipt Date:	10/30/2009
Number Of Containers:	Not reported
Container Type:	Not reported
Waste Code1:	Not reported
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDF Name:	Northland Environmental
TSDF Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	MER000506642
Manifest Docket Number:	005928819JJJ
Quarter:	Not reported
Waste Description:	LATEX PAINTS
Transporter Contact Name:	Not reported
Quantity:	674
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHERWIN-WILLIAMS #5198 (Continued)

1011489099

Total Fee:	Not reported
Item Number:	48755
Transporter Name:	21ST CENTURY ENV MGT LLC, OF RI
Billing Name:	Not reported
Transporter EPA ID:	RID980906986
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	10/30/2009
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDf Receipt Date:	10/30/2009
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported
Transporter Receipt Date:	10/30/2009
Number Of Containers:	Not reported
Container Type:	Not reported
Waste Code1:	D001
Waste Code2:	Not reported
Waste Code3:	Not reported
Waste Code4:	Not reported
Waste Code5:	Not reported
Waste Code6:	Not reported
Comment:	Not reported
Fee Exempt Code:	Not reported
TSDf Name:	Northland Environmental
TSDf Id:	RID040098352
Transporter Name 2:	Not reported
Company Permit Number:	Not reported
Year:	Not reported
EPA ID:	MER000506642
Manifest Docket Number:	005928819JJk
Quarter:	Not reported
Waste Description:	SOLVENT BASED PAINT
Transporter Contact Name:	Not reported
Quantity:	903
Transporter Contact Email:	Not reported
WT/Vol Units:	P
Filing Date:	Not reported
Total Fee:	Not reported
Item Number:	48756
Transporter Name:	21ST CENTURY ENV MGT LLC, OF RI
Billing Name:	Not reported
Transporter EPA ID:	RID980906986
Date Paid:	Not reported
Time Paid:	Not reported
GEN Cert Date:	10/30/2009
Facility Receipt Date:	Not reported
Fee:	Not reported
Transporter 2 Receipt Date:	Not reported
Manifest Created Date:	Not reported
TSDf Receipt Date:	10/30/2009
Transporter 2 ID:	Not reported
Manifest Updated Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

	Site	Database(s)	
C22 ESE < 1/8 0.050 mi. 262 ft.	RITE AID #04149 254 MAIN STREET BELFAST, ME Site 8 of 9 in cluster C	ME ALLSITES	S127593282 N/A
Relative: Higher	ALLSITES:		
Actual: 198 ft.	Name: RITE AID #04149		
	Address: 254 MAIN STREET		
	City,State,Zip: BELFAST, ME		
	Status: COMPLAINT INVESTIGATED		
	Program Type: RCRA		
	Lat/Long: 44.42349 / -69.018		
	Institutional Control?: FALSE		
	Alias: Not reported		
	Acres: 0		
	Sub Status: UNSUBSTANTIATED		
	Status Date: 06/10/2019		
C23 ESE < 1/8 0.050 mi. 262 ft.	DBA RITE AID #04149 254 MAIN STREET BELFAST, ME 04915 Site 9 of 9 in cluster C	RCRA NonGen / NLR FINDS ECHO	1016142052 MER000509919
Relative: Higher	RCRA Listings:		
Actual: 198 ft.	Date Form Received by Agency: 20190611		
	Handler Name: DBA RITE AID #04149		
	Handler Address: 254 MAIN STREET		
	Handler City,State,Zip: BELFAST, ME 04915		
	EPA ID: MER000509919		
	Contact Name: KIMBERLY DASCOLI		
	Contact Address: WILMOT ROAD		
	Contact City,State,Zip: DEERFIELD, IL 60015		
	Contact Telephone: 847-315-2812		
	Contact Fax: Not reported		
	Contact Email: KIM.DASCOLI@WALGREENS.COM		
	Contact Title: DIRECTOR, RETAIL COMPLIANCE		
	EPA Region: 01		
	Land Type: Private		
	Federal Waste Generator Description: Not a generator, verified		
	Non-Notifier: Not reported		
	Biennial Report Cycle: Not reported		
	Accessibility: Not reported		
	Active Site Indicator: Not reported		
	State District Owner: Not reported		
	State District: Not reported		
	Mailing Address: WILMOT ROAD MS #3301		
	Mailing City,State,Zip: DEERFIELD, IL 60015		
	Owner Name: RARED BELFAST, LLC C/O STEPHEN DUBORD		
	Owner Type: Private		
	Operator Name: WALGREEN EASTERN CO.		
	Operator Type: Private		
	Short-Term Generator Activity: No		
	Importer Activity: No		
	Mixed Waste Generator: No		
	Transporter Activity: No		
	Transfer Facility Activity: No		
	Recycler Activity with Storage: No		
	Small Quantity On-Site Burner Exemption: No		

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DBA RITE AID #04149 (Continued)

1016142052

Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20190611
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DBA RITE AID #04149 (Continued)

1016142052

Waste Code:	D004
Waste Description:	ARSENIC
Waste Code:	D005
Waste Description:	BARIUM
Waste Code:	D007
Waste Description:	CHROMIUM
Waste Code:	D008
Waste Description:	LEAD
Waste Code:	D009
Waste Description:	MERCURY
Waste Code:	D010
Waste Description:	SELENIUM
Waste Code:	D011
Waste Description:	SILVER
Waste Code:	D016
Waste Description:	2,4-D (2,4-DICHLOROPHENOXYACETIC ACID)
Waste Code:	D018
Waste Description:	BENZENE
Waste Code:	D024
Waste Description:	M-CRESOL
Waste Code:	D026
Waste Description:	CRESOL
Waste Code:	D028
Waste Description:	1,2-DICHLOROETHANE
Waste Code:	D035
Waste Description:	METHYL ETHYL KETONE
Waste Code:	P001
Waste Description:	2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%
Waste Code:	P042
Waste Description:	1,2-BENZENEDIOL, 4-[1-HYDROXY-2-(METHYLAMINO)ETHYL]-, (R)- (OR) EPINEPHRINE
Waste Code:	P075
Waste Description:	NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS
Waste Code:	P081
Waste Description:	1,2,3-PROPANETRIOL, TRINITRATE (R) (OR) NITROGLYCERINE (R)
Waste Code:	U002
Waste Description:	2-PROPANONE (I) (OR) ACETONE (I)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DBA RITE AID #04149 (Continued)

1016142052

Waste Code:	U035
Waste Description:	BENZENE BUTANOIC ACID, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) CHLORAMBUCIL
Waste Code:	U044
Waste Description:	CHLOROFORM (OR) METHANE, TRICHLORO-
Waste Code:	U058
Waste Description:	2H-1,3,2-OXAZAPHOSPHORIN-2-AMINE, N,N-BIS(2-CHLOROETHYL)TETRAHYDRO-, 2-OXIDE (OR) CYCLOPHOSPHAMIDE
Waste Code:	U072
Waste Description:	BENZENE, 1,4-DICHLORO- (OR) P-DICHLOROBENZENE
Waste Code:	U122
Waste Description:	FORMALDEHYDE
Waste Code:	U129
Waste Description:	CYCLOHEXANE, 1,2,3,4,5,6-HEXACHLORO-, (1ALPHA, 2ALPHA, 3BETA, 4ALPHA, 5ALPHA, 6BETA)- (OR) LINDANE
Waste Code:	U150
Waste Description:	L-PHENYLALANINE, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) MELPHALAN
Waste Code:	U154
Waste Description:	METHANOL (I) (OR) METHYL ALCOHOL (I)
Waste Code:	U165
Waste Description:	NAPHTHALENE
Waste Code:	U188
Waste Description:	PHENOL
Waste Code:	U200
Waste Description:	RESERPINE (OR) YOHIMBAN-16-CARBOXYLIC ACID, 11,17-DIMETHOXY-18-[(3,4,5-TRIMETHOXYBENZOYL)OXY]-, METHYL ESTER, (3BETA, 16BETA, 17ALPHA, 18BETA, 20ALPHA)-
Waste Code:	U201
Waste Description:	1,3-BENZENEDIOL (OR) RESORCINOL
Waste Code:	U205
Waste Description:	SELENIUM SULFIDE (OR) SELENIUM SULFIDE SES2 (R,T)
Waste Code:	U211
Waste Description:	CARBON TETRACHLORIDE (OR) METHANE, TETRACHLORO-
Waste Code:	U240
Waste Description:	2,4-D, SALTS & ESTERS (OR) ACETIC ACID, (2,4-DICHLOROPHENOXY)-, SALTS & ESTERS (OR) DICHLOROPHENOXYACETIC ACID 2,4-D
Waste Code:	U279
Waste Description:	U279

Handler - Owner Operator:

Owner/Operator Indicator:

Owner

Owner/Operator Name: RARED BELFAST, LLC C/O STEPHEN DUBORD

Legal Status:

Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DBA RITE AID #04149 (Continued)

1016142052

Date Became Current: 19990623
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 643528
Owner/Operator City,State,Zip: VERO BEACH, FL 32964
Owner/Operator Telephone: 772-231-3468
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: RARED BELFAST, LLC
Legal Status: Private
Date Became Current: 19990623
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 643528
Owner/Operator City,State,Zip: VERO BEACH, FL 32964
Owner/Operator Telephone: 772-231-3468
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: RITE AID OF MAINE, INC.,
Legal Status: Private
Date Became Current: 19940913
Date Ended Current: Not reported
Owner/Operator Address: 30 HUNTER LANE
Owner/Operator City,State,Zip: CAMP HILL, PA 17011
Owner/Operator Telephone: 717-761-2633
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: RARED BELFAST, LLC C/O STEPHEN DUBORD
Legal Status: Private
Date Became Current: 19990623
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 643528
Owner/Operator City,State,Zip: VERO BEACH, FL 32964
Owner/Operator Telephone: 772-231-3468
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: RITE AID OF MAINE, INC.
Legal Status: Private
Date Became Current: 19990623
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DBA RITE AID #04149 (Continued)

1016142052

Owner/Operator Indicator: Operator
Owner/Operator Name: WALGREEN EASTERN CO.
Legal Status: Private
Date Became Current: 20180118
Date Ended Current: Not reported
Owner/Operator Address: 300 WILMOT ROAD
Owner/Operator City,State,Zip: DEERFIELD, IL 60015
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: RITE AID CORPORATION
Legal Status: Private
Date Became Current: 19940913
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: WALGREEN EASTERN CO.
Legal Status: Private
Date Became Current: 20180118
Date Ended Current: Not reported
Owner/Operator Address: 300 WILMOT ROAD
Owner/Operator City,State,Zip: DEERFIELD, IL 60015
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20190611
Handler Name: DBA RITE AID #04149
Federal Waste Generator Description: Not a generator, verified
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20130123
Handler Name: RITE AID #4149
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DBA RITE AID #04149 (Continued)

1016142052

Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20150819
Handler Name:	RITE AID #4149
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20171211
Handler Name:	DBA RITE AID #04149
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	No
Electronic Manifest Broker:	No

List of NAICS Codes and Descriptions:

NAICS Code:	446110
NAICS Description:	PHARMACIES AND DRUG STORES

Facility Has Received Notices of Violations:

Violations:	No Violations Found

Evaluation Action Summary:

Evaluations:	No Evaluations Found

FINDS:

Registry ID:	110063898803

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DBA RITE AID #04149 (Continued)

1016142052

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1016142052
Registry ID: 110063898803
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110063898803>
Name: DBA RITE AID #04149
Address: 254 MAIN STREET
City,State,Zip: BELFAST, ME 04915

D24
South
< 1/8
0.072 mi.
380 ft.

MERRILL'S POWER WASH
26 STARRETT DRIVE
BELFAST, ME 4915
Site 1 of 3 in cluster D

US BROWNFIELDS **1016952165**
N/A

Relative:
Higher
Actual:
202 ft.

US BROWNFIELDS:

Name: MERRILL'S POWER WASH
Address: 26 STARRETT DRIVE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast, City of
Grant Type: Assessment
Property Number: Tax Map 12, Lot 40 A
Parcel size: 0.47
Latitude: 44.421507
Longitude: -69.0191377
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of a rectangular parcel of land, encompassing approximately 0.47 acres, located on the eastern side of Starrett Drive, approximately 400 feet south of the intersection of Belmont Avenue and Starrett Drive in the City of Belfast. The Site is identified by the City of Belfast Assessor s Office as Tax Map 12, Lot 40 A, which corresponds to 26 Starrett Drive. Prior to development, the Site appears to have originally been utilized for agricultural purposes. In the late 1980s, Starrett Drive was constructed and the surrounding properties began to be developed for commercial use. In 1989, the Site was developed with the current self-service car wash building. The Site building and surrounding properties are connected to municipal sewer and water services. Based on the Site reconnaissance and information gathered during this investigation, the current Site activities are not anticipated to have adversely impacted the environmental condition of the Site.

Datum: North American Datum of 1983
Acres Property ID: 177501
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: 3542
Assessment Funding Source: EPA
Redevelopment Funding: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MERRILL'S POWER WASH (Continued)

1016952165

Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Petroleum
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	Y
Cooperative Agreement Number:	96151001
Start Date:	9/11/2013
Ownership Entity:	-
Completion Date:	9/30/2013
Current Owner:	Eugene Merrill
Did Owner Change:	Y
Cleanup Required:	N
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	N
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	-
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MERRILL'S POWER WASH (Continued)

1016952165

VOCs cleaned: -
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: 0.47
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: 0.47
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of a rectangular parcel of land, encompassing approximately 0.47 acres, located on the eastern side of Starrett Drive, approximately 400 feet south of the intersection of Belmont Avenue and Starrett Drive in the City of Belfast. The Site is identified by the City of Belfast Assessor s Office as Tax Map 12, Lot 40 A, which corresponds to 26 Starrett Drive. Prior to development, the Site appears to have originally been utilized for agricultural purposes. In the late 1980s, Starrett Drive was constructed and the surrounding properties began to be developed for commercial use. In 1989, the Site was developed with the current self-service car wash building. The Site building and surrounding properties are connected to municipal sewer and water services. Based on the Site reconnaissance and information gathered during this investigation, the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MERRILL'S POWER WASH (Continued)

1016952165

current Site activities are not anticipated to have adversely impacted the environmental condition of the Site.

Below Poverty Number: 57
Below Poverty Percent: 19
Meidan Income: 629
Meidan Income Number: 123
Meidan Income Percent: 41
Vacant Housing Number: 20
Vacant Housing Percent: 11.62
Unemployed Number: 4
Unemployed Percent: 1.33

Name: MERRILL'S POWER WASH
Address: 26 STARRETT DRIVE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast, City of
Grant Type: Assessment
Property Number: Tax Map 12, Lot 40 A
Parcel size: 0.47
Latitude: 44.421507
Longitude: -69.0191377
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of a rectangular parcel of land, encompassing approximately 0.47 acres, located on the eastern side of Starrett Drive, approximately 400 feet south of the intersection of Belmont Avenue and Starrett Drive in the City of Belfast. The Site is identified by the City of Belfast Assessor s Office as Tax Map 12, Lot 40 A, which corresponds to 26 Starrett Drive. Prior to development, the Site appears to have originally been utilized for agricultural purposes. In the late 1980s, Starrett Drive was constructed and the surrounding properties began to be developed for commercial use. In 1989, the Site was developed with the current self-service car wash building. The Site building and surrounding properties are connected to municipal sewer and water services. Based on the Site reconnaissance and information gathered during this investigation, the current Site activities are not anticipated to have adversely impacted the environmental condition of the Site.

Datum: North American Datum of 1983
Acres Property ID: 177501
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: 1485
Assessment Funding Source: EPA
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity: -
Grant Type: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MERRILL'S POWER WASH (Continued)

1016952165

Accomplishment Type:	Supplemental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96151001
Start Date:	9/11/2013
Ownership Entity:	-
Completion Date:	9/30/2013
Current Owner:	Eugene Merrill
Did Owner Change:	Y
Cleanup Required:	N
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	N
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	-
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MERRILL'S POWER WASH (Continued)

1016952165

Past use commercial acreage: 0.47
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: 0.47
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of a rectangular parcel of land, encompassing approximately 0.47 acres, located on the eastern side of Starrett Drive, approximately 400 feet south of the intersection of Belmont Avenue and Starrett Drive in the City of Belfast. The Site is identified by the City of Belfast Assessor s Office as Tax Map 12, Lot 40 A, which corresponds to 26 Starrett Drive. Prior to development, the Site appears to have originally been utilized for agricultural purposes. In the late 1980s, Starrett Drive was constructed and the surrounding properties began to be developed for commercial use. In 1989, the Site was developed with the current self-service car wash building. The Site building and surrounding properties are connected to municipal sewer and water services. Based on the Site reconnaissance and information gathered during this investigation, the current Site activities are not anticipated to have adversely impacted the environmental condition of the Site.

Below Poverty Number: 57
Below Poverty Percent: 19
Meidan Income: 629
Meidan Income Number: 123

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MERRILL'S POWER WASH (Continued)

1016952165

Meidan Income Percent: 41
Vacant Housing Number: 20
Vacant Housing Percent: 11.62
Unemployed Number: 4
Unemployed Percent: 1.33

**E25
SW
< 1/8
0.073 mi.
388 ft.**

**C.N. BROWN
INT. RT 1 AND RT 3
BELFAST, ME**

**ME LAST S104221794
N/A**

Site 1 of 2 in cluster E

**Relative:
Higher**

LAST:

**Actual:
208 ft.**

Event:

Name: C.N. BROWN
Address: INT. RT 1 AND RT 3
City,State,Zip: BELFAST, ME
Spill Number: A-470-1996
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: False
AST inside flag: False
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: 12/07/2001
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 10/21/1996
Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 2
Reporter Type: Subject/Spiller
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: BP
Inc Location: Terminal - Bulk Plant
Inc Source Code: Not reported
Inc Source: Not reported
Spill Cause Code: 09
Spill Cause: Overfill
Material Disposal Info: spilled oil will be recycled
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C.N. BROWN (Continued)

S104221794

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: C.N. BROWN
Address: Not reported
City,State: ,
Country: Not reported
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: GLEN WALL

File:

Spill Id: A-470-1996
Date Created: 04/18/1997
Created By: SPILLS
Date Modified: 03/18/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 18-MAR-09.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 470
Spill Year: 1996
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: 10/21/1996
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 10/21/1996
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: GLEN WALL
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: Not reported

Material Recovered:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C.N. BROWN (Continued)

S104221794

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 100
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Spill Point:
Recovery Method: Vacuum Trucks

Recovery Method: Sorbents

Recovery Method: Other

Product:
Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: 100
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: False

D26
South
< 1/8
0.081 mi.
428 ft.

XPRESS LUBE
30 STARRETT DR
BELFAST, ME 04915

EDR Hist Auto **1020212670**
N/A

Site 2 of 3 in cluster D

Relative:
Higher

EDR Hist Auto

Actual:
203 ft.

Year: Name:
2000 XPRESS LUBE
2001 XPRESS LUBE
2002 XPRESS LUBE
2003 XPRESS LUBE
2004 XPRESS LUBE
2005 XPRESS LUBE
2006 XPRESS LUBE
2007 XPRESS LUBE
2008 XPRESS LUBE
2009 XPRESS LUBE
2010 XPRESS LUBE
2011 XPRESS LUBE
2012 XPRESS LUBE
2013 XPRESS LUBE
2014 XPRESS LUBE

Type:
Automotive Repair Shops, NEC
Automotive Repair Shops, NEC
Automotive Repair Shops, NEC
Automotive Repair Shops, NEC
Automotive Repair Shops, NEC
Gasoline Service Stations, NEC
Gasoline Service Stations, NEC
Gasoline Service Stations, NEC
Gasoline Service Stations, NEC
Gasoline Service Stations, NEC
Gasoline Service Stations, NEC
Gasoline Service Stations, NEC
Gasoline Service Stations, NEC
Gasoline Service Stations, NEC
Gasoline Service Stations, NEC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

D27
South
< 1/8
0.093 mi.
491 ft.

TEXACO, XPRESS LUBE
35 STARRET DR.
BELFAST, ME
Site 3 of 3 in cluster D

ME LAST

S105795212
N/A

Relative:
Higher

LAST:

Actual:
205 ft.

Event:

Name: TEXACO, XPRESS LUBE
Address: 35 STARRET DR.
City,State,Zip: BELFAST, ME
Spill Number: A-585-2001
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: False
AST inside flag: False
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 04/01/2002
Modify By: 04/01/2002
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 09/05/2001
Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: I
Spill Type: Non-Oil, Non-Hazardous Incident
Reporter Type Code: 5
Reporter Type: Anonymous
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: CM
Inc Location: Business - Commercial
Inc Source Code: NO
Inc Source: No Source
Spill Cause Code: 00
Spill Cause: Other - No Cause
Material Disposal Info: Not reported
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Not reported
Date Change: 04/01/2002
Changed By: eipcolli

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TEXACO, XPRESS LUBE (Continued)

S105795212

Potential RP: False
Name: Not reported
Title: Not reported
Company: TEXACO, XPRESS LUBE
Address: 35 STARRET DR.
City,State: BELFAST,ME
Country: Not reported
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: THOMAS SMITH

File:
Spill Id: A-585-2001
Date Created: 05/07/2002
Created By: EIMMASON
Date Modified: 06/05/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 05-JUN-09.
Reconcile Date: 05/07/2002
File Reconciled By: Not reported

Media Affected:
Medium: Land

Medium: Groundwater

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 585
Spill Year: 2001
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Non-Oil, Non-Hazardous Incident
Log Spill Datetime: 09/05/2001
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 09/05/2001
Log Rep Prod Cd: 81
Log Rep Prod: WASTE OIL/USED MOTOR OIL
Log Emp Name: THOMAS SMITH
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: NO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TEXACO, XPRESS LUBE (Continued)

S105795212

Material Recovered: None
Material Amount: 0
Material Units: gals.
Material Amt Qualifier: ACTUAL

Spill Point:
Recovery Method: None

Product:
Product Code: NONE
Product Other: Not reported
Product Amt: 0
Product Amt Unit: gals.
Product Amt Qualifier: ACTUAL
Primary Product: True

**F28
ESE
< 1/8
0.103 mi.
544 ft.**

**BENNNERS AUTO SVC
BELMONT AVE
BELFAST, ME**

**ME UST U003098846
N/A**

Site 1 of 7 in cluster F

**Relative:
Higher**

**Actual:
202 ft.**

UST:
Name: BENNNERS AUTO SVC
Address: BELMONT AVE
City: BELFAST
Facility ID: 10490
Facility Location2: BELFAST
Facility Code: COMMERCIAL
Fed Reg Ind: No
Owner Name: BENNER, WILLIAM
Owner Contact: Not reported
Owner Delivery Address: BOX 517
Owner City/State/Zip: BELFAST, ME 04915
Owner Telephone: 2073381445
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: BENNER, WILLIAM
Owner/Operator Address: BOX 517
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073381445

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-DEC-86
Tank Sub Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENNERS AUTO SVC (Continued)

U003098846

Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: UNKNOWN SUBSTANCE
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 12-DEC-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-DEC-86
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 2
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-DEC-86
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: UNKNOWN SUBSTANCE
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 12-DEC-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-DEC-86
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 3
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-DEC-86
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: UNKNOWN SUBSTANCE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENNERS AUTO SVC (Continued)

U003098846

Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 12-DEC-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-DEC-86
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

**F29
ESE
< 1/8
0.103 mi.
544 ft.**

**POULTRY BARN
BELMONT AVE
BELFAST, ME**

**ME UST U000240668
N/A**

Site 2 of 7 in cluster F

**Relative:
Higher**

UST:

**Actual:
202 ft.**

Name: POULTRY BARN
Address: BELMONT AVE
City: BELFAST
Facility ID: 16043
Facility Location2: BELFAST
Facility Code: FARM
Fed Reg Ind: No
Owner Name: STRUCTURAL SOLUTIONS INC
Owner Contact: Not reported
Owner Delivery Address: RR 3 BOX 637
Owner City/State/Zip: BELFAST, ME 04915
Owner Telephone: 2073382408
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: Yes
Near Private Water Label: NEAR PRIVATE WATER
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: STRUCTURAL SOLUTIONS INC
Owner/Operator Address: RR 3 BOX 637
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073382408

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 19-AUG-89
Tank Sub Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

POULTRY BARNs (Continued)

U000240668

Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 22-AUG-89
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 19-AUG-89
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 2
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 19-AUG-89
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 22-AUG-89
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 19-AUG-89
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F30
ESE
< 1/8
0.103 mi.
544 ft.

GRASS, MERLE A
BELMONT AVE
BELFAST, ME
Site 3 of 7 in cluster F

ME UST U002163127
N/A

Relative:
Higher

UST:

Actual:
202 ft.

Name: GRASS, MERLE A
Address: BELMONT AVE
City: BELFAST
Facility ID: 6252
Facility Location2: BELFAST
Facility Code: FARM
Fed Reg Ind: No
Owner Name: GRASS, MERLE A
Owner Contact: Not reported
Owner Delivery Address: STAR RT 80 BOX 24
Owner City/State/Zip: BELFAST, ME 04915
Owner Telephone: 2073382155
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: Yes
Near Private Water Label: NEAR PRIVATE WATER
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: GRASS, MERLE A
Owner/Operator Address: STAR RT 80 BOX 24
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073382155

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-JUN-90
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 2000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 18-SEP-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-JUN-90
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRASS, MERLE A (Continued)

U002163127

Overfill Protection Label: UNKNOWN

Tank Number: 2
Tank Status: **REMOVED**
Tank Status Label: REMOVED
Tank Status Date: 01-JUN-90
Tank Sub Status: **Not reported**
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 2000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 18-SEP-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: **REMOVED**
Pipe Status Date: 01-JUN-90
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

F31
ESE
< 1/8
0.103 mi.
544 ft.

KALLIS FORD
BELMONT AVE
BELFAST, ME

Site 4 of 7 in cluster F

ME UST **U002162105**
N/A

Relative:
Higher

Actual:
202 ft.

UST:
Name: KALLIS FORD
Address: BELMONT AVE
City: BELFAST
Facility ID: 623
Facility Location2: BELFAST
Facility Code: COMMERCIAL
Fed Reg Ind: No
Owner Name: KALLIS, H SCOTT
Owner Contact: Not reported
Owner Delivery Address: RR 3 BOX 703
Owner City/State/Zip: BELFAST, ME 04915
Owner Telephone: 2073381300
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KALLIS FORD (Continued)

U002162105

Longitude: Not reported
Owner/Operator Name: KALLIS FORD
Owner/Operator Address: BELMONT AVE
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073381300

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-SEP-89
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-DEC-67
Product Type: WASTE OIL/USED MOTOR OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 05-JUN-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-SEP-89
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 2
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-AUG-91
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-DEC-67
Product Type: WASTE OIL/USED MOTOR OIL
Tank Volume in Gallons: 500
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 05-JUN-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-AUG-91
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KALLIS FORD (Continued)

U002162105

Overfill Protection Label: UNKNOWN

Tank Number: 3
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-SEP-89
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-DEC-67
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 05-JUN-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-SEP-89
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 4
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-AUG-91
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-SEP-80
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 05-JUN-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-AUG-91
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F32
ESE
< 1/8
0.103 mi.
544 ft.

SEACOAST GROCERY
BELMONT AVE
BELFAST, ME
Site 5 of 7 in cluster F

ME UST U002161111
N/A

Relative:
Higher

UST:

Actual:
202 ft.

Name: SEACOAST GROCERY
Address: BELMONT AVE
City: BELFAST
Facility ID: 6151
Facility Location2: BELFAST
Facility Code: RETAIL OIL
Fed Reg Ind: Yes
Owner Name: WEBBER ENERGY GASOLINE
Owner Contact: GASOLINE ACCOUNTING DEPT
Owner Delivery Address: PO BOX 929
Owner City/State/Zip: BANGOR, ME 04402 0929
Owner Telephone: 2079924020
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: SAWYER, TERRY
Owner/Operator Address: BOX 698
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073382524

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 12-JUN-95
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-JUL-71
Product Type: DIESEL
Tank Volume in Gallons: 6000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 17-SEP-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 12-JUN-95
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEACOAST GROCERY (Continued)

U002161111

Overfill Protection Label: UNKNOWN

Tank Number: 2
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 12-JUN-95
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-JUL-71
Product Type: PREMIUM UNLEADED
Tank Volume in Gallons: 6000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 17-SEP-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 12-JUN-95
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 3
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 12-JUN-95
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-JUL-71
Product Type: UNLEADED GASOLINE
Tank Volume in Gallons: 6000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 17-SEP-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 12-JUN-95
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEACOAST GROCERY (Continued)

U002161111

Tank Number: 4
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-AUG-94
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-JUL-71
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 17-SEP-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-AUG-94
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 5
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-AUG-94
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-JUL-71
Product Type: WASTE OIL/USED MOTOR OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 17-SEP-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-AUG-94
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F33
ESE
< 1/8
0.103 mi.
544 ft.

MOLLISONS INC
BELMONT AVE
BELFAST, ME

Site 6 of 7 in cluster F

ME UST **U003097040**
N/A

Relative:
Higher

UST:

Actual:
202 ft.

Name:	MOLLISONS INC
Address:	BELMONT AVE
City:	BELFAST
Facility ID:	1914
Facility Location2:	BELFAST
Facility Code:	COMMERCIAL
Fed Reg Ind:	Yes
Owner Name:	MOLLISONS INC
Owner Contact:	Not reported
Owner Delivery Address:	PO BOX 408
Owner City/State/Zip:	BELFAST, ME 04915
Owner Telephone:	2073384080
Operator Contact:	Not reported
On Aquifer:	No
On Aquifer Label:	Not reported
Near Public Water:	No
Near Public Water Label:	Not reported
Near Private Water:	Yes
Near Private Water Label:	NEAR PRIVATE WATER
Near Other Water:	No
Nearby Water Other Owner Label:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Owner/Operator Name:	MOLLISONS INC
Owner/Operator Address:	PO BOX 408
Owner/Operator City,St,Zip:	BELFAST, ME 04915
Owner/Operator Phone:	2073384080
Tank Number:	1
Tank Status:	REMOVED
Tank Status Label:	REMOVED
Tank Status Date:	01-OCT-89
Tank Sub Status:	Not reported
Tank Sub Status Label:	Not reported
Installation Date:	01-OCT-69
Product Type:	DIESEL
Tank Volume in Gallons:	3000
Tank Above/Below:	BELOWGROUND
Tank Material:	STEEL - BARE OR ASPHALT COATED.
Reg Date:	02-JUL-86
Tank Leak Detection Label:	UNKNOWN
Chamber ID:	1
Chamber Pump Type Label:	UNKNOWN
Chamber Pump Type Desc:	UNKNOWN
Pipe Status:	REMOVED
Pipe Status Date:	01-OCT-89
Pipe Date Installed:	Not reported
Pipe Material Label:	BLACK IRON - CAST IRON - IRON CONDUIT
Pipe Status Label:	REMOVED
Pipe Leak Detection:	UNKNOWN
Pipe Leak Detection Label:	UNKNOWN
Overfill:	UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLISONS INC (Continued)

U003097040

Overfill Protection Label: UNKNOWN

Tank Number: 2
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-NOV-86
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: DIESEL
Tank Volume in Gallons: 3000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 02-JUL-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-NOV-86
Pipe Date Installed: Not reported
Pipe Material Label: BLACK IRON - CAST IRON - IRON CONDUIT
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 3
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-JUN-86
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: LEADED GASOLINE
Tank Volume in Gallons: 2000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 02-JUL-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-JUN-86
Pipe Date Installed: Not reported
Pipe Material Label: OTHER
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLISONS INC (Continued)

U003097040

Tank Number: 4
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-JUN-86
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: REGULAR GASOLINE
Tank Volume in Gallons: 4000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 02-JUL-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-JUN-86
Pipe Date Installed: Not reported
Pipe Material Label: OTHER
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 5
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-JUN-86
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: REGULAR GASOLINE
Tank Volume in Gallons: 3000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 02-JUL-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-JUN-86
Pipe Date Installed: Not reported
Pipe Material Label: OTHER
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F34
ESE
< 1/8
0.103 mi.
544 ft.

MAWHINNEY, DORIS
BELMONT AVE
BELFAST, ME
Site 7 of 7 in cluster F

ME UST U003560548
N/A

Relative:
Higher

UST:

Actual:
202 ft.

Name: MAWHINNEY, DORIS
Address: BELMONT AVE
City: BELFAST
Facility ID: 11020
Facility Location2: BELFAST
Facility Code: SINGLE RESIDENCE
Fed Reg Ind: No
Owner Name: MAWHINNEY, DORIS
Owner Contact: Not reported
Owner Delivery Address: PO BOX 988
Owner City/State/Zip: BELFAST, ME 04915
Owner Telephone: 2073382381
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: Yes
Near Private Water Label: NEAR PRIVATE WATER
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: MAWHINNEY, DORIS
Owner/Operator Address: PO BOX 988
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073382381

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-OCT-90
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-JUL-76
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 275
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 08-JAN-87
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-OCT-90
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAWHINNEY, DORIS (Continued)

U003560548

Overfill Protection Label: UNKNOWN

E35
WSW
< 1/8
0.116 mi.
612 ft.

R.H. RENY, INC.
1 BELMONT AVE
BELFAST, ME

Site 2 of 2 in cluster E

ME AST **S108651967**
ME TIER 2 **N/A**

Relative:
Higher
Actual:
217 ft.

AST:

Name: R.H. RENY, INC.
Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME 04915
Facility ID: FATR2021AJ2TA800HAK1
Facility Status: Not reported
Facility Phone: Not reported
Facility Dept: Belfast
Record Id: Not reported
CAS Number: Not reported
Submitted By: Not reported
Max Container is Holding: 3384
Max Amount Container: 31160
Location: 4 1,000-gal. tanks in tandem behind Renys store
Mail Address: 731 Route 1
Mail City: Newcastle
Mail State: ME
Mail Zip: 04553
Lat/Long: 44.4251 / -69.0232

Chemical Name: PROPANE
Amount: 13536
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2021

Name: R.H. RENY, INC.
Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 6768
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2020

Name: R.H. RENY, INC.
Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME 04915

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Chemical Name: PROPANE
Amount: 2044
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: No
Report Year: 2019

Name: R.H. RENY, INC.
Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 2044
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: No
Report Year: 2018

Name: R.H. RENY, INC.
Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 1022
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: No
Report Year: 2017

Name: R.H. RENY, INC.
Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 6768
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Greater than ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: No
Report Year: 2016

Name: R.H. RENY, INC.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 6768
Amount Unit: pounds
Type Code: Above
Pressure Code: Great
Temperature Code: Ambie
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: No
Report Year: 2015

Name: R.H. RENY, INC.
Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 6768
Amount Unit: pounds
Type Code: Above
Pressure Code: Great
Temperature Code: Ambie
Max Amount Code: 7
Days On Site: 365
CIEHS Chemical: No
Report Year: 2014

Name: R.H. RENY, INC.
Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME 04915

Chemical Name: Propane
Amount: 10000
Amount Unit: pounds
Type Code: Above
Pressure Code: Ambie
Temperature Code: Ambie
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2013

Name: R.H. RENY, INC.
Address: 1 BELMONT AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 6600
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Report Year: 2012

[Click this hyperlink](#) while viewing on your computer to access
20 additional ME_AST: record(s) in the EDR Site Report.

TIER 2:

Name:	R.H. RENY, INC.
Address:	1 BELMONT AVENUE
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	731 Route 1
Facility Mailing City:	Newcastle
Facility Mailing State:	ME
Facility Mailing Zip:	04553
Facility Mailing Country:	USA
Report Year:	2017
Submitted By:	Tammy L. Lincoln
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/28/2018
Date TierII Received:	Not reported
Facility Dept:	Belfast
Facility ID:	FATR2017AJ2TA800HAK1
Failed Validation:	Not reported
Facility Date Modified:	09/13/2018
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Latitude: 44.42583
Longitude: -69.00694

Name: R.H. RENY, INC.
Address: 1 BELMONT AVENUE
City,State,Zip: BELFAST, ME
Facility Mailing Address: 731 Route 1
Facility Mailing City: Newcastle
Facility Mailing State: ME
Facility Mailing Zip: 04553
Facility Mailing Country: USA
Report Year: 2014
Submitted By: Mary Kate Reny
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported
Facility Router Record ID: Not reported
Chemical Inventory Record ID: Not reported
Chemical Same As Last Year: T
Chronic: Not reported
CICAS: Not reported
CI EHS Chemical: Not reported
CI Last Modified: Not reported
MSDS Number For Chemical: Not reported
CI Notes: Not reported
Days On Site: Not reported
Entered Chemical Name: Not reported
Fire: Not reported
Gas: Not reported
Liquid: Not reported
Maximum Amount: Not reported
Maximum Amount Code: Not reported
Maximum Amount Container: Not reported
Mixture: Not reported
Pressure: Not reported
Pure: Not reported
Reactive: Not reported
Solid: Not reported
Date Signed: 3/1/2015
Date TierII Received: Not reported
Facility Dept: Belfast
Facility ID: FATR2014AJ2TA800HAK1
Failed Validation: Not reported
Facility Date Modified: 11/10/2015
Facility Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Mail Country: Not reported
Lat/Long Location Descr: Not reported
Lat/Long Method: Not reported
Notes: Not reported

Validation Report: Not reported
Latitude: 44.42583
Longitude: -69.00694

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Name: R.H. RENY, INC.
Address: 1 BELMONT AVE
City,State,Zip: BELFAST, ME
Facility Mailing Address: 1 Belmont Ave.
Facility Mailing City: Belfast
Facility Mailing State: ME
Facility Mailing Zip: 04915
Facility Mailing Country: USA
Report Year: 2011
Submitted By: Mary Kate Reny
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported
Facility Router Record ID: Not reported
Chemical Inventory Record ID: Not reported
Chemical Same As Last Year: T
Chronic: Not reported
CICAS: Not reported
CI EHS Chemical: Not reported
CI Last Modified: Not reported
MSDS Number For Chemical: Not reported
CI Notes: Not reported
Days On Site: Not reported
Entered Chemical Name: Not reported
Fire: Not reported
Gas: Not reported
Liquid: Not reported
Maximum Amount: Not reported
Maximum Amount Code: Not reported
Maximum Amount Container: Not reported
Mixture: Not reported
Pressure: Not reported
Pure: Not reported
Reactive: Not reported
Solid: Not reported
Date Signed: 2/29/2012
Date TierII Received: Not reported
Facility Dept: Not reported
Facility ID: FATR20118F7L7W0027GA
Failed Validation: Not reported
Facility Date Modified: 11/02/2012
Facility Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Mail Country: Not reported
Lat/Long Location Descr: Not reported
Lat/Long Method: Z1 - Zip Code
Notes: Not reported

Validation Report: You have checked the box indicating that site plans have been submitted. Since no site plan files have been added in Tier2 Submit, please ensure that you submit appropriate site plans (paper or electronic). This facility passed all validation checks.

Latitude: 44.42582
Longitude: -69.00694

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Name:	R.H. RENY, INC.
Address:	1 BELMONT AVENUE
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	731 Route 1
Facility Mailing City:	Newcastle
Facility Mailing State:	ME
Facility Mailing Zip:	04553
Facility Mailing Country:	USA
Report Year:	2016
Submitted By:	Tammy L. Lincoln
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/16/2017
Date TierII Received:	Not reported
Facility Dept:	Belfast
Facility ID:	FATR2016AJ2TA800HAK1
Failed Validation:	Not reported
Facility Date Modified:	08/28/2017
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42583
Longitude:	-69.00694
Name:	R.H. RENY, INC.
Address:	1 BELMONT AVE.
City,State,Zip:	BELFAST, ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Facility Mailing Address:	731 Route 1
Facility Mailing City:	Newcastle
Facility Mailing State:	ME
Facility Mailing Zip:	04553
Facility Mailing Country:	USA
Report Year:	2006
Submitted By:	Mary Kate Reny
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/16/2007
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2006504HQZ00LMJG
Failed Validation:	Not reported
Facility Date Modified:	4/18/2007
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	R.H. RENY, INC.
Address:	1 BELMONT AVE.
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	731 Route 1
Facility Mailing City:	Newcastle
Facility Mailing State:	ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Facility Mailing Zip:	04553
Facility Mailing Country:	USA
Report Year:	2008
Submitted By:	Mary Kate Reny, Operations/Compliance
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/3/2009
Date TierII Received:	Not reported
Facility Dept:	Operations
Facility ID:	FATR20086C888X00M8E6
Failed Validation:	Not reported
Facility Date Modified:	3/5/2009
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported

Validation Report:	This facility passed all validation checks.
Latitude:	Not reported
Longitude:	Not reported

Name:	R.H. RENY, INC.
Address:	1 BELMONT AVENUE
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	731 Route 1
Facility Mailing City:	Newcastle
Facility Mailing State:	ME
Facility Mailing Zip:	04553
Facility Mailing Country:	USA
Report Year:	2015

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Submitted By:	Mary Kate Reny
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/29/2016
Date TierII Received:	Not reported
Facility Dept:	Belfast
Facility ID:	FATR2015AJ2TA800HAK1
Failed Validation:	Not reported
Facility Date Modified:	08/19/2016
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42583
Longitude:	-69.00694
Name:	R. H. RENY, INC.
Address:	1 BELMONT AVENUE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2010
Submitted By:	Mary Kate Reny, Operations and Compliance
Acute/Chronic:	Not reported
Average Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/28/2011
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20107215PZ015L5B
Failed Validation:	Not reported
Facility Date Modified:	09/12/2011
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	R.H. RENY, INC.
Address:	1 BELMONT AVENUE
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	731 Route 1
Facility Mailing City:	Newcastle
Facility Mailing State:	ME
Facility Mailing Zip:	04553
Facility Mailing Country:	USA
Report Year:	2020
Submitted By:	Not reported
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

Chemical Same As Last Year:	true
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2021-02-19
Date TierII Received:	Not reported
Facility Dept:	Belfast
Facility ID:	FATR2020AJ2TA800HAK1
Failed Validation:	Not reported
Facility Date Modified:	02/19/2021
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	false
Latitude:	44.4251
Longitude:	-69.02320
Name:	R.H. RENY, INC.
Address:	1 BELMONT AVENUE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2013
Submitted By:	Mary Kate Reny
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/27/2014
Date TierII Received:	Not reported
Facility Dept:	Belfast
Facility ID:	FATR20139UC3SK01FX73
Failed Validation:	Not reported
Facility Date Modified:	08/26/2014
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42582
Longitude:	-69.00694
Name:	R.H. RENY, INC.
Address:	1 BELMONT AVE.
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2007
Submitted By:	Not reported
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R.H. RENY, INC. (Continued)

S108651967

CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2007504HQZ00LMJG
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	731 Route 1
Mail City:	Newcastle
Mail State:	ME
Mail Zip:	4553
Mail Country:	USA
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported

G36
WSW
1/8-1/4
0.129 mi.
680 ft.

DUTCH CHEVROLET
6 BELMONT AVE
BELFAST, ME 04915
Site 1 of 3 in cluster G

ME MANIFEST **S121891722**
N/A

Relative:
Higher

MANIFEST:

Actual:
218 ft.

Year:	2015
EPAID:	MED018989285
Contact Name:	GREGORY DUTCH
Contact Phone:	2073381470
Mailing Address:	6 BELMONT AVE
Mailing City:	BELFAST
Mailing State:	ME
Mailing Zip:	04915
Manifest Number:	005338821FLE
Manifest Handler Date:	02/27/2015
Transporter Sequence Number:	1
Transporter EPA ID:	MAD039322250
Transporter Name:	CLEAN HARBORS ENV SERVICES, INC
Transporter Date:	02/27/2015
TSD Date:	03/16/2015
TSD EPAID:	KYD053348108
TSD Name:	SAFETY KLEEN SYSTEMS INC.
Manifest Item Key:	1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET (Continued)

S121891722

Manifest Item Quantity: 350
Manifest Item Quantity Unit: P
Manifest Item Container Number: 1
Manifest Item Container Type: DM
Manifest Item Handling Final: H061
Waste IDS: D001, D018
Manifest Item DOT Description: UN1203, WASTE GASOLINE, 3, PGII

Year: 2017
EPAID: MED018989285
Contact Name: GREGORY DUTCH
Contact Phone: 2073381470
Mailing Address: 6 BELMONT AVE
Mailing City: BELFAST
Mailing State: ME
Mailing Zip: 04915
Manifest Number: 009970281FLE
Manifest Handler Date: 03/10/2017
Transporter Sequence Number: 1
Transporter EPA ID: MAD039322250
Transporter Name: CLEAN HARBORS ENV SERVICES, INC
Transporter Date: 03/10/2017
TSD Date: 03/27/2017
TSD EPAID: KYD053348108
TSD Name: SAFETY KLEEN SYSTEMS INC.
Manifest Item Key: 1
Manifest Item Quantity: 400
Manifest Item Quantity Unit: P
Manifest Item Container Number: 1
Manifest Item Container Type: DM
Manifest Item Handling Final: H061
Waste IDS: F003, D001
Manifest Item DOT Description: UN3175, WASTE SOLIDS, CONTAINING FLAMMABLE LIQUIDS, NOS, 4.1, PGII (XYLENE, PETROLEUM DISTILLATES)

G37
WSW
1/8-1/4
0.129 mi.
680 ft.

DUTCH CHEVROLET BUICK INC.
6 BELMONT AVE
BELFAST, ME

ME AST **S108053161**
ME ALLSITES **N/A**
ME TIER 2

Site 2 of 3 in cluster G

Relative:
Higher

AST:

Actual:
218 ft.

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME 04915
Facility ID: FATR2021D83001002JD8
Facility Status: Not reported
Facility Phone: Not reported
Facility Dept: Service
Record Id: Not reported
CAS Number: Not reported
Submitted By: Not reported
Max Container is Holding: 17150
Max Amount Container: 24150
Location: Mechanical shop
Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Mail Zip: Not reported
Lat/Long: 44.42271 / -69.02279

Chemical Name: MOTOR OIL
Amount: 17150
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2021

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: MOTOR OIL
Amount: 7000
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2020

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: MOTOR OIL
Amount: 17150
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2019

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: MOTOR OIL
Amount: 17150
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Report Year: 2018

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE.
City,State,Zip: BELFAST, ME 04915

Chemical Name: Motor oil
Amount: 17150
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2017

Name: DUTCH CHEVROLET BUICK INC
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: MOTOR OIL
Amount: 7000
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2016

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME 04974

Chemical Name: motor oils
Amount: 7000
Amount Unit: pounds
Type Code: Above
Pressure Code: Ambie
Temperature Code: Ambie
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: No
Report Year: 2015

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: motor oils
Amount: 10000
Amount Unit: pounds
Type Code: Above
Pressure Code: Ambie
Temperature Code: Ambie

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Max Amount Code: 6
Days On Site: 365
CIEHS Chemical: No
Report Year: 2014

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: motor oils
Amount: 7000
Amount Unit: pounds
Type Code: Above
Pressure Code: Ambie
Temperature Code: Ambie
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2013

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: OILS, MISCELLANEOUS: MOTOR
Amount: 7000
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2012

[Click this hyperlink](#) while viewing on your computer to access
3 additional ME_AST: record(s) in the EDR Site Report.

ALLSITES:

Name: DUTCH CHEVROLET BUICK
Address: 6 BELMONT AVENUE
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: RCRA
Lat/Long: 44.42307 / -69.02276
Institutional Control?: FALSE
Alias: Not reported
Acres: 0
Sub Status: NO (OR DE-MINIMIS) CONTAMINATION LEFT ON SITE
Status Date: 06/06/2017

TIER 2:

Name: DUTCH CHEVROLET BUICK INC.
Address: 6 BELMONT AVE
City,State,Zip: BELFAST, ME
Facility Mailing Address: 6 Belmont Ave.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2013
Submitted By:	Gregory Dutch
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3-4-2014
Date TierII Received:	Not reported
Facility Dept:	Service
Facility ID:	FATR201394TS9A002WPY
Failed Validation:	Not reported
Facility Date Modified:	08/26/2014
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42271
Longitude:	69.022795
Name:	DUTCH CHEVROLET BUICK INC.
Address:	6 BELMONT AVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	6 Belmont Ave.
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Facility Mailing Country:	USA
Report Year:	2012
Submitted By:	Gregory Dutch
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	02-28-2013
Date TierII Received:	Not reported
Facility Dept:	Service
Facility ID:	FATR201294TS9A002WPY
Failed Validation:	Not reported
Facility Date Modified:	08/14/2013
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	FC - Facility Centroid
Lat/Long Method:	G0 - GPS (Other)
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42271
Longitude:	69.022795
Name:	DUTCH CHEVROLET BUICK INC
Address:	6 BELMONT AVE
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2016
Submitted By:	Raymond C Rogers

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/10/2017
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2016BUPQWD002P0J
Failed Validation:	Not reported
Facility Date Modified:	08/28/2017
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42271
Longitude:	-69.02279
Name:	DUTCH CHEVROLET BUICK INC.
Address:	6 BELMONT AVE
City,State,Zip:	BELFAST, ME 04974
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2015
Submitted By:	Gregory Dutch
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/17/2016
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2015B6X7A3002QHY
Failed Validation:	Not reported
Facility Date Modified:	08/19/2016
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42271
Longitude:	-69.02279
Name:	DUTCH CHEVROLET BUICK INC.
Address:	6 BELMONT AVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	6 Belmont Ave.
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2011
Submitted By:	Gregory A Dutch
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	02-29-2012
Date TierII Received:	Not reported
Facility Dept:	Service
Facility ID:	FATR20118F7JV5002A5K
Failed Validation:	Not reported
Facility Date Modified:	11/02/2012
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	FC - Facility Centroid
Lat/Long Method:	G0 - GPS (Other)
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42271
Longitude:	69.022795
Name:	DUTCH CHEVROLET BUICK INC.
Address:	6 BELMONT AVE
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2018
Submitted By:	Raymond Rogers
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/12/2019
Date TierII Received:	Not reported
Facility Dept:	Service
Facility ID:	FATR2018D83001002JD8
Failed Validation:	Not reported
Facility Date Modified:	07/30/2019
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42271
Longitude:	-69.02279
Name:	DUTCH CHEVROLET BUICK INC.
Address:	6 BELMONT AVE
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2020
Submitted By:	Not reported
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	true
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2021-02-25
Date TierII Received:	Not reported
Facility Dept:	Service
Facility ID:	FATR2020D83001002JD8
Failed Validation:	Not reported
Facility Date Modified:	07/20/2021
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	false
Latitude:	44.42271
Longitude:	-69.02279
Name:	DUTCH CHEVROLET BUICK PONTIAC INC.
Address:	6 BELMONT AVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2008
Submitted By:	Gregory A. Dutch
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	4/30/2009
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20086GA33J0027FX
Failed Validation:	Not reported
Facility Date Modified:	5/4/2009
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	FC - Facility Centroid
Lat/Long Method:	G0 - GPS (Other)
Notes:	Not reported
Validation Report:	This facility passed all validation checks.
Latitude:	44.42271
Longitude:	60.022795
Name:	DUTCH CHEVROLET BUICK INC.
Address:	6 BELMONT AVE.
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2010
Submitted By:	Gregory A Dutch
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/24/2011
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20107RCFQN002MTC
Failed Validation:	Not reported
Facility Date Modified:	09/12/2011
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	FC - Facility Centroid
Lat/Long Method:	G0 - GPS (Other)
Notes:	Not reported

Validation Report: Note: entered latitude/longitude does not fall within bounding box of Waldo County. This facility passed all validation checks.

Latitude: 44.42271
Longitude: 60.022795

Name:	DUTCH CHEVROLET BUICK INC.
Address:	6 BELMONT AVE.
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2017
Submitted By:	Raymond Rogers
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/27/2018
Date TierII Received:	Not reported
Facility Dept:	Service
Facility ID:	FATR2017CLTM5G002QRL
Failed Validation:	Not reported
Facility Date Modified:	09/13/2018
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.42271
Longitude:	-69.02279
Name:	DUTCH CHEVROLET BUICK INC.
Address:	6 BELMONT AVE
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2019
Submitted By:	Raymond Rogers
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEVROLET BUICK INC. (Continued)

S108053161

Reactive: Not reported
Solid: Not reported
Date Signed: 2/26/2020
Date TierII Received: Not reported
Facility Dept: Service
Facility ID: FATR2019D83001002JD8
Failed Validation: Not reported
Facility Date Modified: 05/21/2020
Facility Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Mail Country: Not reported
Lat/Long Location Descr: Not reported
Lat/Long Method: Not reported
Notes: Not reported

Validation Report: Not reported
Latitude: 44.42271
Longitude: -69.02279

G38
SW
1/8-1/4
0.145 mi.
768 ft.

DUTCH CHEV OLDS BUICK INC
JCT RTS 1 & 3
BELFAST, ME
Site 3 of 3 in cluster G

ME UST **U003096959**
N/A

Relative:
Higher
Actual:
216 ft.

UST:
Name: DUTCH CHEV OLDS BUICK INC
Address: JCT RTS 1 & 3
City: BELFAST
Facility ID: 1513
Facility Location2: BELFAST
Facility Code: COMMERCIAL
Fed Reg Ind: No
Owner Name: DUTCH CHEV OLDS BUICK INC
Owner Contact: Not reported
Owner Delivery Address: JCT RTS 1 & 3
Owner City/State/Zip: BELFAST, ME 04915
Owner Telephone: 2073381470
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: Yes
Near Private Water Label: NEAR PRIVATE WATER
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: DUTCH CHEV OLDS BUICK INC
Owner/Operator Address: JCT RTS 1 & 3
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073381470

Tank Number: 1
Tank Status: REMOVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEV OLDS BUICK INC (Continued)

U003096959

Tank Status Label: REMOVED
Tank Status Date: 01-JUN-90
Tank Sub Status: **Not reported**
Tank Sub Status Label: Not reported
Installation Date: 01-JAN-80
Product Type: WASTE OIL/USED MOTOR OIL
Tank Volume in Gallons: 500
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 24-JUN-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: **REMOVED**
Pipe Status Date: 01-JUN-90
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 2
Tank Status: **REMOVED**
Tank Status Label: REMOVED
Tank Status Date: 01-JUN-90
Tank Sub Status: **Not reported**
Tank Sub Status Label: Not reported
Installation Date: 01-JAN-75
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 24-JUN-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: **REMOVED**
Pipe Status Date: 01-JUN-90
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 3
Tank Status: **REMOVED**
Tank Status Label: REMOVED
Tank Status Date: 01-JUN-90
Tank Sub Status: **Not reported**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DUTCH CHEV OLDS BUICK INC (Continued)

U003096959

Tank Sub Status Label: Not reported
Installation Date: 01-JAN-61
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 24-JUN-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-JUN-90
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 4
Tank Status: ABANDONED_IN_PLACE
Tank Status Label: ABANDONED IN PLACE
Tank Status Date: 01-JUN-90
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-JAN-68
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 1000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 24-JUN-86
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: ABANDONED_IN_PLACE
Pipe Status Date: 01-JUN-90
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: ABANDONED IN PLACE
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

H39
WSW
1/8-1/4
0.190 mi.
1003 ft.

CHARLES BOYNTON
11 BELMONT AVE
BELFAST, ME

ME LAST S106673739
N/A

Site 1 of 7 in cluster H

Relative:
Higher

LAST:

Actual:
210 ft.

Event:

Name: CHARLES BOYNTON
Address: 11 BELMONT AVE
City,State,Zip: BELFAST, ME
Spill Number: A-260-2003
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: False
AST inside flag: True
Create Date: 07/16/2003
Create By: EIDDAVIS
Modify Date: 11/15/2004
Modify By: 11/15/2004
Report Status Code: FR
Report Status: Final Report
Spill Datetime: Not reported
Spill Date Unknown: True
Spill Time Unknown: True
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 7
Reporter Type: Other Involved Party
Detection Method Code: H
Detection Method: Odor/Vapor/Mist
Inc Location Code: SF
Inc Location: Residential - Single Family
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 01
Spill Cause: Corrosion - Tank
Material Disposal Info: By DEP
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Status change from DRV to FR
Date Change: 11/15/2004
Changed By: EITGALLA

Description: Report Created with Report Status = DR
Date Change: 07/16/2003
Changed By: EIDDAVIS

Description: Report Status change from DR to DRV
Date Change: 01/16/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CHARLES BOYNTON (Continued)

S106673739

Changed By: EIDDAVIS

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: CHARLES BOYNTON
Title: Not reported
Company: Not reported
Address: POORS MILL RD
City,State: BELFAST,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: DANIEL E DAVIS

File:

Spill Id: A-260-2003
Date Created: 11/15/2004
Created By: EIPLAMBE
Date Modified: 02/18/2005
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 18-FEB-05.
Reconcile Date: 11/15/2004
File Reconciled By: Not reported

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 260
Spill Year: 2003
Create Date: 06/06/2003
Created By: EIMBARTO
Modify Date: 06/06/2003
Modify By: EIMBARTO
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 06/03/2003
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: DANIEL E DAVIS
Location: 11 Belmont Ave
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: Rusty tank - slow leak to pan and concrete floor

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CHARLES BOYNTON (Continued)

S106673739

Material Recovered:

Material Recovered Type: VP
Material Recovered: Unspilled Product
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: UNKNOWN

Material Recovered Type: SP
Material Recovered: Spilled Product
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: UNKNOWN

Spill Point:

Recovery Method: Pumps

Recovery Method: Other

Product:

Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: 10
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

40
WSW
1/8-1/4
0.214 mi.
1128 ft.

BELFAST, ME

**ME LUST S109801356
N/A**

**Relative:
Higher**

LUST:

**Actual:
207 ft.**

Event:

Name: Not reported
Address: Not reported
City,State,Zip: BELFAST, ME
Spill Number: B-59-1980
Spill Cause: Other - Unknown
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: False
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S109801356

Reporter Type: Anonymous
Detection Method: Other
Inc Location: Residential - Single Family
Inc Source: Not reported
Material Disposal Info: Not reported
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: DUTCH CHEVROLET
Address: Not reported
City,State: BELFAST,ME
Country: Not reported
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: GLENN JACKSON

File:

Spill Id: B-59-1980
Date Created: 08/26/2010
Created By: IMAGING
Date Modified: 08/26/2010
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 26-AUG-10.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Groundwater

Log:

Spill Void Flag: False
Spill Office: Bangor
Spill Off Sequence: 59
Spill Year: 1980
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S109801356

Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 04/08/1980
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: GLENN JACKSON
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: Not reported
Material Recovered: Not reported
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: Not reported

Recovery Method: Not reported

Spill Point:
Date Reported: 4/8/1980
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.422337
Longitude: -69.022618

Product:
Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: Not reported
Product Amt Qualifier: Not reported
Primary Product: False

H41
WSW
1/8-1/4
0.222 mi.
1174 ft.

BANK OF AMERICA / MBNA BELFAST
1 HATLEY ROAD
BELFAST, ME

ME AST S108052814
ME TIER 2 N/A

Site 2 of 7 in cluster H

Relative:
Higher
Actual:
206 ft.

AST:
Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915
Facility ID: FATR200948JK2R00CMRR
Facility Status: Not reported
Facility Phone: Not reported
Facility Dept: Facility - Engineering Department
Record Id: Not reported
CAS Number: 64742-53-6
Submitted By: Satish Natarajan
Max Container is Holding: 10568

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Max Amount Container: 4264
Location: Utility III Daytank Boiler
Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Lat/Long: 44.41989 / 69.022599

Chemical Name: Dielectric Oil
Amount: 2166
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2009

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Lead
Amount: 497
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2009

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Sulfuric Acid
Amount: 206
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 3
Days On Site: 365
CIEHS Chemical: T
Report Year: 2009

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: No. 2 Fuel
Amount: 497
Amount Unit: pounds
Type Code: Above Ground Tank

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 5
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2009

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Propane
Amount: 1576
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2009

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Propane
Amount: 3408
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2009

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Diesel
Amount: 2166
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 5
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2009

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Dielectric Oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Amount: 497
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2009

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Diesel
Amount: 497
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 5
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2009

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: No. 2 Fuel
Amount: 639
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 5
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2009

[Click this hyperlink](#) while viewing on your computer to access
248 additional ME_AST: record(s) in the EDR Site Report.

TIER 2:

Name: BANK OF AMERICA BELFAST
Address: 1 HATLEY ROAD
City,State,Zip: BELFAST, ME
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
Facility Mailing Country: Not reported
Report Year: 2007
Submitted By: Not reported
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR200748JK2R00CMRR
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	1 Hatley Road
Mail City:	Belfast
Mail State:	ME
Mail Zip:	4915
Mail Country:	USA
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.41989
Longitude:	69.022599
Name:	BANK OF AMERICA BELFAST
Address:	1 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2009
Submitted By:	Satish Natarajan
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/11/2010
Date TierII Received:	Not reported
Facility Dept:	Facility - Engineering Department
Facility ID:	FATR200948JK2R00CMRR
Failed Validation:	Not reported
Facility Date Modified:	3/4/2010
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	This facility passed all validation checks.
Latitude:	44.41989
Longitude:	69.022599
Name:	BANK OF AMERICA BELFAST
Address:	1 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2008
Submitted By:	Stacey McFadden/Authorized Representative
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/18/2009
Date TierII Received:	Not reported
Facility Dept:	Facility - Engineering Department
Facility ID:	FATR200848JK2R00CMRR
Failed Validation:	Not reported
Facility Date Modified:	3/5/2009
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	This facility passed all validation checks.
Latitude:	44.41989
Longitude:	69.022599
Name:	BANK OF AMERICA BELFAST
Address:	1 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2006
Submitted By:	Jay Wytiaz, Director Support Services, CBRE/Global Corporate Services 330 Bigbee Street, Pittsburgh, PA 15211
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/26/2007
Date TierII Received:	Not reported
Facility Dept:	Facility - Engineering Department
Facility ID:	FATR200648JK2R00CMRR
Failed Validation:	Not reported
Facility Date Modified:	4/18/2007
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.41989
Longitude:	69.022599
Name:	BANK OF AMERICA / MBNA BELFAST
Address:	1 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2005
Submitted By:	Lisa Shpritz, VP Corporate Workplace Manager
Acute/Chronic:	T
Average Amount:	17328
Record ID:	Not reported
Facility Router Record ID:	FATR200548JK2R00CMRR
Chemical Inventory Record ID:	CVTR200548JK2S01TN7C
Chemical Same As Last Year:	T
Chronic:	T
CICAS:	64742-53-6
CI EHS Chemical:	Not reported
CI Last Modified:	2/22/2006
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	365
Entered Chemical Name:	Dielectric Oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Fire:	T
Gas:	Not reported
Liquid:	T
Maximum Amount:	17328
Maximum Amount Code:	04
Maximum Amount Container:	4264
Mixture:	T
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR200548JK2R00CMRR
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	BANK OF AMERICA / MBNA BELFAST
Address:	1 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2005
Submitted By:	Lisa Shpritz, VP Corporate Workplace Manager
Acute/Chronic:	T
Average Amount:	49110
Record ID:	Not reported
Facility Router Record ID:	FATR200548JK2R00CMRR
Chemical Inventory Record ID:	CVTR200548JK2S01VN8R
Chemical Same As Last Year:	Not reported
Chronic:	T
CICAS:	Not reported
CI EHS Chemical:	T
CI Last Modified:	2/22/2006
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	365
Entered Chemical Name:	Batteries
Fire:	Not reported
Gas:	Not reported
Liquid:	T

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Maximum Amount:	49110
Maximum Amount Code:	04
Maximum Amount Container:	8.55
Mixture:	T
Pressure:	Not reported
Pure:	Not reported
Reactive:	T
Solid:	T
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR200548JK2R00CMRR
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	BANK OF AMERICA / MBNA BELFAST
Address:	1 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2005
Submitted By:	Lisa Shpritz, VP Corporate Workplace Manager
Acute/Chronic:	T
Average Amount:	14400
Record ID:	Not reported
Facility Router Record ID:	FATR200548JK2R00CMRR
Chemical Inventory Record ID:	CVTR200548JK2S00ZMY5
Chemical Same As Last Year:	Not reported
Chronic:	T
CICAS:	8006-61-9
CI EHS Chemical:	Not reported
CI Last Modified:	2/22/2006
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	250
Entered Chemical Name:	Gasoline
Fire:	T
Gas:	Not reported
Liquid:	T
Maximum Amount:	18000
Maximum Amount Code:	04
Maximum Amount Container:	18000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Mixture:	T
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR200548JK2R00CMRR
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	BANK OF AMERICA / MBNA BELFAST
Address:	1 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2005
Submitted By:	Lisa Shpritz, VP Corporate Workplace Manager
Acute/Chronic:	T
Average Amount:	212796
Record ID:	Not reported
Facility Router Record ID:	FATR200548JK2R00CMRR
Chemical Inventory Record ID:	CVTR200548JK2S013N0X
Chemical Same As Last Year:	Not reported
Chronic:	T
CICAS:	68476-30-2
CI EHS Chemical:	Not reported
CI Last Modified:	2/22/2006
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	365
Entered Chemical Name:	No. 2 Fuel
Fire:	T
Gas:	Not reported
Liquid:	T
Maximum Amount:	265994
Maximum Amount Code:	05
Maximum Amount Container:	85200
Mixture:	T
Pressure:	Not reported
Pure:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR200548JK2R00CMRR
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	BANK OF AMERICA / MBNA BELFAST
Address:	1 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2005
Submitted By:	Lisa Shpritz, VP Corporate Workplace Manager
Acute/Chronic:	T
Average Amount:	28289
Record ID:	Not reported
Facility Router Record ID:	FATR200548JK2R00CMRR
Chemical Inventory Record ID:	CVTR200548JK2S01MN45
Chemical Same As Last Year:	T
Chronic:	T
CICAS:	74-98-6
CI EHS Chemical:	Not reported
CI Last Modified:	2/22/2006
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	365
Entered Chemical Name:	Propane
Fire:	T
Gas:	T
Liquid:	T
Maximum Amount:	35362
Maximum Amount Code:	04
Maximum Amount Container:	4420
Mixture:	Not reported
Pressure:	T
Pure:	T
Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR200548JK2R00CMRR
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	BANK OF AMERICA / MBNA BELFAST
Address:	1 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2005
Submitted By:	Lisa Shpritz, VP Corporate Workplace Manager
Acute/Chronic:	T
Average Amount:	163243
Record ID:	Not reported
Facility Router Record ID:	FATR200548JK2R00CMRR
Chemical Inventory Record ID:	CVTR200548JK2S00NMUY
Chemical Same As Last Year:	T
Chronic:	T
CICAS:	68476-34-6
CI EHS Chemical:	Not reported
CI Last Modified:	2/22/2006
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	365
Entered Chemical Name:	Diesel
Fire:	T
Gas:	Not reported
Liquid:	T
Maximum Amount:	204054
Maximum Amount Code:	05
Maximum Amount Container:	85200
Mixture:	T
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR200548JK2R00CMRR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BANK OF AMERICA / MBNA BELFAST (Continued)

S108052814

Failed Validation: Not reported
Facility Date Modified: Not reported
Facility Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Mail Country: Not reported
Lat/Long Location Descr: Not reported
Lat/Long Method: Not reported
Notes: Not reported

Validation Report: Not reported
Latitude: Not reported
Longitude: Not reported

H42
WSW
1/8-1/4
0.222 mi.
1174 ft.

ATHENAHEALTH INC
1 HATLEY RD
BELFAST, ME

ME UST **U004281841**
N/A

Site 3 of 7 in cluster H

Relative:
Higher

UST:

Actual:
206 ft.

Name: ATHENAHEALTH INC
Address: 1 HATLEY RD
City: BELFAST
Facility ID: 20960
Facility Location2: BELFAST
Facility Code: COMMERCIAL
Fed Reg Ind: No
Owner Name: ATHENAHEALTH INC
Owner Contact: Not reported
Owner Delivery Address: 311 ARSENAL ST
Owner City/State/Zip: WATERTOWN, MA 02472
Owner Telephone: 6174021000
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: 44.42039
Longitude: -69.02222
Owner/Operator Name: ATHENAHEALTH INC
Owner/Operator Address: 311 ARSENAL ST
Owner/Operator City,St,Zip: WATERTOWN, MA 02472
Owner/Operator Phone: 6174021000

Tank Number: 1
Tank Status: **REMOVED**
Tank Status Label: REMOVED
Tank Status Date: 18-APR-17
Tank Sub Status: **SA_APPROVED**
Tank Sub Status Label: SA APPROVED
Installation Date: 01-FEB-96
Product Type: #2 FUEL OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH INC (Continued)

U004281841

Tank Volume in Gallons: 12000
Tank Above/Below: BELOWGROUND
Tank Material: JACKETED TANK - DOUBLE-WALLED
Reg Date: 10-JAN-05
Tank Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Chamber ID: 1
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Pipe Status: REMOVED
Pipe Status Date: 18-APR-17
Pipe Date Installed: 01/01/1996
Pipe Material Label: FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label: REMOVED
Pipe Leak Detection: SEC_CONT_CONTIN_ELEC_MON
Pipe Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Overfill: ELECTRONIC
Overfill Protection Label: ELECTRONIC

Tank Number: 2
Tank Status: PLANNED
Tank Status Label: PLANNED FOR INSTALLATION
Tank Status Date: 24-OCT-05
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 24-OCT-05
Product Type: DIESEL
Tank Volume in Gallons: 90
Tank Above/Below: ABOVEGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 10-JAN-05
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Pipe Status: PLANNED
Pipe Status Date: 24-OCT-05
Pipe Date Installed: 10/24/2005
Pipe Material Label: NONE
Pipe Status Label: PLANNED FOR INSTALLATION
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: ELECTRONIC
Overfill Protection Label: ELECTRONIC

Tank Number: 3
Tank Status: PLANNED
Tank Status Label: PLANNED FOR INSTALLATION
Tank Status Date: 24-OCT-05
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 24-OCT-05
Product Type: DIESEL
Tank Volume in Gallons: 164
Tank Above/Below: ABOVEGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH INC (Continued)

U004281841

Reg Date:	10-JAN-05
Tank Leak Detection Label:	UNKNOWN
Chamber ID:	1
Chamber Pump Type Label:	SUCTION
Chamber Pump Type Desc:	SUCTION
Pipe Status:	PLANNED
Pipe Status Date:	24-OCT-05
Pipe Date Installed:	10/24/2005
Pipe Material Label:	NONE
Pipe Status Label:	PLANNED FOR INSTALLATION
Pipe Leak Detection:	UNKNOWN
Pipe Leak Detection Label:	UNKNOWN
Overfill:	ELECTRONIC
Overfill Protection Label:	ELECTRONIC
Tank Number:	4
Tank Status:	PLANNED
Tank Status Label:	PLANNED FOR INSTALLATION
Tank Status Date:	24-OCT-05
Tank Sub Status:	Not reported
Tank Sub Status Label:	Not reported
Installation Date:	24-OCT-05
Product Type:	DIESEL
Tank Volume in Gallons:	164
Tank Above/Below:	ABOVEGROUND
Tank Material:	STEEL - BARE OR ASPHALT COATED.
Reg Date:	10-JAN-05
Tank Leak Detection Label:	UNKNOWN
Chamber ID:	1
Chamber Pump Type Label:	SUCTION
Chamber Pump Type Desc:	SUCTION
Pipe Status:	PLANNED
Pipe Status Date:	24-OCT-05
Pipe Date Installed:	10/24/2005
Pipe Material Label:	NONE
Pipe Status Label:	PLANNED FOR INSTALLATION
Pipe Leak Detection:	UNKNOWN
Pipe Leak Detection Label:	UNKNOWN
Overfill:	ELECTRONIC
Overfill Protection Label:	ELECTRONIC
Tank Number:	5
Tank Status:	PLANNED
Tank Status Label:	PLANNED FOR INSTALLATION
Tank Status Date:	24-OCT-05
Tank Sub Status:	Not reported
Tank Sub Status Label:	Not reported
Installation Date:	24-OCT-05
Product Type:	DIESEL
Tank Volume in Gallons:	222
Tank Above/Below:	ABOVEGROUND
Tank Material:	STEEL - BARE OR ASPHALT COATED.
Reg Date:	10-JAN-05
Tank Leak Detection Label:	UNKNOWN
Chamber ID:	1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH INC (Continued)

U004281841

Chamber Pump Type Label:	SUCTION
Chamber Pump Type Desc:	SUCTION
Pipe Status:	PLANNED
Pipe Status Date:	24-OCT-05
Pipe Date Installed:	10/24/2005
Pipe Material Label:	NONE
Pipe Status Label:	PLANNED FOR INSTALLATION
Pipe Leak Detection:	UNKNOWN
Pipe Leak Detection Label:	UNKNOWN
Overfill:	ELECTRONIC
Overfill Protection Label:	ELECTRONIC
Tank Number:	6
Tank Status:	PLANNED
Tank Status Label:	PLANNED FOR INSTALLATION
Tank Status Date:	24-OCT-05
Tank Sub Status:	Not reported
Tank Sub Status Label:	Not reported
Installation Date:	24-OCT-05
Product Type:	DIESEL
Tank Volume in Gallons:	400
Tank Above/Below:	ABOVEGROUND
Tank Material:	STEEL - BARE OR ASPHALT COATED.
Reg Date:	10-JAN-05
Tank Leak Detection Label:	UNKNOWN
Chamber ID:	1
Chamber Pump Type Label:	SUCTION
Chamber Pump Type Desc:	SUCTION
Pipe Status:	PLANNED
Pipe Status Date:	24-OCT-05
Pipe Date Installed:	10/24/2005
Pipe Material Label:	NONE
Pipe Status Label:	PLANNED FOR INSTALLATION
Pipe Leak Detection:	UNKNOWN
Pipe Leak Detection Label:	UNKNOWN
Overfill:	ELECTRONIC
Overfill Protection Label:	ELECTRONIC
Tank Number:	7
Tank Status:	PLANNED
Tank Status Label:	PLANNED FOR INSTALLATION
Tank Status Date:	24-OCT-05
Tank Sub Status:	Not reported
Tank Sub Status Label:	Not reported
Installation Date:	24-OCT-05
Product Type:	DIESEL
Tank Volume in Gallons:	200
Tank Above/Below:	ABOVEGROUND
Tank Material:	STEEL - BARE OR ASPHALT COATED.
Reg Date:	10-JAN-05
Tank Leak Detection Label:	UNKNOWN
Chamber ID:	1
Chamber Pump Type Label:	SUCTION
Chamber Pump Type Desc:	SUCTION
Pipe Status:	PLANNED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH INC (Continued)

U004281841

Pipe Status Date: 24-OCT-05
Pipe Date Installed: 10/24/2005
Pipe Material Label: NONE
Pipe Status Label: PLANNED FOR INSTALLATION
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: ELECTRONIC
Overfill Protection Label: ELECTRONIC

H43
WSW
1/8-1/4
0.222 mi.
1174 ft.

MBNA NEW ENGLAND BELFAST
1 HATLEY RD
BELFAST, ME

Site 4 of 7 in cluster H

ME AST **A100273103**
N/A

Relative:
Higher

AST:

Actual:
206 ft.

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST
Facility ID: Not reported
Facility Status: OUTSIDE
Facility Phone: 2073387901
Facility Dept: Not reported
Record Id: 1000003891
CAS Number: Not reported
Submitted By: Not reported
Max Container is Holding: Not reported
Max Amount Container: Not reported
Location: Not reported
Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Lat/Long: Not reported

Chemical Name: PROPANE
Amount: Not reported
Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported
Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported
CIEHS Chemical: Not reported
Report Year: Not reported

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST

Chemical Name: FUEL OIL, [DIESEL]
Amount: Not reported
Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported
Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MBNA NEW ENGLAND BELFAST (Continued)

A100273103

CIEHS Chemical: Not reported
Report Year: Not reported

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST

Chemical Name: LEAD
Amount: Not reported
Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported
Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported
CIEHS Chemical: Not reported
Report Year: Not reported

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST

Chemical Name: FUEL OIL, [DIESEL]
Amount: Not reported
Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported
Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported
CIEHS Chemical: Not reported
Report Year: 2000

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST

Chemical Name: FUEL OIL, [NO. 2]
Amount: Not reported
Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported
Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported
CIEHS Chemical: Not reported
Report Year: 2000

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST

Chemical Name: SULFURIC ACID
Amount: Not reported
Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MBNA NEW ENGLAND BELFAST (Continued)

A100273103

Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported
CIEHS Chemical: Not reported
Report Year: 2000

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST

Chemical Name: LEAD
Amount: Not reported
Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported
Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported
CIEHS Chemical: Not reported
Report Year: 2000

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST

Chemical Name: PROPANE
Amount: Not reported
Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported
Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported
CIEHS Chemical: Not reported
Report Year: 2000

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST

Chemical Name: GASOLINE
Amount: Not reported
Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported
Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported
CIEHS Chemical: Not reported
Report Year: 2000

Name: MBNA NEW ENGLAND BELFAST
Address: 1 HATLEY RD
City,State,Zip: BELFAST

Chemical Name: FUEL OIL, [NO. 2]
Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MBNA NEW ENGLAND BELFAST (Continued)

A100273103

Amount Unit: Not reported
Type Code: Not reported
Pressure Code: Not reported
Temperature Code: Not reported
Max Amount Code: Not reported
Days On Site: Not reported
CIEHS Chemical: Not reported
Report Year: 1999

[Click this hyperlink](#) while viewing on your computer to access
9 additional ME_AST: record(s) in the EDR Site Report.

AST 2:

Name: ATHENAHEALTH INC
Address: 1 HATLEY RD
City: BELFAST
Registration Number: 20960
Facility Location: BELFAST
Facility Telephone Number: 2073237594
Facility Use Code: COMMERCIAL
Owner Name: ATHENAHEALTH INC
Owner Contact: Not reported
Owner Delivery Address: 311 ARSENAL ST
Owner Town: WATERTOWN
Owner State: MA
Owner Zip: 02472
Owner Zip Plus: Not reported
Owner Telephone Number: 6174021000
Operator Name: ATHENAHEALTH INC
Operator Contact: Not reported
Operator Delivery Address: 311 ARSENAL ST
Operator Town: WATERTOWN
Operator State: MA
Operator Zip: 02472
Operator Zip Plus: Not reported
Operator Telephone Number: 6174021000
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Nearby Water Other Owner: No
Nearby Water Other Owner Label: Not reported
Latitude: 44.42039612
Longitude: -69.02222835

Tank Number: 2
Tank Status: PLANNED
Tank Status Label: PLANNED FOR INSTALLATION
Status Date: 10/24/2005
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Date Installed: 10/24/2005
Tank Type: ABOVEGROUND
Substance: DIESEL
Tank Volume Gl: 90

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MBNA NEW ENGLAND BELFAST (Continued)

A100273103

Tank Material: STEEL - BARE OR ASPHALT COATED.
Tank Leak Detection: UNKNOWN
Tank Leak Detection Label: UNKNOWN
Chamber Number: 1
Overfill Protection: ELECTRONIC
Registration Date: 01/10/2005
Fed Regulated: No
Chamber Volume GI: 90
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Date Piping Installed: 10/24/2005
Piping Type: ABOVEGROUND
Piping Material: NONE
Piping Status: PLANNED
Piping Status Date: 10/24/2005
Piping Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Piping Status Label: PLANNED FOR INSTALLATION
Overfill Protection Label: ELECTRONIC

Tank Number: 3
Tank Status: PLANNED
Tank Status Label: PLANNED FOR INSTALLATION
Status Date: 10/24/2005
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Date Installed: 10/24/2005
Tank Type: ABOVEGROUND
Substance: DIESEL
Tank Volume GI: 164
Tank Material: STEEL - BARE OR ASPHALT COATED.
Tank Leak Detection: UNKNOWN
Tank Leak Detection Label: UNKNOWN
Chamber Number: 1
Overfill Protection: ELECTRONIC
Registration Date: 01/10/2005
Fed Regulated: No
Chamber Volume GI: 164
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Date Piping Installed: 10/24/2005
Piping Type: ABOVEGROUND
Piping Material: NONE
Piping Status: PLANNED
Piping Status Date: 10/24/2005
Piping Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Piping Status Label: PLANNED FOR INSTALLATION
Overfill Protection Label: ELECTRONIC

Tank Number: 4
Tank Status: PLANNED
Tank Status Label: PLANNED FOR INSTALLATION
Status Date: 10/24/2005
Tank Sub Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MBNA NEW ENGLAND BELFAST (Continued)

A100273103

Tank Sub Status Label: Not reported
Date Installed: 10/24/2005
Tank Type: ABOVEGROUND
Substance: DIESEL
Tank Volume Gl: 164
Tank Material: STEEL - BARE OR ASPHALT COATED.
Tank Leak Detection: UNKNOWN
Tank Leak Detection Label: UNKNOWN
Chamber Number: 1
Overfill Protection: ELECTRONIC
Registration Date: 01/10/2005
Fed Regulated: No
Chamber Volume Gl: 164
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Date Piping Installed: 10/24/2005
Piping Type: ABOVEGROUND
Piping Material: NONE
Piping Status: PLANNED
Piping Status Date: 10/24/2005
Piping Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Piping Status Label: PLANNED FOR INSTALLATION
Overfill Protection Label: ELECTRONIC

Tank Number: 5
Tank Status: PLANNED
Tank Status Label: PLANNED FOR INSTALLATION
Status Date: 10/24/2005
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Date Installed: 10/24/2005
Tank Type: ABOVEGROUND
Substance: DIESEL
Tank Volume Gl: 222
Tank Material: STEEL - BARE OR ASPHALT COATED.
Tank Leak Detection: UNKNOWN
Tank Leak Detection Label: UNKNOWN
Chamber Number: 1
Overfill Protection: ELECTRONIC
Registration Date: 01/10/2005
Fed Regulated: No
Chamber Volume Gl: 222
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Date Piping Installed: 10/24/2005
Piping Type: ABOVEGROUND
Piping Material: NONE
Piping Status: PLANNED
Piping Status Date: 10/24/2005
Piping Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Piping Status Label: PLANNED FOR INSTALLATION
Overfill Protection Label: ELECTRONIC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MBNA NEW ENGLAND BELFAST (Continued)

A100273103

Tank Number: 6
Tank Status: PLANNED
Tank Status Label: PLANNED FOR INSTALLATION
Status Date: 10/24/2005
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Date Installed: 10/24/2005
Tank Type: ABOVEGROUND
Substance: DIESEL
Tank Volume Gl: 400
Tank Material: STEEL - BARE OR ASPHALT COATED.
Tank Leak Detection: UNKNOWN
Tank Leak Detection Label: UNKNOWN
Chamber Number: 1
Overfill Protection: ELECTRONIC
Registration Date: 01/10/2005
Fed Regulated: No
Chamber Volume Gl: 400
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Date Piping Installed: 10/24/2005
Piping Type: ABOVEGROUND
Piping Material: NONE
Piping Status: PLANNED
Piping Status Date: 10/24/2005
Piping Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Piping Status Label: PLANNED FOR INSTALLATION
Overfill Protection Label: ELECTRONIC

Tank Number: 7
Tank Status: PLANNED
Tank Status Label: PLANNED FOR INSTALLATION
Status Date: 10/24/2005
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Date Installed: 10/24/2005
Tank Type: ABOVEGROUND
Substance: DIESEL
Tank Volume Gl: 200
Tank Material: STEEL - BARE OR ASPHALT COATED.
Tank Leak Detection: UNKNOWN
Tank Leak Detection Label: UNKNOWN
Chamber Number: 1
Overfill Protection: ELECTRONIC
Registration Date: 01/10/2005
Fed Regulated: No
Chamber Volume Gl: 200
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Date Piping Installed: 10/24/2005
Piping Type: ABOVEGROUND
Piping Material: NONE
Piping Status: PLANNED
Piping Status Date: 10/24/2005
Piping Leak Detection: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MBNA NEW ENGLAND BELFAST (Continued)

A100273103

Pipe Leak Detection Label: UNKNOWN
Piping Status Label: PLANNED FOR INSTALLATION
Overfill Protection Label: ELECTRONIC

H44
WSW
1/8-1/4
0.222 mi.
1174 ft.
MBNA BELFAST FLEET BLDG
1 HATLEY RD
BELFAST, ME
Site 5 of 7 in cluster H

ME UST **U004281836**
N/A

Relative:
Higher

Actual:
206 ft.

UST:
Name: MBNA BELFAST FLEET BLDG
Address: 1 HATLEY RD
City: BELFAST
Facility ID: 19721
Facility Location2: BELFAST
Facility Code: COMMERCIAL
Fed Reg Ind: Yes
Owner Name: BRACEBRIDGE CORP
Owner Contact: Not reported
Owner Delivery Address: 1 HATLEY RD
Owner City/State/Zip: BELFAST, ME 04915
Owner Telephone: 2073387079
Operator Contact: ORTIZ- VIDAL, YARISSA
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: 44.42104
Longitude: -69.02223
Owner/Operator Name: MBNA MARKETING SYSTEMS INC
Owner/Operator Address: 1 HATLEY RD
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073387079

Tank Number: 1
Tank Status: **ABANDONED_IN_PLACE**
Tank Status Label: ABANDONED IN PLACE
Tank Status Date: 01-JUN-05
Tank Sub Status: **Not reported**
Tank Sub Status Label: Not reported
Installation Date: 15-JAN-98
Product Type: WASTE OIL/USED MOTOR OIL
Tank Volume in Gallons: 500
Tank Above/Below: BELOWGROUND
Tank Material: JACKETED TANK - DOUBLE-WALLED
Reg Date: 29-SEP-97
Tank Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Chamber ID: 1
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Pipe Status: **ABANDONED_IN_PLACE**
Pipe Status Date: 01-JUN-05
Pipe Date Installed: 01/15/1998

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MBNA BELFAST FLEET BLDG (Continued)

U004281836

Pipe Material Label: F/GLASS - SEC CONTAINMENT - PETRO ONLY
Pipe Status Label: ABANDONED IN PLACE
Pipe Leak Detection: SEC_CONT_CONTIN_ELEC_MON
Pipe Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Overfill: ELECTRONIC
Overfill Protection Label: ELECTRONIC

H45
WSW
1/8-1/4
0.227 mi.
1196 ft.

ATHENAHEALTH, INC.
3 HATLEY RD
BELFAST, ME 04915

Site 6 of 7 in cluster H

ME AST
ME AIRS
ME TIER 2
S109697308
N/A

Relative:
Higher
Actual:
205 ft.

AST:
Name: ATHENAHEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915
Facility ID: FATR2021D7MQA8002W7L
Facility Status: Not reported
Facility Phone: Not reported
Facility Dept: Not reported
Record Id: Not reported
CAS Number: Not reported
Submitted By: Not reported
Max Container is Holding: 4200
Max Amount Container: 42200
Location: East side of clinic - (2) 1000 gallon
Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Lat/Long: 44.41914 / -69.02151

Chemical Name: Propane
Amount: 8440
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2021

Name: ATHENAHEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Propane
Amount: 8440
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2020

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Name: ATHENAHEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Propane
Amount: 639
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: No
Report Year: 2019

Name: ATHENAHEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Ultra Low Sulfur Diesel Fuel
Amount: 12660
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 08
Days On Site: 365
CIEHS Chemical: No
Report Year: 2018

Name: ATHENAHEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: PROPANE
Amount: 2162
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: No
Report Year: 2017

Name: ATHENAHEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Ethylene Glycol
Amount: 54874
Amount Unit: pounds
Type Code: Above ground tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 08
Days On Site: 365

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

CIEHS Chemical: No
Report Year: 2016

Name: ATHENAHEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Structural Steel
Amount: 7029
Amount Unit: pounds
Type Code: Above
Pressure Code: Ambie
Temperature Code: Ambie
Max Amount Code: 07
Days On Site: 365
CIEHS Chemical: No
Report Year: 2015

Name: ATHENA HEALTH INC.
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: LEAD
Amount: 2132
Amount Unit: pounds
Type Code: Above
Pressure Code: Ambie
Temperature Code: Ambie
Max Amount Code: 6
Days On Site: 365
CIEHS Chemical: No
Report Year: 2014

Name: ATHENAHEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Diesel Fuel
Amount: 2328
Amount Unit: pounds
Type Code: Above
Pressure Code: Ambie
Temperature Code: Ambie
Max Amount Code: 08
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2013

Name: ATHENA HEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915

Chemical Name: Diesel Fuel
Amount: 1491
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 366
CIEHS Chemical: Not reported
Report Year: 2012

[Click this hyperlink](#) while viewing on your computer to access
106 additional ME_AST: record(s) in the EDR Site Report.

AIRS:

Name: ATHENAHEALTH, INC.
Address: 3 HATLEY RD
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: 2015
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: Not reported
Lead: Not reported
Permit Issued Date: Not reported
Permit Expiration Date: Not reported
Facility Category: Not reported
Lead: Not reported

Name: ATHENAHEALTH, INC.
Address: 3 HATLEY RD
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: Not reported
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: Not reported
Lead: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Permit Issued Date: 10/12/2012
Permit Expiration Date: 10/12/2022
Facility Category: Synthetic Minor
Lead: Not reported

Name: ATHENAHEALTH, INC.
Address: 3 HATLEY RD
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: 2012
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: n/a
Lead: Not reported
Permit Issued Date: Not reported
Permit Expiration Date: Not reported
Facility Category: Not reported
Lead: Not reported

Name: ATHENAHEALTH, INC.
Address: 3 HATLEY RD
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: 2018
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: Not reported
Lead: Not reported
Permit Issued Date: 10/12/2012
Permit Expiration Date: 10/12/2022
Facility Category: Synthetic Minor
Lead: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Name: ATHENAHEALTH, INC.
Address: 3 HATLEY RD
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: 2011
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: n/a
Lead: Not reported
Permit Issued Date: Not reported
Permit Expiration Date: Not reported
Facility Category: Not reported
Lead: Not reported

TIER 2:

Name: ATHENAHEALTH
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME 04915
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
Facility Mailing Country: Not reported
Report Year: 2016
Submitted By: Robert DesLauriers
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported
Facility Router Record ID: Not reported
Chemical Inventory Record ID: Not reported
Chemical Same As Last Year: Not reported
Chronic: Not reported
CICAS: Not reported
CI EHS Chemical: Not reported
CI Last Modified: Not reported
MSDS Number For Chemical: Not reported
CI Notes: Not reported
Days On Site: Not reported
Entered Chemical Name: Not reported
Fire: Not reported
Gas: Not reported
Liquid: Not reported
Maximum Amount: Not reported
Maximum Amount Code: Not reported
Maximum Amount Container: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/1/2017
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2016AJP02G002PXV
Failed Validation:	Not reported
Facility Date Modified:	08/28/2017
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.41914
Longitude:	-69.02151
Name:	ATHENAHEALTH
Address:	3 HATLEY ROAD
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2021
Submitted By:	Not reported
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	true
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Reactive: Not reported
Solid: Not reported
Date Signed: 2022-01-13
Date TierII Received: Not reported
Facility Dept: Not reported
Facility ID: FATR2021D7MQA8002W7L
Failed Validation: Not reported
Facility Date Modified: 01/13/2022
Facility Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Mail Country: Not reported
Lat/Long Location Descr: Not reported
Lat/Long Method: Not reported
Notes: Not reported

Validation Report: Not reported
Latitude: 44.41914
Longitude: -69.02151

Name: ATHENAHEALTH INC.
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
Facility Mailing Country: Not reported
Report Year: 2008
Submitted By: Robert DesLauriers
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported
Facility Router Record ID: Not reported
Chemical Inventory Record ID: Not reported
Chemical Same As Last Year: Not reported
Chronic: Not reported
CICAS: Not reported
CI EHS Chemical: Not reported
CI Last Modified: Not reported
MSDS Number For Chemical: Not reported
CI Notes: Not reported
Days On Site: Not reported
Entered Chemical Name: Not reported
Fire: Not reported
Gas: Not reported
Liquid: Not reported
Maximum Amount: Not reported
Maximum Amount Code: Not reported
Maximum Amount Container: Not reported
Mixture: Not reported
Pressure: Not reported
Pure: Not reported
Reactive: Not reported
Solid: Not reported
Date Signed: 5/26/2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20086GMZ57002VAM
Failed Validation:	Not reported
Facility Date Modified:	7/9/2009
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	CE - Center of Facility
Lat/Long Method:	G4 - GPS (Precise Positioning Service)
Notes:	Not reported

Validation Report:	This facility passed all validation checks.
Latitude:	44.41911
Longitude:	-69.02128

Name:	ATHENAHEALTH
Address:	3 HATLEY ROAD
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2017
Submitted By:	Robert DesLauriers
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/26/2018
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2017AJP02G002PXV

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Failed Validation: Not reported
Facility Date Modified: 09/13/2018
Facility Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Mail Country: Not reported
Lat/Long Location Descr: Not reported
Lat/Long Method: Not reported
Notes: Not reported

Validation Report: Not reported
Latitude: 44.41914
Longitude: -69.02151

Name: ATHENA HEALTH INC.
Address: 3 HATLEY ROAD
City,State,Zip: BELFAST, ME
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
Facility Mailing Country: Not reported
Report Year: 2009
Submitted By: Robert DesLauriers
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported
Facility Router Record ID: Not reported
Chemical Inventory Record ID: Not reported
Chemical Same As Last Year: Not reported
Chronic: Not reported
CICAS: Not reported
CI EHS Chemical: Not reported
CI Last Modified: Not reported
MSDS Number For Chemical: Not reported
CI Notes: Not reported
Days On Site: Not reported
Entered Chemical Name: Not reported
Fire: Not reported
Gas: Not reported
Liquid: Not reported
Maximum Amount: Not reported
Maximum Amount Code: Not reported
Maximum Amount Container: Not reported
Mixture: Not reported
Pressure: Not reported
Pure: Not reported
Reactive: Not reported
Solid: Not reported
Date Signed: 2/23/2010
Date TierII Received: Not reported
Facility Dept: Not reported
Facility ID: FATR200971N42U002HGE
Failed Validation: Not reported
Facility Date Modified: 3/4/2010
Facility Mail Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	CE - Center of Facility
Lat/Long Method:	G4 - GPS (Precise Positioning Service)
Notes:	Not reported
Validation Report:	This facility passed all validation checks.
Latitude:	44.41911
Longitude:	-69.02128
Name:	ATHENA HEALTH
Address:	3 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	3 Hatley Road
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2012
Submitted By:	Robert DesLauriers
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	04-14-2013
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR201297FPCS002CPG
Failed Validation:	Not reported
Facility Date Modified:	08/14/2013
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Mail Country:	Not reported
Lat/Long Location Descr:	CE - Center of Facility
Lat/Long Method:	G4 - GPS (Precise Positioning Service)
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.41911
Longitude:	-69.02128
Name:	ATHENA HEALTH INC.
Address:	3 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	3 Hatley Road
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2014
Submitted By:	Robert DesLauriers
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/10/2015
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20147R45EG002SMQ
Failed Validation:	Not reported
Facility Date Modified:	11/10/2015
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.41911
Longitude:	-69.02129
Name:	ATHENAHEALTH
Address:	3 HATLEY ROAD
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2018
Submitted By:	Stephen Christie Sr Property Manager athenaEnvironment
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/11/2019
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2018D7MQA8002W7L
Failed Validation:	Not reported
Facility Date Modified:	07/30/2019
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Latitude:	44.41914
Longitude:	-69.02151
Name:	ATHENA HEALTH INC.
Address:	3 HATLEY ROAD
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	3 Hatley Road
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2011
Submitted By:	Robert DesLauriers
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/5/2012
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20117R45EG002SMQ
Failed Validation:	Not reported
Facility Date Modified:	11/02/2012
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	CE - Center of Facility
Lat/Long Method:	G4 - GPS (Precise Positioning Service)
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.41911
Longitude:	-69.02128

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Name:	ATHENAHEALTH
Address:	3 HATLEY ROAD
City,State,Zip:	BELFAST, ME 04915
Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2020
Submitted By:	Not reported
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	false
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2021-01-14
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2020D7MQA8002W7L
Failed Validation:	Not reported
Facility Date Modified:	01/14/2021
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	false
Latitude:	44.41914
Longitude:	-69.02151
Name:	ATHENAHEALTH
Address:	3 HATLEY ROAD
City,State,Zip:	BELFAST, ME 04915

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHENAHEALTH, INC. (Continued)

S109697308

Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2015
Submitted By:	Robert DesLauriers
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/22/2016
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2015AJP02G002PXV
Failed Validation:	Not reported
Facility Date Modified:	08/19/2016
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.41914
Longitude:	-69.02151

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

H46
WSW
1/8-1/4
0.227 mi.
1196 ft.
ATHEANAHEALTH INC
3 HATLEY RD
BELFAST, ME
Site 7 of 7 in cluster H

ME UST
U004340269
N/A

Relative:
Higher

UST:

Actual:
205 ft.

Name: ATHEANAHEALTH INC
Address: 3 HATLEY RD
City: BELFAST
Facility ID: 20961
Facility Location2: BELFAST
Facility Code: COMMERCIAL
Fed Reg Ind: Yes
Owner Name: ATHENAHEALTH INC
Owner Contact: Not reported
Owner Delivery Address: 311 ARSENAL ST
Owner City/State/Zip: WATERTOWN, MA 02472
Owner Telephone: 6174021000
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: 44.42039
Longitude: -69.02223
Owner/Operator Name: ATHENAHEALTH INC
Owner/Operator Address: 311 ARSENAL ST
Owner/Operator City,St,Zip: WATERTOWN, MA 02472
Owner/Operator Phone: 6174021000

Tank Number: 1
Tank Status: **ACTIVE**
Tank Status Label: ACTIVE
Tank Status Date: 10-JAN-05
Tank Sub Status: **IN_SERVICE**
Tank Sub Status Label: IN SERVICE
Installation Date: 01-FEB-96
Product Type: DIESEL
Tank Volume in Gallons: 10000
Tank Above/Below: BELOWGROUND
Tank Material: JACKETED TANK - DOUBLE-WALLED
Reg Date: 10-JAN-05
Tank Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Chamber ID: 1
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Pipe Status: **ACTIVE**
Pipe Status Date: 10-JAN-05
Pipe Date Installed: 02/01/1996
Pipe Material Label: FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label: ACTIVE
Pipe Leak Detection: SEC_CONT_CONTIN_ELEC_MON
Pipe Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Overfill: ELECTRONIC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ATHEANAHEALTH INC (Continued)

U004340269

Overfill Protection Label: ELECTRONIC

47
East
1/8-1/4
0.227 mi.
1201 ft.

CRONIN
216 MAIN STREET
BELFAST, ME

ME LAST S125411147
N/A

Relative:
Higher
Actual:
208 ft.

LAST:

Event:

Name: CRONIN
Address: 216 MAIN STREET
City,State,Zip: BELFAST, ME
Spill Number: A-523-2017
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: True
AST inside flag: True
Create Date: 10/23/2017
Create By: EIEWERLY
Modify Date: 08/20/2019
Modify By: 08/20/2019
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 10/03/2017
Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 6
Reporter Type: Contractor/Consultant
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: SF
Inc Location: Residential - Single Family
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 01
Spill Cause: Corrosion - Tank
Material Disposal Info: Spiller arranged for disposal
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 10/23/2017
Changed By: EIEWERLY

Description: Report Status change from DQA to FR
Date Change: 08/20/2019
Changed By: EIRKROUT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CRONIN (Continued)

S125411147

Description: Report Status change from DR to DRV
Date Change: 08/23/2018
Changed By: EIRWILLI

Description: Report Status change from DRV to DQA
Date Change: 08/13/2019
Changed By: EIJWOODA

Contact:
Contact Type: Subject/Spiller
Potential RP: True
Name: JOHN CRONIN
Title: OWNER
Company: Not reported
Address: 216 MAIN STREET
City,State: BELFAST,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: ROBERT J WILLIAMS

Media Affected:
Medium: Land

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 523
Spill Year: 2017
Create Date: 10/23/2017
Created By: EIEWERLY
Modify Date: 10/23/2017
Modify By: EIEWERLY
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 10/03/2017
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: ROBERT J WILLIAMS
Location: 216 Main Street
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: Leaking tank in basement

Material Recovered:
Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 25
Material Units: lbs.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CRONIN (Continued)

S125411147

Material Amt Qualifier: ESTIMATE

Spill Point:
Recovery Method: Sorbents

Product:
Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: .9
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

**I48
WSW
1/4-1/2
0.332 mi.
1752 ft.**

**NICKERSON'S EXXON
ROUTE 3
BELFAST, ME**

**ME LUST S106795858
N/A**

Site 1 of 4 in cluster I

**Relative:
Higher**

LUST:

**Actual:
197 ft.**

Event:

Name: NICKERSON'S EXXON
Address: ROUTE 3
City,State,Zip: BELFAST, ME
Spill Number: A-232-1998
Spill Cause: Other - Unknown
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Site Assessment
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: Not reported
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICKERSON'S EXXON (Continued)

S106795858

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: NICKERSON'S EXXON
Address: ROUTE 3
City,State: BELFAST,ME
Country: Not reported
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: MARY CORR

File:

Spill Id: A-232-1998
Date Created: 09/29/1998
Created By: SPILLS
Date Modified: 04/07/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 07-APR-09.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Medium: Groundwater

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 232
Spill Year: 1998
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 05/04/1998
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: MARY CORR
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICKERSON'S EXXON (Continued)

S106795858

Material Recovered:

Material Recovered Type: Not reported
Material Recovered: Not reported
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: Not reported

Recovery Method: None

Spill Point:

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: Unknown
Product Amt Qualifier: UNKNOWN
Primary Product: False

J49
NE
1/4-1/2
0.332 mi.
1754 ft.

MCTAGGART APARTMENT HOUSE
60 WALDO AVENUE
BELFAST, ME

ME LAST **S117323282**
N/A

Site 1 of 2 in cluster J

Relative:
Lower

LAST:

Actual:
118 ft.

Event:

Name: MCTAGGART APARTMENT HOUSE
Address: 60 WALDO AVENUE
City,State,Zip: BELFAST, ME
Spill Number: A-168-2013
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: True
AST inside flag: True
Create Date: 04/11/2013
Create By: EIRWILLI
Modify Date: 09/22/2014
Modify By: 09/22/2014
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 03/25/2013
Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 2
Reporter Type: Subject/Spiller
Detection Method Code: L
Detection Method: Visual Product

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MCTAGGART APARTMENT HOUSE (Continued)

S117323282

Inc Location Code: MF
Inc Location: Residential - Multi Family
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 09
Spill Cause: Overfill
Material Disposal Info: Maritime Energy arranged for disposal.
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Status change from DRV to DQA
Date Change: 09/17/2014
Changed By: EIJWOODA

Description: Report Status change from DQA to FR
Date Change: 09/22/2014
Changed By: EIRKROUT

Description: Report Created with Report Status = DR
Date Change: 04/11/2013
Changed By: EIRWILLI

Description: Report Status change from DR to DRV
Date Change: 07/12/2013
Changed By: EIRWILLI

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: MARITIME ENERGY
Address: 234 PARK ST
City,State: ROCKLAND,ME
Country: USA
Zipcode: 04841
Phone/Ext: /
Comments: Not reported

Contact Type: Other Contact
Potential RP: False
Name: SHANE MCTAGGART
Title: OWNER
Company: Not reported
Address: 60 WALDO AVENUE
City,State: BELFAST,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: ROBERT J WILLIAMS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MCTAGGART APARTMENT HOUSE (Continued)

S117323282

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 168
Spill Year: 2013
Create Date: 04/11/2013
Created By: EIRWILLI
Modify Date: 04/11/2013
Modify By: EIRWILLI
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 03/25/2013
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: ROBERT J WILLIAMS
Location: 60 Waldo Ave
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: 2 quarts from overfill of basement tank

Material Recovered:

Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 80
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Spill Point:

Recovery Method: Sorbents

Product:

Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: .5
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

I50
WSW
1/4-1/2
0.335 mi.
1771 ft.

**NICKERSONS EXXON
25 BELMONT AVE
BELFAST, ME**

Site 2 of 4 in cluster I

**ME LUST U003765937
ME UST N/A**

Relative:
Higher

LUST:

Actual:
197 ft.

Event:

Name: NICKERSONS EXXON
Address: 25 BELMONT AVE
City,State,Zip: BELFAST, ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICKERSONS EXXON (Continued)

U003765937

Spill Number: A-576-2002
Spill Cause: Other - Unknown
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: True
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/17/2002
Create By: EIGWALL
Modify Date: 11/06/2003
Modify By: EITGALLA
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: True
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Tank and/or Piping Removal
Inc Location: Terminal - Service Station
Inc Source: Storage Unit - Underground Storage Tank
Material Disposal Info: none
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal1.DEP&Password=DEPPortal1

Change:

Description: Report Status change from DQA to FR
Date Change: 11/06/2003
Changed By: EITGALLA

Description: Report Created with Report Status = DR
Date Change: 12/17/2002
Changed By: EIGWALL

Description: Report Status change from DR to DRV
Date Change: 12/17/2002
Changed By: EIGWALL

Description: Report Status change from DRV to DQA
Date Change: 12/19/2002
Changed By: EIPBLANC

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: THOMAS AUGER
Title: Not reported
Company: Not reported
Address: 319 RIDGE RD
City,State: WALES,ME
Country: USA
Zipcode: 04280
Phone/Ext: /
Comments: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICKERSONS EXXON (Continued)

U003765937

Primary Employee:

Primary Employee: True
Name: GLEN WALL

File:

Spill Id: A-576-2002
Date Created: 12/09/2003
Created By: EIPLAMBE
Date Modified: 07/28/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 28-JUL-09.
Reconcile Date: 12/09/2003
File Reconciled By: Not reported

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 576
Spill Year: 2002
Create Date: 09/26/2002
Created By: EIMBARTO
Modify Date: 09/26/2002
Modify By: EIMBARTO
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 09/20/2002
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: GLEN WALL
Location: Nickerson Garage on Route 3
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: USTs removed, some soil contamination

Material Recovered:

Material Recovered Type: NO
Material Recovered: None
Material Amount: 0
Material Units: gals.
Material Amt Qualifier: ACTUAL

Recovery Method: None

Spill Point:

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: 5

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICKERSONS EXXON (Continued)

U003765937

Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

Attachments:

Description: Cleanup DTREE
Attach Type: Electronic Form
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 12/17/2002

Description: DEP Hydrocarbon Decision Tree
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 12/17/2002

Description: Underground Storage Tank Removal Site Assessment
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 12/17/2002

UST:

Name: NICKERSONS EXXON
Address: 25 BELMONT AVE
City: BELFAST
Facility ID: 2053
Facility Location2: BELFAST
Facility Code: RETAIL OIL
Fed Reg Ind: Yes
Owner Name: BLACKSTONE PROPERTIES
Owner Contact: Not reported
Owner Delivery Address: 319 RIDGE RD
Owner City/State/Zip: WALES, ME 04280
Owner Telephone: 2079335443
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: NICKERSON, HARLAND
Owner/Operator Address: 25 BELMONT AVE
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073383264

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICKERSONS EXXON (Continued)

U003765937

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 20-SEP-02
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-SEP-84
Product Type: UNLEADED GASOLINE
Tank Volume in Gallons: 6000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL WITH CATHODIC PROTECTION.
Reg Date: 07-JUL-86
Tank Leak Detection Label: SIA STATISTICAL INVENTORY ANALYSIS
Chamber ID: 1
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Pipe Status: REMOVED
Pipe Status Date: 20-SEP-02
Pipe Date Installed: 04/20/1994
Pipe Material Label: FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label: REMOVED
Pipe Leak Detection: CONFORMING_SUCTION_SYSTEM
Pipe Leak Detection Label: CONFORMING SUCTION SYSTEM
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 2
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 20-SEP-02
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-SEP-84
Product Type: UNLEADED GASOLINE
Tank Volume in Gallons: 4000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL WITH CATHODIC PROTECTION.
Reg Date: 07-JUL-86
Tank Leak Detection Label: SIA STATISTICAL INVENTORY ANALYSIS
Chamber ID: 1
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Pipe Status: REMOVED
Pipe Status Date: 20-SEP-02
Pipe Date Installed: 04/20/1994
Pipe Material Label: FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label: REMOVED
Pipe Leak Detection: CONFORMING_SUCTION_SYSTEM
Pipe Leak Detection Label: CONFORMING SUCTION SYSTEM
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 3
Tank Status: REMOVED
Tank Status Label: REMOVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICKERSONS EXXON (Continued)

U003765937

Tank Status Date: 20-SEP-02
Tank Sub Status: **Not reported**
Tank Sub Status Label: Not reported
Installation Date: 01-SEP-84
Product Type: PREMIUM UNLEADED
Tank Volume in Gallons: 4000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL WITH CATHODIC PROTECTION.
Reg Date: 07-JUL-86
Tank Leak Detection Label: SIA STATISTICAL INVENTORY ANALYSIS
Chamber ID: 1
Chamber Pump Type Label: SUCTION
Chamber Pump Type Desc: SUCTION
Pipe Status: **REMOVED**
Pipe Status Date: 20-SEP-02
Pipe Date Installed: 04/20/1994
Pipe Material Label: FLEXIBLE DOUBLE-WALLED PIPING
Pipe Status Label: REMOVED
Pipe Leak Detection: CONFORMING_SUCTION_SYSTEM
Pipe Leak Detection Label: CONFORMING SUCTION SYSTEM
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

J51
NE
1/4-1/2
0.335 mi.
1771 ft.

KNIGHT KATHLEEN
67 WALDO AVE
BELFAST, ME
Site 2 of 2 in cluster J

ME LUST **S104878051**
N/A

Relative:
Lower

LUST:

Actual:
117 ft.

Event:
Name: KNIGHT KATHLEEN
Address: 67 WALDO AVE
City,State,Zip: BELFAST, ME
Spill Number: A-535-1994
Spill Cause: Overfill
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: 11/10/1994
Actual Spill Date Unknown: False
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Subject/Spiller
Detection Method: Tank and/or Piping Removal
Inc Location: Residential - Single Family
Inc Source: Not reported
Material Disposal Info: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KNIGHT KATHLEEN (Continued)

S104878051

Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: KATHLEEN KNIGHT
Title: Not reported
Company: Not reported
Address: 67 WALDO AVE
City,State: BELFAST,ME
Country: Not reported
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: WILLIAM WALLACE

File:

Spill Id: A-535-1994
Date Created: 02/12/1997
Created By: SPILLS
Date Modified: 12/04/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 04-DEC-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 535
Spill Year: 1994
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: 11/10/1994
Spill Time Unk: True
Spill Dt Unknown: False
Log Rep Dt Tm: 11/10/1994
Log Rep Prod Cd: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KNIGHT KATHLEEN (Continued)

S104878051

Log Rep Prod: #2 FUEL OIL
Log Emp Name: WILLIAM WALLACE
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: Not reported
Material Recovered: Not reported
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: Not reported

Recovery Method: Not reported

Spill Point:

Product:
Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: 10
Product Amt Unit: gals.
Product Amt Qualifier: ACTUAL
Primary Product: False

**K52
NNE
1/4-1/2
0.348 mi.
1835 ft.**

**MSAD 34 (BELFAST HIGH SCHOOL)
P.O. BOX 363
BELFAST, ME**

**ME LUST S106792225
N/A**

Site 1 of 2 in cluster K

**Relative:
Lower**

LUST:

**Actual:
115 ft.**

Event:

Name: MSAD 34 (BELFAST HIGH SCHOOL)
Address: P.O. BOX 363
City,State,Zip: BELFAST, ME
Spill Number: A-74-1993
Spill Cause: Overfill
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Citizen Complaint

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MSAD 34 (BELFAST HIGH SCHOOL) (Continued)

S106792225

Detection Method: Visual Product
Inc Location: Government, Municipal or Religious Facility
Inc Source: Not reported
Material Disposal Info: landspread onsite
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: MSAD 34 (BELFAST HIGH SCHOOL)
Address: P.O. BOX 363
City,State: BELFAST,ME
Country: Not reported
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: JON ANDREWS

File:

Spill Id: A-74-1993
Date Created: 10/30/2008
Created By: IMAGING
Date Modified: 10/30/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 30-OCT-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Medium: Inland Surface Water

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 74
Spill Year: 1993
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MSAD 34 (BELFAST HIGH SCHOOL) (Continued)

S106792225

Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 02/02/1993
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: JON ANDREWS
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: gals.
Material Amt Qualifier: UNKNOWN

Recovery Method: Excavation

Spill Point:

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: False

Event:

Name: MSAD 34 (BELFAST HIGH SCHOOL)
Address: P.O. BOX 363
City,State,Zip: BELFAST, ME
Spill Number: A-74-1993
Spill Cause: Overfill
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: False
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Citizen Complaint

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MSAD 34 (BELFAST HIGH SCHOOL) (Continued)

S106792225

Detection Method: Visual Product
Inc Location: Government, Municipal or Religious Facility
Inc Source: Not reported
Material Disposal Info: landspread onsite
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: MSAD 34 (BELFAST HIGH SCHOOL)
Address: P.O. BOX 363
City,State: BELFAST,ME
Country: Not reported
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: JON ANDREWS

File:

Spill Id: A-74-1993
Date Created: 10/30/2008
Created By: IMAGING
Date Modified: 10/30/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 30-OCT-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Medium: Inland Surface Water

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 74
Spill Year: 1993
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MSAD 34 (BELFAST HIGH SCHOOL) (Continued)

S106792225

Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 02/02/1993
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: JON ANDREWS
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: gals.
Material Amt Qualifier: UNKNOWN

Recovery Method: Excavation

Spill Point:

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: False

K53
NNE
1/4-1/2
0.348 mi.
1840 ft.
Relative:
Lower
Actual:
113 ft.

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
98 WALDO AVE
BELFAST, ME

ME LAST **S108651729**
ME AST **N/A**
ME TIER 2

Site 2 of 2 in cluster K

LAST:

Event:

Name: SAD 34 BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME
Spill Number: A-361-2007
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: False
AST inside flag: False
Create Date: 06/28/2007
Create By: EIEWERLY
Modify Date: 07/23/2009
Modify By: 07/23/2009
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 06/26/2007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: 0
Spill Type: Oil Incident
Reporter Type Code: 2
Reporter Type: Subject/Spiller
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: LC
Inc Location: Government - Local
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 09
Spill Cause: Overfill
Material Disposal Info: Disposal by spiller
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 06/28/2007
Changed By: EIEWERLY

Description: Report Status change from DR to DQA
Date Change: 09/04/2008
Changed By: EIPBLANC

Description: Report Status change from DQA to FR
Date Change: 07/23/2009
Changed By: EIJLYONS

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: COMMUNITY FUELS
Address: 227 NORTH SEARSPORT ROAD
City,State: SWANVILLE,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Contact Type: Other Contact
Potential RP: False
Name: BERNIE
Title: MECHANIC
Company: SAD 34 BUS GARAGE
Address: 98 WALDO WAY (RT7) PO BOX 363
City,State: BELFAST,ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: PETER J BLANCHARD

File:
Spill Id: A-361-2007
Date Created: 07/27/2009
Created By: IMAGING
Date Modified: 07/27/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 27-JUL-09.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:
Medium: Land

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 361
Spill Year: 2007
Create Date: 06/28/2007
Created By: EIEWERLY
Modify Date: 06/28/2007
Modify By: EIEWERLY
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 06/26/2007
Log Rep Prod Cd: 29
Log Rep Prod: DIESEL
Log Emp Name: PETER J BLANCHARD
Location: Waldo Ave., Municipal Bus Garage
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: Delivery overfill 3-5 gallons to concrete.

Material Recovered:
Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 30
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Material Recovered Type: CS
Material Recovered: Contaminated Soil
Material Amount: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Material Units: cu. yds.
Material Amt Qualifier: ESTIMATE

Spill Point:
Recovery Method: Sorbents

Recovery Method: Excavation

Product:
Product Code: DIESEL
Product Other: Not reported
Product Amt: 3
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

AST:
Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME 04915
Facility ID: FATR20147TGU6M01VDS5
Facility Status: Not reported
Facility Phone: Not reported
Facility Dept: Not reported
Record Id: Not reported
CAS Number: 68476-30-2
Submitted By: Jake Gurney
Max Container is Holding: 68300
Max Amount Container: 68300
Location: next to garage
Mail Address: PO Box 363
Mail City: Belfast
Mail State: ME
Mail Zip: 04915
Lat/Long: 44.508 / -69.1389

Chemical Name: FUEL OIL, [NO. 2]
Amount: 18750
Amount Unit: pounds
Type Code: Above
Pressure Code: Ambie
Temperature Code: Ambie
Max Amount Code: 8
Days On Site: 365
CIEHS Chemical: No
Report Year: 2014

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: Gasoline
Amount: 18750
Amount Unit: pounds
Type Code: Above

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Pressure Code: Ambie
Temperature Code: Ambie
Max Amount Code: 06
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2013

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: Diesel Fuel
Amount: 18750
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2012

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: FUEL OIL, [NO. 2]
Amount: 18750
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2012

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: Gasoline
Amount: 18750
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2012

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: FUEL OIL, [NO. 2]

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Amount: 18750
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2011

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: Gasoline
Amount: 18750
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2011

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: Diesel Fuel
Amount: 18750
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2011

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME 04915

Chemical Name: Diesel Fuel
Amount: 18750
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2010

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

City,State,Zip: BELFAST, ME 04915

Chemical Name: Gasoline
Amount: 18750
Amount Unit: pounds
Type Code: Above Ground Tank
Pressure Code: Ambient pressure
Temperature Code: Ambient temperature
Max Amount Code: 4
Days On Site: 365
CIEHS Chemical: Not reported
Report Year: 2010

[Click this hyperlink](#) while viewing on your computer to access
4 additional ME_AST: record(s) in the EDR Site Report.

TIER 2:

Name: RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address: 98 WALDO AVE
City,State,Zip: BELFAST, ME
Facility Mailing Address: PO Box 363
Facility Mailing City: Belfast
Facility Mailing State: ME
Facility Mailing Zip: 04915
Facility Mailing Country: USA
Report Year: 2011
Submitted By: Mitch Brown
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported
Facility Router Record ID: Not reported
Chemical Inventory Record ID: Not reported
Chemical Same As Last Year: T
Chronic: Not reported
CICAS: Not reported
CI EHS Chemical: Not reported
CI Last Modified: Not reported
MSDS Number For Chemical: Not reported
CI Notes: Not reported
Days On Site: Not reported
Entered Chemical Name: Not reported
Fire: Not reported
Gas: Not reported
Liquid: Not reported
Maximum Amount: Not reported
Maximum Amount Code: Not reported
Maximum Amount Container: Not reported
Mixture: Not reported
Pressure: Not reported
Pure: Not reported
Reactive: Not reported
Solid: Not reported
Date Signed: 5/30/2012
Date TierII Received: Not reported
Facility Dept: Not reported
Facility ID: FATR20117TGU6M01VDS5
Failed Validation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Facility Date Modified:	11/02/2012
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	BELFAST AREA HIGH SCHOOL
Address:	98 WALDO AVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	P O BOX 363
Facility Mailing City:	BELFAST
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2006
Submitted By:	MITCH BROWN
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	4/18/2007
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20065292WF014RA8
Failed Validation:	Not reported
Facility Date Modified:	5/29/2007
Facility Mail Address:	Not reported
Mail City:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	RSU 20 BELFAST AREA H.S. / BUS GARAGE
Address:	98 WALDO AVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	PO BOX 363
Facility Mailing City:	BELFAST
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2009
Submitted By:	MITCH BROWN
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	6/7/2010
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20096KBKXS019A0H
Failed Validation:	Not reported
Facility Date Modified:	6/8/2010
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	This facility passed all validation checks.
Latitude:	Not reported
Longitude:	Not reported
Name:	RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address:	98 WALDO AVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	PO Box 363
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2013
Submitted By:	Mitch Brown
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	4/2/2014
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20137TGU6M01VDS5
Failed Validation:	Not reported
Facility Date Modified:	08/26/2014
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Validation Report:	Not reported
Latitude:	44.43048
Longitude:	-69.01685
Name:	RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address:	98 WALDO AVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	PO Box 363
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2014
Submitted By:	Jake Gurney
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/13/2015
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20147TGU6M01VDS5
Failed Validation:	Not reported
Facility Date Modified:	11/10/2015
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.50800
Longitude:	-69.13890

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Name:	RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address:	98 WALDO AVE
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	PO Box 363
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2012
Submitted By:	Mitch Brown
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	1/15/2013
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20127TGU6M01VDS5
Failed Validation:	Not reported
Facility Date Modified:	08/14/2013
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE
Address:	98 WALDO AVE
City,State,Zip:	BELFAST, ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BELFAST AREA HIGH SCHOOL/ BUS GARAGE (Continued)

S108651729

Facility Mailing Address:	PO Box 363
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2010
Submitted By:	Mitch Brown
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/30/2011
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20107TGU6M01VDS5
Failed Validation:	Not reported
Facility Date Modified:	09/12/2011
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

54
East
1/4-1/2
0.355 mi.
1872 ft.

THE AMBASSADOR
6 CONGRESS STREET
BELFAST, ME

ME LAST S117323329
N/A

Relative:
Lower

LAST:

Actual:
183 ft.

Event:

Name: THE AMBASSADOR
Address: 6 CONGRESS STREET
City,State,Zip: BELFAST, ME
Spill Number: A-479-2013
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: True
AST inside flag: True
Create Date: 08/23/2013
Create By: EIJFISH
Modify Date: 09/17/2014
Modify By: 09/17/2014
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 08/05/2013
Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 6
Reporter Type: Contractor/Consultant
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: MF
Inc Location: Residential - Multi Family
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 09
Spill Cause: Overfill
Material Disposal Info: Not reported
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Status change from DRV to FR
Date Change: 09/17/2014
Changed By: EIJWOODA

Description: Report Status change from DR to DRV
Date Change: 08/26/2013
Changed By: EIJFISH

Description: Report Created with Report Status = DR
Date Change: 08/23/2013

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

THE AMBASSADOR (Continued)

S117323329

Changed By: EIJFISH

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: THE AMBASSADOR
Address: 6 CONGRESS STREET
City,State: BELFAST,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: JASON A FISH

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 479
Spill Year: 2013
Create Date: 08/23/2013
Created By: EIJFISH
Modify Date: 08/23/2013
Modify By: EIJFISH
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 08/05/2013
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: JASON A FISH
Location: 6 Congress Street
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: 3-4 gallons lost from overfill.

Material Recovered:

Material Recovered Type: CS
Material Recovered: Contaminated Soil
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: UNKNOWN

Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: Not reported
Material Units: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

Site

Database(s)

THE AMBASSADOR (Continued)

S117323329

Material Amt Qualifier: UNKNOWN

Spill Point:

Recovery Method: Excavation

Recovery Method: Sorbents

Product:

Product Code: #2 FUEL OIL

Product Other: Not reported

Product Amt: 4

Product Amt Unit: gals.

Product Amt Qualifier: ESTIMATE

Primary Product: True

I55
WSW
1/4-1/2
0.363 mi.
1917 ft.

29 BELMONT AVE. (FORMER EXXON STATION)
29 BELMONT AVENUE
BELFAST, ME 4915

Site 3 of 4 in cluster I

US BROWNFIELDS
FINDS **1016456425**
N/A

Relative:
Higher

Actual:
200 ft.

US BROWNFIELDS:

Name:

29 BELMONT AVE. (FORMER EXXON STATION)

Address:

29 BELMONT AVENUE

City,State,Zip:

BELFAST, ME 4915

Recipient Name:

Maine Department of Economic and Community Development

Grant Type:

BCRLF

Property Number:

Tax Map 5, Lot 16B

Parcel size:

0.76

Latitude:

44.4231432

Longitude:

-69.0260428

HCM Label:

Address Matching-House Number

Map Scale:

-

Point of Reference:

Entrance Point of a Facility or Station

Highlights:

Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Property likely to be redeveloped as commercial retail in 2014.
Datum: North American Datum of 1983
Acres Property ID: 156921
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 96135501
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: Belfast Soup Kitchen
Did Owner Change: Y
Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: Y
IC Category Proprietary Controls: Y
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N
State/tribal program date: 8/7/2013
State/tribal program ID: REM02201
State/tribal NFA date: -
Air cleaned: -
Asbestos found: -
Asbestos cleaned: -
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: -
Lead contaminant found: -
Lead cleaned up: -
No media affected: Y
Unknown media affected: -
Other cleaned up: -
Other metals found: Y
Other metals cleaned: -
Other contaminants found: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.76
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.76
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Property Description: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43
Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

Name: 29 BELMONT AVE. (FORMER EXXON STATION)
Address: 29 BELMONT AVENUE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast, City of
Grant Type: Assessment
Property Number: Tax Map 5, Lot 16B
Parcel size: 0.76
Latitude: 44.4231432
Longitude: -69.0260428
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Datum: North American Datum of 1983
Acres Property ID: 156921
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: 1490
Assessment Funding Source: EPA
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: Supplemental Assessment
Accomplishment Count: N
Cooperative Agreement Number: 96151001
Start Date: 3/21/2012
Ownership Entity: Private
Completion Date: 5/15/2012
Current Owner: Belfast Soup Kitchen
Did Owner Change: Y
Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: Y
IC Category Proprietary Controls: Y
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N
State/tribal program date: 8/7/2013
State/tribal program ID: REM02201
State/tribal NFA date: -
Air cleaned: -
Asbestos found: -
Asbestos cleaned: -
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.76
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.76
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transfered in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43
Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

Name: 29 BELMONT AVE. (FORMER EXXON STATION)
Address: 29 BELMONT AVENUE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Tax Map 5, Lot 16B
Parcel size: 0.76
Latitude: 44.4231432
Longitude: -69.0260428
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014. North American Datum of 1983

Datum:
Acres Property ID: 156921
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 00A00529
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: Belfast Soup Kitchen
Did Owner Change: Y
Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: Y
IC Category Proprietary Controls: Y
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

State/tribal program date:	8/7/2013
State/tribal program ID:	REM02201
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.76
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.76
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43
Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

Name: 29 BELMONT AVE. (FORMER EXXON STATION)
Address: 29 BELMONT AVENUE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Grant Type:	Assessment
Property Number:	Tax Map 5, Lot 16B
Parcel size:	0.76
Latitude:	44.4231432
Longitude:	-69.0260428
HCM Label:	Address Matching-House Number
Map Scale:	-
Point of Reference:	Entrance Point of a Facility or Station
Highlights:	Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.
Datum:	North American Datum of 1983
Acres Property ID:	156921
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	11494.93
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Cleanup Planning
Accomplishment Count:	N
Cooperative Agreement Number:	00A00529
Start Date:	2/10/2020
Ownership Entity:	Private
Completion Date:	1/29/2021
Current Owner:	Belfast Soup Kitchen
Did Owner Change:	Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	8/7/2013
State/tribal program ID:	REM02201
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.76
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.76
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

Name: 29 BELMONT AVE. (FORMER EXXON STATION)
Address: 29 BELMONT AVENUE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Tax Map 5, Lot 16B
Parcel size: 0.76
Latitude: 44.4231432
Longitude: -69.0260428
HCM Label: Address Matching-House Number
Map Scale: -

Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Datum: North American Datum of 1983
Acres Property ID: 156921
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	00A00529
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Belfast Soup Kitchen
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	8/7/2013
State/tribal program ID:	REM02201
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Past use residential acreage: -
Surface Water: -
Past use commercial acreage: 0.76
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: 0.76
Future use industrial acreage: -
Superfund Fed. landowner flag: Y
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43
Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

Name: 29 BELMONT AVE. (FORMER EXXON STATION)
Address: 29 BELMONT AVENUE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Tax Map 5, Lot 16B
Parcel size: 0.76
Latitude: 44.4231432
Longitude: -69.0260428
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Datum: North American Datum of 1983
Acres Property ID: 156921
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	00A00529
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	Belfast Soup Kitchen
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	8/7/2013
State/tribal program ID:	REM02201
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Sediments found: -
Sediments cleaned: -
Soil affected: Y
Soil cleaned up: -
Surface water cleaned: -
VOCs found: Y
VOCs cleaned: -
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: 0.76
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: 0.76
Future use industrial acreage: -
Superfund Fed. landowner flag: Y
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43
Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

Name: 29 BELMONT AVE. (FORMER EXXON STATION)
Address: 29 BELMONT AVENUE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Tax Map 5, Lot 16B
Parcel size: 0.76
Latitude: 44.4231432
Longitude: -69.0260428
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Datum: North American Datum of 1983
Acres Property ID: 156921
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 00A00529
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: Belfast Soup Kitchen
Did Owner Change: Y
Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: Y
IC Category Proprietary Controls: Y
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N
State/tribal program date: 8/7/2013
State/tribal program ID: REM02201
State/tribal NFA date: -
Air cleaned: -
Asbestos found: -
Asbestos cleaned: -
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: -
Lead contaminant found: -
Lead cleaned up: -
No media affected: Y
Unknown media affected: -
Other cleaned up: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.76
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.76
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Indoor air media cleaned up:
Unknown media cleaned up:
Past Use: Multistory
Property Description:

-
-
-

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Median Income: 796
Median Income Number: 43
Median Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

Name: 29 BELMONT AVE. (FORMER EXXON STATION)
Address: 29 BELMONT AVENUE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Tax Map 5, Lot 16B
Parcel size: 0.76
Latitude: 44.4231432
Longitude: -69.0260428
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Datum: North American Datum of 1983
Acres Property ID: 156921

IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 00A00529
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: Belfast Soup Kitchen
Did Owner Change: Y
Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: Y
IC Category Proprietary Controls: Y
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N
State/tribal program date: 8/7/2013
State/tribal program ID: REM02201
State/tribal NFA date: -
Air cleaned: -
Asbestos found: -
Asbestos cleaned: -
Controlled substance found: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contaminants found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.76
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.76
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43
Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

Name: 29 BELMONT AVE. (FORMER EXXON STATION)
Address: 29 BELMONT AVENUE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast, City of
Grant Type: Assessment
Property Number: Tax Map 5, Lot 16B
Parcel size: 0.76
Latitude: 44.4231432
Longitude: -69.0260428
HCM Label: Address Matching-House Number
Map Scale: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Point of Reference:	Entrance Point of a Facility or Station
Highlights:	Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.
Datum:	North American Datum of 1983
Acres Property ID:	156921
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	3499
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	Y
Cooperative Agreement Number:	96151001
Start Date:	3/21/2012
Ownership Entity:	Private
Completion Date:	5/15/2012
Current Owner:	Belfast Soup Kitchen
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	8/7/2013
State/tribal program ID:	REM02201
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.76
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.76
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43
Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

Name: 29 BELMONT AVE. (FORMER EXXON STATION)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Address:	29 BELMONT AVENUE
City,State,Zip:	BELFAST, ME 4915
Recipient Name:	Belfast City of
Grant Type:	Assessment
Property Number:	Tax Map 5, Lot 16B
Parcel size:	0.76
Latitude:	44.4231432
Longitude:	-69.0260428
HCM Label:	Address Matching-House Number
Map Scale:	-
Point of Reference:	Entrance Point of a Facility or Station
Highlights:	Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.
Datum:	North American Datum of 1983
Acres Property ID:	156921
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	2533
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	00A00209
Start Date:	10/17/2016
Ownership Entity:	Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Completion Date:	11/30/2016
Current Owner:	Belfast Soup Kitchen
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	8/7/2013
State/tribal program ID:	REM02201
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contaminants found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.76
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	0.76

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Future use industrial acreage: -
Superfund Fed. landowner flag: Y
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transfered in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number:

30

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43
Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

[Click this hyperlink](#) while viewing on your computer to access
8 additional US BROWNFIELDS: record(s) in the EDR Site Report.

Name: 29 BELMONT AVE. (FORMER EXXON STATION)
Address: 29 BELMONT AVENUE
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast, City of
Grant Type: Assessment
Property Number: Tax Map 5, Lot 16B
Parcel size: 0.76
Latitude: 44.4231432
Longitude: -69.0260428
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Datum: North American Datum of 1983
Acres Property ID: 156921
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: 3520

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	96151001
Start Date:	8/12/2013
Ownership Entity:	Private
Completion Date:	10/11/2013
Current Owner:	Belfast Soup Kitchen
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	Y
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	8/7/2013
State/tribal program ID:	REM02201
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

Surface water cleaned: -
VOCs found: Y
VOCs cleaned: -
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: 0.76
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: 0.76
Future use industrial acreage: -
Superfund Fed. landowner flag: Y
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: -
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of approximately 0.76 acres, located along the northern side of Belmont Avenue (Route 3). The Site is located in a primarily highway-commercial area of Belfast and is currently vacant. The Site is bounded to the east by a small unnamed stream. The Site was originally developed in 1956 as a gasoline filling station and automobile repair facility. The filling station and auto repair facility operated until the Site was vacated in 1998. The former Site building was located on the northwestern portion of the Site, and included two vehicle bays used for automobile repair. The Site was originally developed with one 2,000-gallon, one 3,000-gallon, and one 4,000-gallon underground storage tank (UST) installed in 1956, which

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

29 BELMONT AVE. (FORMER EXXON STATION) (Continued)

1016456425

were used for the storage of gasoline. The original USTs were replaced in 1984 with three USTs, which were also used for the storage of gasoline. Reportedly, the Site was never used to store or dispense diesel fuel. Waste oil generated during automotive repair activities was reportedly stored in an above ground storage tank (AST). The former filling station ceased operation in 1998, the gasoline USTs were removed in 2002, and the former building was demolished in 2003. MEDEP Spill Numbers A-232-1998 and A-576-2002 were also identified in connection with the Site. Following the assessment work, property ownership was transferred in October 2013 from Eighty One Eutaw, LLC to Kevin Cross of South Portland, Maine. Property likely to be redeveloped as commercial retail in 2014.

Below Poverty Number: 30
Below Poverty Percent: 31.25
Meidan Income: 796
Meidan Income Number: 43
Meidan Income Percent: 44.79
Vacant Housing Number: 5
Vacant Housing Percent: 10.34
Unemployed Number: 6
Unemployed Percent: 6.25

[Click this hyperlink](#) while viewing on your computer to access 8 additional US BROWNFIELDS: record(s) in the EDR Site Report.

FINDS:

Registry ID: 110057202664

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES) is an federal online database for Brownfields Grantees to electronically submit data directly to EPA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

I56
WSW
1/4-1/2
0.363 mi.
1917 ft.

EXXON STATION (29 BELMONT AVE)
29 BELMONT AVE
BELFAST, ME

ME VCP **S113405023**
ME BROWNFIELDS **N/A**
ME ALLSITES

Site 4 of 4 in cluster I

Relative:
Higher
Actual:
200 ft.

VCP:
Name: EXXON STATION (29 BELMONT AVE)
Address: 29 BELMONT AVE
City,State,Zip: BELFAST, ME
Facility ID: REM02201
Facility status: REMEDIATION STAGE
Program Type: VRAP
Lat/Long: 44.42321 / -69.02766
Institutional Control?: FALSE
Alias: 29 BELMONT AVE
Acres: 1
Sub Status: NEED (AWAITING RESOURCES)
Status Date: 10/29/2013

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EXXON STATION (29 BELMONT AVE) (Continued)

S113405023

BROWNFIELDS:

Name: EXXON STATION (29 BELMONT AVE)
Address: 29 BELMONT AVE
City,State,Zip: BELFAST, ME
Facility ID: REM02201
Facility Status: REMEDIATION STAGE
Program Type: BROWNFIELDS-104K
Lat/Long: 44.42321 / -69.02766
Institutional Control?: FALSE
Alias: 29 BELMONT AVE
Acres: 1
Sub Status: NEED (AWAITING RESOURCES)
Status Date: 10/29/2013

ALLSITES:

Name: EXXON STATION (29 BELMONT AVE)
Address: 29 BELMONT AVE
City,State,Zip: BELFAST, ME
Status: REMEDIATION STAGE
Program Type: BROWNFIELDS-104K
Lat/Long: 44.42321 / -69.02766
Institutional Control?: FALSE
Alias: 29 BELMONT AVE
Acres: 1
Sub Status: NEED (AWAITING RESOURCES)
Status Date: 10/29/2013

Name: EXXON STATION (29 BELMONT AVE)
Address: 29 BELMONT AVE
City,State,Zip: BELFAST, ME
Status: REMEDIATION STAGE
Program Type: VRAP
Lat/Long: 44.42321 / -69.02766
Institutional Control?: FALSE
Alias: 29 BELMONT AVE
Acres: 1
Sub Status: NEED (AWAITING RESOURCES)
Status Date: 10/29/2013

L57
WSW
1/4-1/2
0.385 mi.
2032 ft.

MARITIME ENERGY
BELMONT AVENUE STORE
BELFAST, ME
Site 1 of 2 in cluster L

ME LUST **S106788085**
N/A

Relative:
Higher

LUST:

Actual:
202 ft.

Event:

Name: MARITIME ENERGY
Address: BELMONT AVENUE STORE
City,State,Zip: BELFAST, ME
Spill Number: A-58-1993
Spill Cause: Corrosion - Tank
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME ENERGY (Continued)

S106788085

MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: Not reported
Number Wells Impacted: Not reported
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Subject/Spiller
Detection Method: Tank and/or Piping Removal
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: Sawyers
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal1.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: MARITIME ENERGY
Address: P. O. BOX 485
City,State: ROCKLAND,ME
Country: Not reported
Zipcode: 04841
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: FRANCIS GEHRLING

File:

Spill Id: A-58-1993
Date Created: 10/30/2008
Created By: IMAGING
Date Modified: 10/30/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 30-OCT-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME ENERGY (Continued)

S106788085

Medium: Groundwater

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 58
Spill Year: 1993
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 01/29/1993
Log Rep Prod Cd: 86
Log Rep Prod: HYDRAULIC OIL
Log Emp Name: FRANCIS GEHRLING
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: gals.
Material Amt Qualifier: UNKNOWN

Recovery Method: Excavation

Spill Point:

Product:

Product Code: HYDRAULIC OIL
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: False

L58
WSW
1/4-1/2
0.398 mi.
2101 ft.

MARITIME FARMS
32 BELMONT AVENUE
BELFAST, ME

Site 2 of 2 in cluster L

Relative:
Higher

LUST:

Actual:
204 ft.

Event:

Name: MARITIME FARMS
Address: 32 BELMONT AVENUE
City,State,Zip: BELFAST, ME
Spill Number: A-11-1994

ME LUST **S104217279**
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S104217279

Spill Cause: Corrosion - Tank
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: Not reported
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: UST Tank Anomaly
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: Soil still on site as of 7/28/94
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: MARITIME ENERGY
Address: 244 PARK STREET
City,State: ROCKLAND,ME
Country: Not reported
Zipcode: 04841
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: FRANCIS GEHRLING

File:

Spill Id: A-11-1994
Date Created: 11/19/2008
Created By: IMAGING
Date Modified: 11/19/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 19-NOV-08.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S104217279

Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:
Medium: Land

Medium: Groundwater

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 11
Spill Year: 1994
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 01/16/1994
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: FRANCIS GEHRLING
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 50
Material Units: gals.
Material Amt Qualifier: ACTUAL

Recovery Method: Pumps

Recovery Method: Excavation

Spill Point:
Date Reported: 1/16/1994
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.423798
Longitude: -69.018819

Product:
Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: 200
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S104217279

Primary Product: False

Event:

Name: MARITIME FARMS
Address: 32 BELMONT AVENUE
City,State,Zip: BELFAST, ME
Spill Number: A-11-1994
Spill Cause: Corrosion - Tank
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: Not reported
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: UST Tank Anomaly
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: Soil still on site as of 7/28/94
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: MARITIME ENERGY
Address: 244 PARK STREET
City,State: ROCKLAND,ME
Country: Not reported
Zipcode: 04841
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: FRANCIS GEHRLING

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S104217279

File:

Spill Id: A-11-1994
Date Created: 11/19/2008
Created By: IMAGING
Date Modified: 11/19/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 19-NOV-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Medium: Groundwater

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 11
Spill Year: 1994
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 01/16/1994
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: FRANCIS GEHRLING
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 50
Material Units: gals.
Material Amt Qualifier: ACTUAL

Recovery Method: Pumps

Recovery Method: Excavation

Spill Point:

Date Reported: 1/16/1994
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.423798

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S104217279

Longitude: -69.018819

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: 200
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: False

Event:

Name: MARITIME FARMS
Address: 32 BELMONT AVENUE
City,State,Zip: BELFAST, ME
Spill Number: A-11-1994
Spill Cause: Corrosion - Tank
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: Not reported
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: UST Tank Anomaly
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: Soil still on site as of 7/28/94
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: MARITIME ENERGY
Address: 244 PARK STREET
City,State: ROCKLAND,ME
Country: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S104217279

Zipcode: 04841
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: FRANCIS GEHRLING

File:
Spill Id: A-11-1994
Date Created: 11/19/2008
Created By: IMAGING
Date Modified: 11/19/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 19-NOV-08.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:
Medium: Land

Medium: Groundwater

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 11
Spill Year: 1994
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 01/16/1994
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: FRANCIS GEHRLING
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 50
Material Units: gals.
Material Amt Qualifier: ACTUAL

Recovery Method: Pumps

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARITIME FARMS (Continued)

S104217279

Recovery Method: Excavation

Spill Point:

Date Reported: 1/16/1994
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.423798
Longitude: -69.018819

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: 200
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: False

59
SE
1/4-1/2
0.403 mi.
2128 ft.

**DANWELL RESIDENCE
133 MILLER STREET
BELFAST, ME**

**ME LAST S117733922
N/A**

Relative:
Higher

LAST:

Actual:
207 ft.

Event:

Name: DANWELL RESIDENCE
Address: 133 MILLER STREET
City,State,Zip: BELFAST, ME
Spill Number: A-230-2013
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: True
AST inside flag: True
Create Date: 04/30/2013
Create By: EIRWILLI
Modify Date: 03/26/2015
Modify By: 03/26/2015
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 04/30/2013
Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: 0
Spill Type: Oil Incident
Reporter Type Code: 6
Reporter Type: Contractor/Consultant
Detection Method Code: L
Detection Method: Visual Product

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANWELL RESIDENCE (Continued)

S117733922

Inc Location Code: SF
Inc Location: Residential - Single Family
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 01
Spill Cause: Corrosion - Tank
Material Disposal Info: Maine Department of Environmental Protection warehouse for consolidation and later disposal.
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Status change from DQA to FR
Date Change: 03/26/2015
Changed By: EIRKROUT

Description: Report Status change from DRV to DQA
Date Change: 03/25/2015
Changed By: EIJWOODA

Description: Report Created with Report Status = DR
Date Change: 04/30/2013
Changed By: EIRWILLI

Description: Report Status change from DR to DRV
Date Change: 07/18/2013
Changed By: EIRWILLI

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: BLAND DANWELL
Title: OWNER
Company: Not reported
Address: 133 MILLER STREET
City,State: BELFAST,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: ROBERT J WILLIAMS

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 230
Spill Year: 2013
Create Date: 04/30/2013
Created By: EIRWILLI

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANWELL RESIDENCE (Continued)

S117733922

Modify Date: 04/30/2013
Modify By: EIRWILLI
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 04/30/2013
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: ROBERT J WILLIAMS
Location: 133 Miller St.
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: < 1 gallon to concrete floor from leaking tank.

Material Recovered:
Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 40
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Spill Point:
Recovery Method: Sorbents

Product:
Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: 32
Product Amt Unit: oz.
Product Amt Qualifier: ESTIMATE
Primary Product: True

60
ENE
1/4-1/2
0.412 mi.
2173 ft.

CONSOLIDATED COMMUNICATIONS
19 WALDO AVENUE
BELFAST, ME

ME LUST S129062391
N/A

Relative:
Lower

LUST:

Actual:
128 ft.

Event:
Name: CONSOLIDATED COMMUNICATIONS
Address: 19 WALDO AVENUE
City,State,Zip: BELFAST, ME
Spill Number: A-464-2020
Spill Cause: Other - Unknown
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: False
MCD Value: 27010
Create Date: 08/28/2020
Create By: EIJWOODA
Modify Date: 09/21/2022
Modify By: SPILLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONSOLIDATED COMMUNICATIONS (Continued)

S129062391

Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Site Assessment
Inc Location: Business - Commercial
Inc Source: Storage Unit - Underground Storage Tank
Material Disposal Info: No refuse or debris was created as a result of this petroleum release.
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Change:

Description: Report Status change from DR to DRV
Date Change: 02/02/2021
Changed By: EINCAPUT

Description: Report Status change from DRV to DQA
Date Change: 02/18/2021
Changed By: EIJWOODA

Description: Report Created with Report Status = DR
Date Change: 08/28/2020
Changed By: EIJWOODA

Description: Report Status change from DQA to FR
Date Change: 09/21/2022
Changed By: SOM\Jon.L.Woodard

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: CONSOLIDATED COMMUNICATIONS
Address: 5 DAVIS FARM ROAD FLOOR 2
City,State: PORTLAND,ME
Country: USA
Zipcode: 04103
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: NINA M CAPUTO

Media Affected:

Medium: Land

Medium: Groundwater

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONSOLIDATED COMMUNICATIONS (Continued)

S129062391

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 464
Spill Year: 2020
Create Date: 08/28/2020
Created By: EIJWOODA
Modify Date: 02/02/2021
Modify By: EINCAPUT
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 08/26/2020
Log Rep Prod Cd: 29
Log Rep Prod: DIESEL
Log Emp Name: NINA M CAPUTO
Location: 19 Waldo Avenue, Belfast, ME 04915 Consolidated Communications
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Excedences of PRGs, but not RAGs. Nearest well 800 ft away

Material Recovered:

Material Recovered Type: NO
Material Recovered: None
Material Amount: 0
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Recovery Method: None

Spill Point:

Product:

Product Code: DIESEL
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: Not reported
Product Amt Qualifier: UNKNOWN
Primary Product: True

Attachments:

Description: Referral to MATTHEW BURKE
Attach Type: Electronic Form
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 02/02/2021

Description: Table 2 - Groundwater Results
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 02/02/2021

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONSOLIDATED COMMUNICATIONS (Continued)

S129062391

Description: Table 1 - Soil Results
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 02/02/2021

M61
NE
1/4-1/2
0.417 mi.
2203 ft.

WATERFALL ARTS
256 HIGH STREET
BELFAST, ME 4915

Site 1 of 3 in cluster M

US BROWNFIELDS **1023620855**
FINDS **N/A**

Relative:
Lower

Actual:
110 ft.

US BROWNFIELDS:

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154
Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights:

Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Datum: -
Acres Property ID: 229662
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	00A00529
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	The Arts Center of Kingdom Falls
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	12/22/2017
State/tribal program ID:	REM0250
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Surface water cleaned: -
VOCs found: -
VOCs cleaned: -
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: 1.24
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: 1.24
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Median Income: 994
Median Income Number: 322
Median Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154
Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights:

Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Datum: -
Acres Property ID: 229662
IC Data Access: -
Start Date: -
Redev Completion Date: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	21647
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Cleanup Planning
Accomplishment Count:	N
Cooperative Agreement Number:	00A00209
Start Date:	12/1/2017
Ownership Entity:	Private
Completion Date:	-
Current Owner:	The Arts Center of Kingdom Falls
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	12/22/2017
State/tribal program ID:	REM0250
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Petro products cleaned: -
Sediments found: -
Sediments cleaned: -
Soil affected: Y
Soil cleaned up: -
Surface water cleaned: -
VOCs found: -
VOCs cleaned: -
Cleanup other description: -
Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: 1.24
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: 1.24
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994
Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154
Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -

Highlights: Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Datum:	-
Acres Property ID:	229662
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	64919
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	00A00209
Start Date:	3/1/2017
Ownership Entity:	Private
Completion Date:	6/12/2018
Current Owner:	The Arts Center of Kingdom Falls
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	12/22/2017
State/tribal program ID:	REM0250
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site encompasses approximately 1.24 acres of land located in a

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994
Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154
Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights:

Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Datum: -
Acres Property ID: 229662
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: 21486.25
Assessment Funding Source: EPA
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: Cleanup Planning
Accomplishment Count: N
Cooperative Agreement Number: 00A00529
Start Date: 2/10/2020
Ownership Entity: Private
Completion Date: -
Current Owner: The Arts Center of Kingdom Falls
Did Owner Change: N
Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: Y
IC Category Proprietary Controls: -
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N
State/tribal program date: 12/22/2017
State/tribal program ID: REM0250
State/tribal NFA date: -
Air cleaned: -
Asbestos found: Y
Asbestos cleaned: -
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: -
Groundwater cleaned: -
Lead contaminant found: Y
Lead cleaned up: -
No media affected: -
Unknown media affected: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Building material media cleaned up:
Indoor air media cleaned up:
Unknown media cleaned up:
Past Use: Multistory
Property Description:

-
-
-
-
The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994
Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154
Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights:

Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Datum: -
Acres Property ID: 229662
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 00A00529
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: The Arts Center of Kingdom Falls
Did Owner Change: N
Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: Y
IC Category Proprietary Controls: -
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N
State/tribal program date: 12/22/2017
State/tribal program ID: REM0250
State/tribal NFA date: -
Air cleaned: -
Asbestos found: Y
Asbestos cleaned: -
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994
Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154
Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights:

Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Datum: -
Acres Property ID: 229662
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 00A00529
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: The Arts Center of Kingdom Falls
Did Owner Change: N
Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: Y
IC Category Proprietary Controls: -
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: N
State/tribal program date: 12/22/2017
State/tribal program ID: REM0250
State/tribal NFA date: -
Air cleaned: -
Asbestos found: Y
Asbestos cleaned: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994
Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154
Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights: Former Use: The Site encompasses approximately 1.24 acres of land

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Datum:	-
Acres Property ID:	229662
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	4670
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	Y
Cooperative Agreement Number:	00A00209
Start Date:	1/3/2017
Ownership Entity:	Private
Completion Date:	2/27/2017
Current Owner:	The Arts Center of Kingdom Falls
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	12/22/2017

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

State/tribal program ID:	REM0250
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contaminants found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994
Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights: Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Datum: -
Acres Property ID: 229662
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 00A00209
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: The Arts Center of Kingdom Falls
Did Owner Change: N
Cleanup Required: Y
Video Available: -
Photo Available: -
Institutional Controls Required: Y
IC Category Proprietary Controls: -
IC Cat. Info. Devices: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	12/22/2017
State/tribal program ID:	REM0250
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contaminants found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994
Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Recipient Name:	Waterfall Arts
Grant Type:	Cleanup
Property Number:	Map 13, Lot 32
Parcel size:	1.24
Latitude:	44.4295154
Longitude:	-69.0138567
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.
Datum:	-
Acres Property ID:	229662
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	00A00520
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	The Arts Center of Kingdom Falls
Did Owner Change:	N
Cleanup Required:	Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	12/22/2017
State/tribal program ID:	REM0250
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	1.24
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994
Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Unemployed Percent: 1.65

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154
Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights: Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Datum: -
Acres Property ID: 229662
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: -
Grant Type: Hazardous & Petroleum
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 00A00529
Start Date: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Ownership Entity:	Private
Completion Date:	-
Current Owner:	The Arts Center of Kingdom Falls
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	12/22/2017
State/tribal program ID:	REM0250
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	1.24
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Future use commercial acreage: 1.24
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

[Click this hyperlink](#) while viewing on your computer to access
1 additional US BROWNFIELDS: record(s) in the EDR Site Report.

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast City of
Grant Type: Assessment
Property Number: Map 13, Lot 32
Parcel size: 1.24
Latitude: 44.4295154
Longitude: -69.0138567
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights:

Former Use: The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the ?Site building?), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Datum: -
Acres Property ID: 229662
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous & Petroleum
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	00A00529
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	The Arts Center of Kingdom Falls
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	-
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	N
State/tribal program date:	12/22/2017
State/tribal program ID:	REM0250
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: 1.24
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: -
Future use commercial acreage: 1.24
Future use industrial acreage: -
Superfund Fed. landowner flag: -
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: -
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: -
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site encompasses approximately 1.24 acres of land located in a primarily residential area of Belfast. The Site is currently improved with one building (the Site building), which is describes as the Waterfall Arts building. The building is connected to municipal water and sewer services and is currently heated and cooled with an electric heat pump system. The Site building was formerly heated with a coal-fired boiler and a fuel oil-fired boiler. Remaining portions of the Site are improved with asphalt-paved driveways/parking areas, grassed lawns, a playground, and landscaped areas. Based on available information, the Site was improved with a residence dating back to the early 1900s. Sometime around 1912, this residence was converted to the McClellan Public School, which occupied the Site, until it was destroyed by a fire in the early 1930s. A majority of the existing Site building was constructed in 1935 and the southwestern addition was constructed in 1947. The existing Site building was originally

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

1023620855

utilized as the Governor Anderson School (public elementary school), until the school vacated the property in 2004. The City of Belfast acquired the Site in 2004 and sold it to the Arts Center of Kingdom Falls in 2005. The Site and building have been utilized as an arts center (Waterfall Arts), since 2005.

Below Poverty Number: 156
Below Poverty Percent: 19.85
Meidan Income: 994
Meidan Income Number: 322
Meidan Income Percent: 40.97
Vacant Housing Number: 53
Vacant Housing Percent: 11.87
Unemployed Number: 13
Unemployed Percent: 1.65

[Click this hyperlink](#) while viewing on your computer to access
1 additional US BROWNFIELDS: record(s) in the EDR Site Report.

FINDS:

Registry ID: 110070057674

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:

US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES)
is an federal online database for Brownfields Grantees to
electronically submit data directly to EPA.

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

**M62
NE
1/4-1/2
0.417 mi.
2203 ft.**

**WATERFALL ARTS
256 HIGH STREET
BELFAST, ME

Site 2 of 3 in cluster M**

**ME INST CONTROL S121351033
ME VCP N/A
ME BROWNFIELDS
ME ALLSITES**

**Relative:
Lower**

INST CONTROL:
Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME
Facility ID: REM02750
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: BROWNFIELDS-104K
Lat/Long: 44.4295 / -69.01381
Institutional Control?: TRUE
Alias: Not reported
Acres: Not reported
Sub Status: Not reported
Status Date: Not reported

**Actual:
110 ft.**

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME
Facility ID: REM02750
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.4295 / -69.01381
Institutional Control?: TRUE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

S121351033

Alias: Not reported
Acres: Not reported
Sub Status: Not reported
Status Date: Not reported

VCP:

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME
Facility ID: REM02750
Facility status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.4295 / -69.01381
Institutional Control?: TRUE
Alias: Not reported
Acres: 1
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 11/15/2018

BROWNFIELDS:

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME
Facility ID: REM02750
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: BROWNFIELDS-104K
Lat/Long: 44.4295 / -69.01381
Institutional Control?: TRUE
Alias: Not reported
Acres: 1
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 11/15/2018

ALLSITES:

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: BROWNFIELDS-104K
Lat/Long: 44.4295 / -69.01381
Institutional Control?: TRUE
Alias: Not reported
Acres: 1
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 11/15/2018

Name: WATERFALL ARTS
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.4295 / -69.01381
Institutional Control?: TRUE
Alias: Not reported
Acres: 1
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

S121351033

Status Date: 11/15/2018

**M63
NE
1/4-1/2
0.417 mi.
2203 ft.**

**WATERFALL ARTS
256 HIGH ST
BELFAST, ME

Site 3 of 3 in cluster M**

**ME LUST U003053045
ME UST N/A
ME TIER 2**

**Relative:
Lower**

LUST:

**Actual:
110 ft.**

Event:

Name: WATERFALLS ART SCHOOL
Address: 256 HIGH STREET
City,State,Zip: BELFAST, ME
Spill Number: A-410-2017
Spill Cause: Other - No Cause
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 08/09/2017
Create By: EIEWERLY
Modify Date: 04/25/2018
Modify By: EIRKROUT
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: UST Tank Anomaly
Inc Location: School - Public
Inc Source: Storage Unit - Underground Storage Tank
Material Disposal Info: No disposal necessary.
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal1.DEP&Password=DEPPortal1

Change:

Description: Report Status change from DR to DRV
Date Change: 11/14/2017
Changed By: EIFDELAN

Description: Report Status change from DQA to FR
Date Change: 04/25/2018
Changed By: EIRKROUT

Description: Report Created with Report Status = DR
Date Change: 08/09/2017
Changed By: EIEWERLY

Description: Report Status change from DRV to DQA
Date Change: 04/12/2018
Changed By: EIJWOODA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: WATERFALLS ART SCHOOL
Address: 256 HIGH STREET
City,State: BELFAST,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: FRANKI B DELANEY

Media Affected:

Medium: None

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 410
Spill Year: 2017
Create Date: 08/09/2017
Created By: EIEWERLY
Modify Date: 08/09/2017
Modify By: EIEWERLY
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 08/01/2017
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: FRANKI B DELANEY
Location: 256 High Street
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: UST removal

Material Recovered:

Material Recovered Type: NO
Material Recovered: None
Material Amount: 0
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Recovery Method: None

Spill Point:

Product:

Product Code: #2 FUEL OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Product Other: Not reported
Product Amt: 0
Product Amt Unit: gals.
Product Amt Qualifier: ACTUAL
Primary Product: True

Attachments:

Description: Referral to NICHOLAS HODGKINS
Attach Type: Electronic Form
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 04/25/2018

UST:

Name: WATERFALL ARTS
Address: 256 HIGH ST
City: BELFAST
Facility ID: 17448
Facility Location2: BELFAST
Facility Code: TOWN "&" SCHOOL
Fed Reg Ind: No
Owner Name: WATERFALL ARTS
Owner Contact: Not reported
Owner Delivery Address: 256 HIGH ST
Owner City/State/Zip: BELFAST, ME 04915
Owner Telephone: 2073382222
Operator Contact: Not reported
On Aquifer: No
On Aquifer Label: Not reported
Near Public Water: No
Near Public Water Label: Not reported
Near Private Water: No
Near Private Water Label: Not reported
Near Other Water: No
Nearby Water Other Owner Label: Not reported
Latitude: Not reported
Longitude: Not reported
Owner/Operator Name: WATERFALL ARTS
Owner/Operator Address: 256 HIGH ST
Owner/Operator City,St,Zip: BELFAST, ME 04915
Owner/Operator Phone: 2073382222

Tank Number: 1
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-AUG-94
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 3000
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 07-NOV-90

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-AUG-94
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 2
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 01-AUG-94
Tank Sub Status: Not reported
Tank Sub Status Label: Not reported
Installation Date: 01-OCT-69
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 300
Tank Above/Below: BELOWGROUND
Tank Material: STEEL - BARE OR ASPHALT COATED.
Reg Date: 07-NOV-90
Tank Leak Detection Label: UNKNOWN
Chamber ID: 1
Chamber Pump Type Label: UNKNOWN
Chamber Pump Type Desc: UNKNOWN
Pipe Status: REMOVED
Pipe Status Date: 01-AUG-94
Pipe Date Installed: Not reported
Pipe Material Label: GALVANIZED STEEL
Pipe Status Label: REMOVED
Pipe Leak Detection: UNKNOWN
Pipe Leak Detection Label: UNKNOWN
Overfill: UNKNOWN
Overfill Protection Label: UNKNOWN

Tank Number: 3
Tank Status: REMOVED
Tank Status Label: REMOVED
Tank Status Date: 07-NOV-17
Tank Sub Status: SA_NOT_REQUIRED
Tank Sub Status Label: SA NOT REQUIRED
Installation Date: 12-AUG-94
Product Type: #2 FUEL OIL
Tank Volume in Gallons: 3000
Tank Above/Below: BELOWGROUND
Tank Material: JACKETED TANK - DOUBLE-WALLED
Reg Date: 07-NOV-90
Tank Leak Detection Label: SECONDARY CONTAINMENT / CONT ELEC MON
Chamber ID: 1
Chamber Pump Type Label: SUCTION

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Chamber Pump Type Desc:	SUCTION
Pipe Status:	ABANDONED_IN_PLACE
Pipe Status Date:	07-NOV-17
Pipe Date Installed:	08/12/1994
Pipe Material Label:	COPPER WITH SECONDARY CONTAINMENT
Pipe Status Label:	ABANDONED IN PLACE
Pipe Leak Detection:	SEC_CONT_CONTIN_ELEC_MON
Pipe Leak Detection Label:	SECONDARY CONTAINMENT / CONT ELEC MON
Overfill:	VENT_WHISTLE
Overfill Protection Label:	VENT WHISTLE

TIER 2:

Name:	WATERFALL ARTS
Address:	256 HIGH ST
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	256 High St
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2011
Submitted By:	Daniel L Beckman
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	4/30/2012
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2011716J59002GCT
Failed Validation:	Not reported
Facility Date Modified:	11/02/2012
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	WATERFALL ARTS
Address:	256 HIGH ST
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	256 High St
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2009
Submitted By:	Daniel L Beckman
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	2/16/2010
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2009716J59002GCT
Failed Validation:	Not reported
Facility Date Modified:	3/29/2010
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Notes:	Not reported
Validation Report:	This facility passed all validation checks.
Latitude:	Not reported
Longitude:	Not reported
Name:	WATERFALL ARTS
Address:	256 HIGH ST
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	256 High St
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2013
Submitted By:	Michael Fletcher
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	6/9/2014
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2013716J59002GCT
Failed Validation:	Not reported
Facility Date Modified:	08/26/2014
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Latitude:	44.42987
Longitude:	-69.01346
Name:	WATERFALL ARTS
Address:	256 HIGH ST
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	256 High St
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2012
Submitted By:	Michael Fletcher
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	T
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	05/28/2013
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR2012716J59002GCT
Failed Validation:	Not reported
Facility Date Modified:	08/14/2013
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Name:	WATERFALL ARTS
Address:	256 HIGH ST
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	256 HIGH ST
Facility Mailing City:	BELFAST
Facility Mailing State:	ME
Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2006
Submitted By:	LORNA CRICHTON
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	5/23/2007
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR200654HSMM002Y1D
Failed Validation:	Not reported
Facility Date Modified:	8/24/2007
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.25220
Longitude:	69.001097
Name:	WATERFALL ARTS
Address:	256 HIGH ST
City,State,Zip:	BELFAST, ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Facility Mailing Address:	Not reported
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
Facility Mailing Country:	Not reported
Report Year:	2007
Submitted By:	Not reported
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	Not reported
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20075P0RQN003SPK
Failed Validation:	Not reported
Facility Date Modified:	Not reported
Facility Mail Address:	256 HIGH ST
Mail City:	BELFAST
Mail State:	ME
Mail Zip:	4915
Mail Country:	USA
Lat/Long Location Descr:	Not reported
Lat/Long Method:	G0 - GPS (Other)
Notes:	Not reported
Validation Report:	Not reported
Latitude:	44.25220
Longitude:	69.001097
Name:	WATERFALL ARTS
Address:	256 HIGH ST
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	256 High St
Facility Mailing City:	Belfast
Facility Mailing State:	ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Facility Mailing Zip:	04915
Facility Mailing Country:	USA
Report Year:	2010
Submitted By:	Bob New
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/3/2011
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20107RRWUK00L7VZ
Failed Validation:	Not reported
Facility Date Modified:	09/12/2011
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	Not reported
Latitude:	Not reported
Longitude:	Not reported
Name:	WATERFALL ARTS
Address:	256 HIGH ST
City,State,Zip:	BELFAST, ME
Facility Mailing Address:	256 High St
Facility Mailing City:	Belfast
Facility Mailing State:	ME
Facility Mailing Zip:	04951
Facility Mailing Country:	USA
Report Year:	2008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATERFALL ARTS (Continued)

U003053045

Submitted By:	Lorna Chrichton
Acute/Chronic:	Not reported
Average Amount:	Not reported
Record ID:	Not reported
Facility Router Record ID:	Not reported
Chemical Inventory Record ID:	Not reported
Chemical Same As Last Year:	Not reported
Chronic:	Not reported
CICAS:	Not reported
CI EHS Chemical:	Not reported
CI Last Modified:	Not reported
MSDS Number For Chemical:	Not reported
CI Notes:	Not reported
Days On Site:	Not reported
Entered Chemical Name:	Not reported
Fire:	Not reported
Gas:	Not reported
Liquid:	Not reported
Maximum Amount:	Not reported
Maximum Amount Code:	Not reported
Maximum Amount Container:	Not reported
Mixture:	Not reported
Pressure:	Not reported
Pure:	Not reported
Reactive:	Not reported
Solid:	Not reported
Date Signed:	3/23/2009
Date TierII Received:	Not reported
Facility Dept:	Not reported
Facility ID:	FATR20086DUZTR002H6A
Failed Validation:	Not reported
Facility Date Modified:	3/31/2009
Facility Mail Address:	Not reported
Mail City:	Not reported
Mail State:	Not reported
Mail Zip:	Not reported
Mail Country:	Not reported
Lat/Long Location Descr:	Not reported
Lat/Long Method:	Not reported
Notes:	Not reported
Validation Report:	This facility passed all validation checks.
Latitude:	Not reported
Longitude:	Not reported

N64
East
1/4-1/2
0.433 mi.
2285 ft.

MSAD # 34/BELFAST HIGH SCHOOL
8 WALDO STREET
BELFAST, ME
Site 1 of 2 in cluster N

ME LUST **S104219254**
N/A

Relative:
Lower

LUST:

Actual:
126 ft.

Event:

Name:	MSAD # 34/BELFAST HIGH SCHOOL
Address:	8 WALDO STREET
City,State,Zip:	BELFAST, ME
Spill Number:	A-354-1994

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MSAD # 34/BELFAST HIGH SCHOOL (Continued)

S104219254

Spill Cause: Other - Unknown
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Tank and/or Piping Removal
Inc Location: Government, Municipal or Religious Facility
Inc Source: Not reported
Material Disposal Info: 80 tons of soil to Dragon Pruducts
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: MSAD # 34/BELFAST HIGH SCHOOL
Address: P.O. BOX 363
City,State: BELFAST,ME
Country: Not reported
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: GLEN WALL

File:

Spill Id: A-354-1994
Date Created: 11/30/1995
Created By: SPILLS
Date Modified: 12/01/2008
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 01-DEC-08.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MSAD # 34/BELFAST HIGH SCHOOL (Continued)

S104219254

Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:
Medium: Land

Medium: Groundwater

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 354
Spill Year: 1994
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 08/03/1994
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: GLEN WALL
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 15
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Recovery Method: Excavation

Spill Point:
Date Reported: 8/3/1994
Notes: Not reported
Product: #2 FUEL OIL
Product Notes: Not reported
Latitude: 44.428097
Longitude: -69.018467

Product:
Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: 15
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

N65
East
1/4-1/2
0.433 mi.
2285 ft.
RSU 20 BUS GARAGE
6A WALDO AVE
BELFAST, ME
Site 2 of 2 in cluster N

ME LUST **S118954898**
N/A

Relative:
Lower

LUST:

Actual:
126 ft.

Event:

Name: RSU 20 BUS GARAGE
Address: 6A WALDO AVE
City,State,Zip: BELFAST, ME
Spill Number: A-182-2010
Spill Cause: Overfill
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 04/02/2010
Create By: EIEWERLY
Modify Date: 11/27/2012
Modify By: EIELEIGH
Report Status: Final Report
Actual Spill Datetime: 03/31/2010
Actual Spill Date Unknown: False
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Subject/Spiller
Detection Method: Visual Product
Inc Location: School - Public
Inc Source: Storage Unit - Underground Storage Tank
Material Disposal Info: Oil contaminated sorbent material removed by DEP staff and taken to Auburn incinerator. Oil and water mixture drummed and managed with shop waste.

Lust Document Search: https://fortisportal.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 04/02/2010
Changed By: EIEWERLY

Description: Report Status change from DRV to DQA
Date Change: 03/23/2011
Changed By: EIPBLANC

Description: Report Status change from DQA to FR
Date Change: 11/27/2012
Changed By: EIELEIGH

Description: Report Status change from DR to DRV
Date Change: 10/29/2010
Changed By: EIJFISH

Contact:

Contact Type: Subject/Spiller

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BUS GARAGE (Continued)

S118954898

Potential RP: True
Name: Not reported
Title: Not reported
Company: RSU 20
Address: PO BOX 363
City,State: BELFAST,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: JASON A FISH

Media Affected:
Medium: Land

Medium: Inland Surface Water

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 182
Spill Year: 2010
Create Date: 04/02/2010
Created By: EIEWERLY
Modify Date: 10/29/2010
Modify By: EIJFISH
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 03/31/2010
Log Rep Prod Cd: 29
Log Rep Prod: DIESEL
Log Emp Name: JASON A FISH
Location: 6A Lions Way Belfast School Bus Garage
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: 25 gallons spilled from bus overfill

Material Recovered:
Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 40
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 200
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RSU 20 BUS GARAGE (Continued)

S118954898

Recovery Method: Pumps

Recovery Method: Sorbents

Spill Point:

Product:

Product Code: DIESEL
Product Other: Not reported
Product Amt: 20
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

66
NNE
1/4-1/2
0.450 mi.
2378 ft.

**BELFAST HEADSTART
275 HIGH STREET
BELFAST, ME**

**ME LAST S115778750
N/A**

**Relative:
Lower**

LAST:

**Actual:
109 ft.**

Event:

Name: BELFAST HEADSTART
Address: 275 HIGH STREET
City,State,Zip: BELFAST, ME
Spill Number: A-592-2012
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: True
AST inside flag: True
Create Date: 11/16/2012
Create By: EIDDAVIS
Modify Date: 12/18/2013
Modify By: 12/18/2013
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 11/09/2012
Spill Date Unknown: False
Spill Time Unknown: True
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 2
Reporter Type: Subject/Spiller
Detection Method Code: H
Detection Method: Odor/Vapor/Mist
Inc Location Code: LC
Inc Location: Government - Local
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST HEADSTART (Continued)

S115778750

Spill Cause: Corrosion - Tank
Material Disposal Info: Sorbent disposed of by oil burner tech
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEPP&Password=DEPPortal1

Change:

Description: Report Status change from DR to DQA
Date Change: 09/13/2013
Changed By: EIPBLANC

Description: Report Created with Report Status = DR
Date Change: 11/16/2012
Changed By: EIDDAVIS

Description: Report Status change from DQA to FR
Date Change: 12/18/2013
Changed By: EIDDAVIS

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: BELFAST HEADSTART
Address: 275 HIGH STREET
City,State: BELFAST,ME
Country: USA
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: PETER J BLANCHARD

Media Affected:

Medium: Interior Surface

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 592
Spill Year: 2012
Create Date: 11/16/2012
Created By: EIDDAVIS
Modify Date: 11/16/2012
Modify By: EIDDAVIS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 11/09/2012
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: PETER J BLANCHARD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST HEADSTART (Continued)

S115778750

Location: Belfast headstart, 275 High Street
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: AST corrosion leak to concrete basement

Material Recovered:

Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: UNKNOWN

Spill Point:

Recovery Method: Sorbents

Product:

Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: Not reported
Product Amt Qualifier: UNKNOWN
Primary Product: True

O67
North
1/4-1/2
0.459 mi.
2425 ft.

WENTWORTH FAMILY QWIK STOP
142 WALDO AVENUE
BELFAST, ME

ME LAST **S104324398**
ME LUST **N/A**

Site 1 of 2 in cluster O

Relative:
Lower

LAST:

Actual:
123 ft.

Event:

Name: PERRY'S QUICK STOP
Address: 142 WALDO AVE.
City,State,Zip: BELFAST, ME
Spill Number: A-786-2009
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: True
AST inside flag: Not reported
Create Date: 12/29/2009
Create By: EIEWERLY
Modify Date: 01/06/2012
Modify By: 01/06/2012
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 12/18/2009
Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: O

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WENTWORTH FAMILY QWIK STOP (Continued)

S104324398

Spill Type: Oil Incident
Reporter Type Code: 2
Reporter Type: Subject/Spiller
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: SS
Inc Location: Terminal - Service Station
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 17
Spill Cause: Accident - Human Error
Material Disposal Info: Maritime Energy took care of disposal.
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal1.DEP&Password=DEPPortal1

Change:

Description: Report Status change from DRV to FR
Date Change: 01/06/2012
Changed By: EIELEIGH

Description: Report Status change from DR to DRV
Date Change: 09/07/2011
Changed By: EIBNEWHO

Description: Report Created with Report Status = DR
Date Change: 12/29/2009
Changed By: EIEWERLY

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: MARITIME ENERGY
Address: 234 PARK ST
City,State: ROCKLAND,ME
Country: USA
Zipcode: 04841
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: BARTON J NEWHOUSE

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 786
Spill Year: 2009
Create Date: 12/29/2009
Created By: EIEWERLY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WENTWORTH FAMILY QWIK STOP (Continued)

S104324398

Modify Date: 12/29/2009
Modify By: EIEWERLY
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 12/18/2009
Log Rep Prod Cd: 01
Log Rep Prod: #1 FUEL OIL - KEROSENE
Log Emp Name: BARTON J NEWHOUSE
Location: 142 Waldo Ave Perry's Quick Stop
Log Location Town: BELFAST
Log Tank Involved: None
Notes: 2 1/2 gallon spill from open nozzle on fill hose to pavement and snow.
Not reported

Material Recovered:
Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 25
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Spill Point:
Recovery Method: Sorbents

Product:
Product Code: #1 FUEL OIL - KEROSENE
Product Other: Not reported
Product Amt: 2.5
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

LUST:

Event:
Name: PERRY'S QUICK STOP
Address: 142 WALDO AVENUE
City,State,Zip: BELFAST, ME
Spill Number: A-316-1997
Spill Cause: Mechanical Failure - Loose Fitting
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: True
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: 09/02/1997
Actual Spill Date Unknown: False
Number Wells At Risk: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WENTWORTH FAMILY QWIK STOP (Continued)

S104324398

Number Wells Impacted: Not reported
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Tank and/or Piping Removal
Inc Location: Terminal - Service Station
Inc Source: Not reported
Material Disposal Info: Contaminated soils sent to Thibodeau & Sons for treatment.
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.I.DEF&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: PERRY'S QUICK STOP
Address: 142 WALDO AVENUE
City,State: BELFAST,ME
Country: Not reported
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: FRANCIS GEHRLING

File:

Spill Id: A-316-1997
Date Created: 12/18/1998
Created By: SPILLS
Date Modified: 03/26/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 26-MAR-09.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:

Medium: Land

Medium: Groundwater

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 316
Spill Year: 1997

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WENTWORTH FAMILY QWIK STOP (Continued)

S104324398

Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: 09/02/1997
Spill Time Unk: True
Spill Dt Unknown: False
Log Rep Dt Tm: 09/02/1997
Log Rep Prod Cd: 23
Log Rep Prod: UNLEADED GASOLINE
Log Emp Name: FRANCIS GEHRLING
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: gals.
Material Amt Qualifier: UNKNOWN

Recovery Method: Pumps

Recovery Method: Excavation

Spill Point:

Date Reported: 9/2/1997
Notes: Not reported
Product: UNLEADED GASOLINE
Product Notes: Not reported
Latitude: 44.431907
Longitude: -69.019295

Product:

Product Code: UNLEADED GASOLINE
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: False

Event:

Name: WENTWORTH FAMILY QWIK STOP
Address: 142 WALDO AVENUE
City,State,Zip: BELFAST, ME
Spill Number: A-235-2020
Spill Cause: Corrosion - Tank
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WENTWORTH FAMILY QWIK STOP (Continued)

S104324398

MCD Value: 27010
Create Date: 05/20/2020
Create By: EIJWOODA
Modify Date: 08/02/2022
Modify By: EIJWOODA
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Site Assessment
Inc Location: Business - Commercial
Inc Source: Storage Unit - Underground Storage Tank
Material Disposal Info: Oily soil was collected by NRC and disposed of at Juniper Ridge Landfill in Old Town. Oil contaminated water was collected by NRC and disposed of at ENPRO in South Portland.
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Status change from DR to DQA
Date Change: 09/15/2020
Changed By: EIJWOODA

Description: Report Created with Report Status = DR
Date Change: 05/20/2020
Changed By: EIJWOODA

Description: Report Status change from DQA to FR
Date Change: 08/02/2022
Changed By: EIJWOODA

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: ANJOSA ENTERPRISED, INC
Address: PO BOX 157
City,State: BROOKS,ME
Country: USA
Zipcode: 04921
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: NINA M CAPUTO

Media Affected:

Medium: Land

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WENTWORTH FAMILY QWIK STOP (Continued)

S104324398

Medium: Groundwater

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 235
Spill Year: 2020
Create Date: 05/20/2020
Created By: EIJWOODA
Modify Date: 09/08/2020
Modify By: EINCAPUT
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 05/11/2020
Log Rep Prod Cd: 23
Log Rep Prod: UNLEADED GASOLINE
Log Emp Name: NINA M CAPUTO
Location: 142 Waldo Avenue, Belfast, ME 04915 Wentworth Family Quik Stop
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Expected water issues and contamination. No contamination found when removing the most recently installed tank that was immediately southeast of the building, but found old contamination related to A-316-1997 immediately southwest of Maine Route 137 and southeast of the dispenser pad.

Material Recovered:

Material Recovered Type: CS
Material Recovered: Contaminated Soil
Material Amount: 1295.23
Material Units: tons
Material Amt Qualifier: ACTUAL

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: 66975
Material Units: gals.
Material Amt Qualifier: ACTUAL

Recovery Method: Excavation

Recovery Method: Pumps

Spill Point:

Product:

Product Code: UNLEADED GASOLINE
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WENTWORTH FAMILY QWIK STOP (Continued)

S104324398

Attachments:

Description: Weight Slips (47)
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 09/08/2020

Description: Referral to TROY SMITH
Attach Type: Electronic Form
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 09/08/2020

Description: Referral to ALEXANDER PUGH IV
Attach Type: Electronic Form
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 09/08/2020

Description: Email - Historical Site Analysis
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 09/08/2020

Description: Tank Grave Groundwater Lab Results
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 09/08/2020

Description: Bill of Ladings (14)
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 09/08/2020

Description: Oil Spill Debris Form
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 09/08/2020

Description: Photos
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 09/08/2020

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WENTWORTH FAMILY QWIK STOP (Continued)

S104324398

Description: Expense Tracking
Attach Type: Electronic Form
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 07/16/2020

68
SE
1/4-1/2
0.464 mi.
2452 ft.

GEO S ROBINSON SCHOOL
HIGH STREET
BELFAST, ME

ME LUST S106789890
N/A

Relative:
Higher

LUST:

Actual:
197 ft.

Event:

Name: GEO S ROBINSON SCHOOL
Address: HIGH STREET
City,State,Zip: BELFAST, ME
Spill Number: A-590-1998
Spill Cause: Overfill
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: False
MCD Value: 27010
Create Date: 12/07/2001
Create By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Report Status: Final Report
Actual Spill Datetime: 10/28/1998
Actual Spill Date Unknown: False
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Subject/Spiller
Detection Method: Visual Product
Inc Location: Government - Local
Inc Source: Not reported
Material Disposal Info: pads and soil to general waste stream
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Created with Report Status = FR
Date Change: 12/07/2001
Changed By: SPILLS

Contact:

Contact Type: Subject/Spiller
Potential RP: False
Name: Not reported
Title: Not reported
Company: IRVING OIL CO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GEO S ROBINSON SCHOOL (Continued)

S106789890

Address: Not reported
City,State: SEARSPORT,ME
Country: Not reported
Zipcode: 04974
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: GLEN WALL

File:
Spill Id: A-590-1998
Date Created: 03/21/2001
Created By: SPILLS
Date Modified: 04/15/2009
Modified By: IMAGING
File Num Sheets: 0
Notes: Report scanned into the imaging system on 15-APR-09.
Reconcile Date: Not reported
File Reconciled By: Not reported

Media Affected:
Medium: Land

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 590
Spill Year: 1998
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: 10/28/1998
Spill Time Unk: True
Spill Dt Unknown: False
Log Rep Dt Tm: 10/28/1998
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: GLEN WALL
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:
Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: .5
Material Units: gals.
Material Amt Qualifier: ACTUAL

Recovery Method: Sorbents

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GEO S ROBINSON SCHOOL (Continued)

S106789890

Recovery Method: Excavation

Spill Point:

Product:

Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: .5
Product Amt Unit: gals.
Product Amt Qualifier: ACTUAL
Primary Product: False

69
ENE
1/4-1/2
0.467 mi.
2467 ft.

**BELFAST-MOOSEHEAD LAKE RAILROAD
11 WATER STREET
BELFAST, ME 04915**

**SEMS-ARCHIVE 1003862755
MED985467166**

**Relative:
Lower**

SEMS Archive:

**Actual:
118 ft.**

Site ID: 0101950
EPA ID: MED985467166
Name: BELFAST-MOOSEHEAD LAKE RAILROAD
Address: 11 WATER STREET
Address 2: Not reported
City,State,Zip: BELFAST, ME 04915
Cong District: 01
FIPS Code: 23027
FF: N
NPL: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

SEMS Archive Detail:

Region: 01
Site ID: 0101950
EPA ID: MED985467166
Site Name: BELFAST-MOOSEHEAD LAKE RAILROAD
NPL: N
FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 1
Start Date: Not reported
Finish Date: 1989-03-28 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 01
Site ID: 0101950
EPA ID: MED985467166
Site Name: BELFAST-MOOSEHEAD LAKE RAILROAD
NPL: N
FF: N
OU: 00
Action Code: PA
Action Name: PA
SEQ: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST-MOOSEHEAD LAKE RAILROAD (Continued)

1003862755

Start Date: Not reported
Finish Date: 1989-03-28 05:00:00
Qual: N
Current Action Lead: EPA Perf

Region: 01
Site ID: 0101950
EPA ID: MED985467166
Site Name: BELFAST-MOOSEHEAD LAKE RAILROAD
NPL: N
FF: N
OU: 00
Action Code: DS
Action Name: DISCVRY
SEQ: 1
Start Date: 1988-06-01 04:00:00
Finish Date: 1988-06-01 04:00:00
Qual: Not reported
Current Action Lead: EPA Perf

70
East
1/4-1/2
0.473 mi.
2495 ft.

PELLERITI RENTAL PROPERTY
38 FRANKLIN STREET
BELFAST, ME

ME LAST **S120762833**
N/A

Relative:
Lower

LAST:

Actual:
170 ft.

Event:

Name: PELLERITI RENTAL PROPERTY
Address: 38 FRANKLIN STREET
City,State,Zip: BELFAST, ME
Spill Number: A-19-2017
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: True
AST inside flag: True
Create Date: 01/17/2017
Create By: EIJWOODA
Modify Date: 04/25/2017
Modify By: 04/25/2017
Report Status Code: FR
Report Status: Final Report
Spill Datetime: Not reported
Spill Date Unknown: True
Spill Time Unknown: True
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: 0
Spill Type: Oil Incident
Reporter Type Code: 7
Reporter Type: Other Involved Party
Detection Method Code: H

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PELLERITI RENTAL PROPERTY (Continued)

S120762833

Detection Method: Odor/Vapor/Mist
Inc Location Code: SF
Inc Location: Residential - Single Family
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 01
Spill Cause: Corrosion - Tank
Material Disposal Info: Allstate Environmental Services disposed of oily debris.
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Status change from DRV to DQA
Date Change: 04/07/2017
Changed By: EIJWOODA

Description: Report Created with Report Status = DR
Date Change: 01/17/2017
Changed By: EIJWOODA

Description: Report Status change from DR to DRV
Date Change: 04/07/2017
Changed By: EIDDAVIS

Description: Report Status change from DQA to FR
Date Change: 04/25/2017
Changed By: EIRKROUT

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: LEO PELLERITI
Title: Not reported
Company: Not reported
Address: UNKNOWN
City,State: ,
Country: Not reported
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: DANIEL E DAVIS

Media Affected:

Medium: Interior Surface

Medium: Inland Surface Water

Medium: Coastal Water

Log:

Spill Void Flag: False
Spill Office: Augusta

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PELLERITI RENTAL PROPERTY (Continued)

S120762833

Spill Off Sequence: 19
Spill Year: 2017
Create Date: 01/17/2017
Created By: EIJWOODA
Modify Date: 01/17/2017
Modify By: EIJWOODA
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 01/07/2017
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: DANIEL E DAVIS
Location: 38 Franklin Street
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: 20 gallons to basement floor

Material Recovered:
Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 300
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Spill Point:
Recovery Method: Sorbents

Product:
Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: 20
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

O71
North
1/4-1/2
0.481 mi.
2541 ft.

BELFAST FAMILY PLANNING AND PRIMARY CARE
147 WALDO AVENUE
BELFAST, ME

ME LAST **S118709754**
N/A

Site 2 of 2 in cluster O

Relative:
Lower

LAST:

Actual:
124 ft.

Event:

Name: BELFAST FAMILY PLANNING AND PRIMARY CARE
Address: 147 WALDO AVENUE
City,State,Zip: BELFAST, ME
Spill Number: A-492-2014
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: True
AST inside flag: True
Create Date: 08/11/2014

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST FAMILY PLANNING AND PRIMARY CARE (Continued)

S118709754

Create By: EIJWOODA
Modify Date: 06/15/2016
Modify By: 06/15/2016
Report Status Code: FR
Report Status: Final Report
Spill Datetime: 07/31/2014
Spill Date Unknown: False
Spill Time Unknown: False
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 6
Reporter Type: Contractor/Consultant
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: OB
Inc Location: Business - Other
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 01
Spill Cause: Corrosion - Tank
Material Disposal Info: Speedi dri sorbent material disposed of by Maritime Energy.
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal1.DEP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 08/11/2014
Changed By: EIJWOODA

Description: Report Status change from DR to DRV
Date Change: 03/09/2016
Changed By: EIALASSE

Description: Report Status change from DQA to FR
Date Change: 06/15/2016
Changed By: EIRKROUT

Description: Report Status change from DRV to DQA
Date Change: 03/25/2016
Changed By: EIJWOODA

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: BELFAST FAMILY PLANNING AND PRIMARY CARE
Address: 147 WALDO AVENUE
City,State: BELFAST,ME
Country: USA
Zipcode: 04915

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST FAMILY PLANNING AND PRIMARY CARE (Continued)

S118709754

Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: ANDREA L LASSELLE

Media Affected:
Medium: Interior Surface

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 492
Spill Year: 2014
Create Date: 08/11/2014
Created By: EIJWOODA
Modify Date: 01/29/2015
Modify By: EIJGREEN
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 07/31/2014
Log Rep Prod Cd: 01
Log Rep Prod: #1 FUEL OIL - KEROSENE
Log Emp Name: ANDREA L LASSELLE
Location: 147 Waldo Avenue
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: Leaking AST to concrete slab. Maritime Pumping Tanks.

Material Recovered:
Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: UNKNOWN

Spill Point:
Recovery Method: Sorbents

Product:
Product Code: #1 FUEL OIL - KEROSENE
Product Other: less than'
Product Amt: 1
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

P72
ESE
1/4-1/2
0.484 mi.
2557 ft.

OLD WALDO COUNTY JAIL
45 CONGRESS STREET
BELFAST, ME 4915

US BROWNFIELDS
FINDS
1016457001
N/A

Site 1 of 3 in cluster P

Relative:
Lower

US BROWNFIELDS:

Actual:
189 ft.

Name:

OLD WALDO COUNTY JAIL

Address:

45 CONGRESS STREET

City,State,Zip:

BELFAST, ME 4915

Recipient Name:

Congress Street Hill Property LLC

Grant Type:

Cleanup

Property Number:

Tax Map 10, Lot 36

Parcel size:

0.35

Latitude:

44.4227805

Longitude:

-69.0094302

HCM Label:

Address Matching-House Number

Map Scale:

-

Point of Reference:

Entrance Point of a Facility or Station

Highlights:

Former Use: The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff's Office, former Sheriff's Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer's House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff's Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer's House building, which was reportedly formerly located within the footprint of the current Sheriff's Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff's Office was utilized as the Sheriff's House and Office and the building was solely utilized for office use, until the sheriff's office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Datum:

North American Datum of 1983

Acres Property ID:

157043

IC Data Access:

-

Start Date:

5/22/2017

Redev Completion Date:

-

Completed Date:

5/4/2018

Acres Cleaned Up:

0.35

Cleanup Funding:

170399

Cleanup Funding Source:

EPA

Assessment Funding:

-

Assessment Funding Source:

-

Redevelopment Funding:

-

Redev. Funding Source:

-

Redev. Funding Entity Name:

-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	US EPA - Brownfields Cleanup Cooperative Agreement
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96188401
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	Congress Street Hill Property, LLC
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	5/17/2018
IC in place:	Y
State/tribal program date:	7/8/2013
State/tribal program ID:	-
State/tribal NFA date:	5/4/2018
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	Y
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	Universal Wastes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Num. of cleanup and re-dev. jobs: -
Past use greenspace acreage: -
Past use residential acreage: -
Surface Water: -
Past use commercial acreage: 0.35
Past use industrial acreage: -
Future use greenspace acreage: -
Future use residential acreage: 0.25
Future use commercial acreage: 0.1
Future use industrial acreage: -
Superfund Fed. landowner flag: Y
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: Y
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: Y
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff s Office, former Sheriff s Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

of the current Sheriff's Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff's Office was utilized as the Sheriff's House and Office and the building was solely utilized for office use, until the sheriff's office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Below Poverty Number: 408
Below Poverty Percent: 22.7
Median Income: 3080
Median Income Number: 772
Median Income Percent: 42.96
Vacant Housing Number: 114
Vacant Housing Percent: 11.66
Unemployed Number: 42
Unemployed Percent: 2.34

Name: OLD WALDO COUNTY JAIL
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast, City of
Grant Type: Assessment
Property Number: Tax Map 10, Lot 36
Parcel size: 0.35
Latitude: 44.4227805
Longitude: -69.0094302
HCM Label: Address Matching-House Number
Map Scale: -

Point of Reference: Entrance Point of a Facility or Station

Highlights: Former Use: The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff's Office, former Sheriff's Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer's House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff's Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer's House building, which was reportedly formerly located within the footprint of the current Sheriff's Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff's Office was utilized as the Sheriff's House and Office and the building was solely utilized for office use, until the sheriff's office relocated to the new Waldo County Emergency Operations Center in 2011. The barn

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

has reportedly been utilized for miscellaneous storage purposes,
since its construction.
North American Datum of 1983
Datum: 157043
Acres Property ID: 157043
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: 3505
Assessment Funding Source: EPA
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity: -
Grant Type: Hazardous
Accomplishment Type: Phase I Environmental Assessment
Accomplishment Count: Y
Cooperative Agreement Number: 96151001
Start Date: 7/23/2012
Ownership Entity: Government
Completion Date: 11/19/2012
Current Owner: Congress Street Hill Property, LLC
Did Owner Change: Y
Cleanup Required: Y
Video Available: N
Photo Available: Y
Institutional Controls Required: Y
IC Category Proprietary Controls: -
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: 5/17/2018
IC in place: Y
State/tribal program date: 7/8/2013
State/tribal program ID: -
State/tribal NFA date: 5/4/2018
Air cleaned: -
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: -
Lead contaminant found: Y
Lead cleaned up: Y
No media affected: Y
Unknown media affected: -
Other cleaned up: Y
Other metals found: Y
Other metals cleaned: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	Universal Wastes
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.35
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	0.25
Future use commercial acreage:	0.1
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	Y
Indoor air media cleaned up:	-
Unknown media cleaned up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Past Use: Multistory
Property Description:

-
The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff's Office, former Sheriff's Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer's House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff's Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer's House building, which was reportedly formerly located within the footprint of the current Sheriff's Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff's Office was utilized as the Sheriff's House and Office and the building was solely utilized for office use, until the sheriff's office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Below Poverty Number: 408
Below Poverty Percent: 22.7
Median Income: 3080
Median Income Number: 772
Median Income Percent: 42.96
Vacant Housing Number: 114
Vacant Housing Percent: 11.66
Unemployed Number: 42
Unemployed Percent: 2.34

Name: OLD WALDO COUNTY JAIL
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Congress Street Hill Property LLC
Grant Type: Cleanup
Property Number: Tax Map 10, Lot 36
Parcel size: 0.35
Latitude: 44.4227805
Longitude: -69.0094302
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of only the northeastern, approximate

0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff's Office, former Sheriff's Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint of the current Sheriff s Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff s Office was utilized as the Sheriff s House and Office and the building was solely utilized for office use, until the sheriff s office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Datum: North American Datum of 1983
Acres Property ID: 157043
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: -
Grant Type: Hazardous
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 96188401
Start Date: -
Ownership Entity: Government
Completion Date: -
Current Owner: Congress Street Hill Property, LLC
Did Owner Change: Y
Cleanup Required: Y
Video Available: N
Photo Available: Y
Institutional Controls Required: Y
IC Category Proprietary Controls: -
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: 5/17/2018
IC in place: Y
State/tribal program date: 7/8/2013
State/tribal program ID: -
State/tribal NFA date: 5/4/2018

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	Y
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contaminants found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	Universal Wastes
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.35
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	0.25
Future use commercial acreage:	0.1
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: Y
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff s Office, former Sheriff s Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint of the current Sheriff s Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff s Office was utilized as the Sheriff s House and Office and the building was solely utilized for office use, until the sheriff s office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Below Poverty Number: 408
Below Poverty Percent: 22.7
Meidan Income: 3080
Meidan Income Number: 772
Meidan Income Percent: 42.96
Vacant Housing Number: 114
Vacant Housing Percent: 11.66
Unemployed Number: 42
Unemployed Percent: 2.34

Name: OLD WALDO COUNTY JAIL
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Congress Street Hill Property LLC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Grant Type:	Cleanup
Property Number:	Tax Map 10, Lot 36
Parcel size:	0.35
Latitude:	44.4227805
Longitude:	-69.0094302
HCM Label:	Address Matching-House Number
Map Scale:	-
Point of Reference:	Entrance Point of a Facility or Station
Highlights:	Former Use: The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff s Office, former Sheriff s Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint of the current Sheriff s Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff s Office was utilized as the Sheriff s House and Office and the building was solely utilized for office use, until the sheriff s office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.
Datum:	North American Datum of 1983
Acres Property ID:	157043
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96188401
Start Date:	-
Ownership Entity:	Government

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Completion Date:	-
Current Owner:	Congress Street Hill Property, LLC
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	5/17/2018
IC in place:	Y
State/tribal program date:	7/8/2013
State/tribal program ID:	-
State/tribal NFA date:	5/4/2018
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	Y
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contaminants found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	Universal Wastes
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.35
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	0.25
Future use commercial acreage:	0.1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Future use industrial acreage: -
Superfund Fed. landowner flag: Y
Arsenic cleaned up: -
Cadmium cleaned up: -
Chromium cleaned up: -
Copper cleaned up: -
Iron cleaned up: -
mercury cleaned up: -
Nickel Cleaned Up: -
No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: Y
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: Y
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff s Office, former Sheriff s Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint of the current Sheriff s Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff s Office was utilized as the Sheriff s House and Office and the building was solely utilized for office use, until the sheriff s office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

been utilized for miscellaneous storage purposes, since its construction.

Below Poverty Number: 408
Below Poverty Percent: 22.7
Meidan Income: 3080
Meidan Income Number: 772
Meidan Income Percent: 42.96
Vacant Housing Number: 114
Vacant Housing Percent: 11.66
Unemployed Number: 42
Unemployed Percent: 2.34

Name: OLD WALDO COUNTY JAIL
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Congress Street Hill Property LLC
Grant Type: Cleanup
Property Number: Tax Map 10, Lot 36
Parcel size: 0.35
Latitude: 44.4227805
Longitude: -69.0094302
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff s Office, former Sheriff s Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint of the current Sheriff s Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff s Office was utilized as the Sheriff s House and Office and the building was solely utilized for office use, until the sheriff s office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Datum: North American Datum of 1983
Acres Property ID: 157043
IC Data Access: -
Start Date: 5/22/2017
Redev Completion Date: -
Completed Date: 5/4/2018
Acres Cleaned Up: 0.35

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Cleanup Funding:	34080
Cleanup Funding Source:	Congress Street Hill Property, LLC (Owner)
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	Cost Share
Grant Type:	Hazardous
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	96188401
Start Date:	-
Ownership Entity:	Government
Completion Date:	-
Current Owner:	Congress Street Hill Property, LLC
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	5/17/2018
IC in place:	Y
State/tribal program date:	7/8/2013
State/tribal program ID:	-
State/tribal NFA date:	5/4/2018
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	Y
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contaminants found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	Universal Wastes
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.35
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	0.25
Future use commercial acreage:	0.1
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	Y
Media affected indoor air:	-
Building material media cleaned up:	Y
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff s Office, former Sheriff s Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint of the current Sheriff s Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff s Office was utilized as the Sheriff s House and Office and the building was solely utilized for office use, until the sheriff s office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Below Poverty Number: 408
Below Poverty Percent: 22.7
Meidan Income: 3080
Meidan Income Number: 772
Meidan Income Percent: 42.96
Vacant Housing Number: 114
Vacant Housing Percent: 11.66
Unemployed Number: 42
Unemployed Percent: 2.34

Name: OLD WALDO COUNTY JAIL
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast, City of
Grant Type: Assessment
Property Number: Tax Map 10, Lot 36
Parcel size: 0.35
Latitude: 44.4227805
Longitude: -69.0094302
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights:

Former Use: The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff s Office, former Sheriff s Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint of the current Sheriff s Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff s Office was utilized as the Sheriff s House and Office and the building was solely utilized for office use, until the sheriff s office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Datum: North American Datum of 1983
Acres Property ID: 157043
IC Data Access: -
Start Date: -
Redev Completion Date: -
Completed Date: -
Acres Cleaned Up: -
Cleanup Funding: -
Cleanup Funding Source: -
Assessment Funding: 22420
Assessment Funding Source: EPA
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity: -
Grant Type: Hazardous
Accomplishment Type: Phase II Environmental Assessment
Accomplishment Count: N
Cooperative Agreement Number: 96151001
Start Date: 10/1/2012
Ownership Entity: Government
Completion Date: 3/20/2013
Current Owner: Congress Street Hill Property, LLC
Did Owner Change: Y
Cleanup Required: Y
Video Available: N
Photo Available: Y
Institutional Controls Required: Y
IC Category Proprietary Controls: -
IC Cat. Info. Devices: Y
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: 5/17/2018
IC in place: Y
State/tribal program date: 7/8/2013
State/tribal program ID: -
State/tribal NFA date: 5/4/2018
Air cleaned: -
Asbestos found: Y
Asbestos cleaned: Y
Controlled substance found: -
Controlled substance cleaned: -
Drinking water affected: -
Drinking water cleaned: -
Groundwater affected: Y
Groundwater cleaned: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Lead contaminant found:	Y
Lead cleaned up:	Y
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	Universal Wastes
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.35
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	0.25
Future use commercial acreage:	0.1
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	Y
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: Y
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff s Office, former Sheriff s Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint of the current Sheriff s Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff s Office was utilized as the Sheriff s House and Office and the building was solely utilized for office use, until the sheriff s office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Below Poverty Number: 408
Below Poverty Percent: 22.7
Meidan Income: 3080
Meidan Income Number: 772
Meidan Income Percent: 42.96
Vacant Housing Number: 114
Vacant Housing Percent: 11.66
Unemployed Number: 42
Unemployed Percent: 2.34

Name: OLD WALDO COUNTY JAIL
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME 4915
Recipient Name: Belfast, City of
Grant Type: Assessment
Property Number: Tax Map 10, Lot 36
Parcel size: 0.35
Latitude: 44.4227805
Longitude: -69.0094302
HCM Label: Address Matching-House Number
Map Scale: -
Point of Reference: Entrance Point of a Facility or Station
Highlights: Former Use: The Site consists of only the northeastern, approximate

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff's Office, former Sheriff's Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer's House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff's Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer's House building, which was reportedly formerly located within the footprint of the current Sheriff's Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff's Office was utilized as the Sheriff's House and Office and the building was solely utilized for office use, until the sheriff's office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Datum:	North American Datum of 1983
Acres Property ID:	157043
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	6623
Assessment Funding Source:	EPA
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	US EPA - Brownfields Assessment Cooperative Agreement
Cleanup Funding Entity:	-
Grant Type:	Hazardous
Accomplishment Type:	Cleanup Planning
Accomplishment Count:	N
Cooperative Agreement Number:	96151001
Start Date:	3/20/2013
Ownership Entity:	Government
Completion Date:	5/9/2013
Current Owner:	Congress Street Hill Property, LLC
Did Owner Change:	Y
Cleanup Required:	Y
Video Available:	N
Photo Available:	Y
Institutional Controls Required:	Y
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	5/17/2018
IC in place:	Y
State/tribal program date:	7/8/2013
State/tribal program ID:	-
State/tribal NFA date:	5/4/2018
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	Y
Groundwater cleaned:	-
Lead contaminant found:	Y
Lead cleaned up:	Y
No media affected:	Y
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	Y
Other metals cleaned:	-
Other contaminants found:	-
Other contaminants found description:	-
PAHs found:	Y
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	Y
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	Y
VOCs cleaned:	-
Cleanup other description:	Universal Wastes
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	0.35
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	0.25
Future use commercial acreage:	0.1
Future use industrial acreage:	-
Superfund Fed. landowner flag:	Y
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

No clean up: -
Pesticides cleaned up: -
Selenium cleaned up: -
SVOCs cleaned up: -
Unknown clean up: -
Arsenic contaminant found: Y
Cadmium contaminant found: -
Chromium contaminant found: -
Copper contaminant found: -
Iron contaminant found: -
Mercury contaminant found: -
Nickel contaminant found: -
No contaminant found: -
Pesticides contaminant found: -
Selenium contaminant found: -
SVOCs contaminant found: -
Unknown contaminant found: -
Future Use: Multistory -
Media affected Bluiding Material: Y
Media affected indoor air: -
Building material media cleaned up: Y
Indoor air media cleaned up: -
Unknown media cleaned up: -
Past Use: Multistory -
Property Description:

The Site consists of only the northeastern, approximate 0.35-acre portion of the Waldo County Public Safety Complex, which is improved with the Old Waldo County Jail, former Sheriff s Office, former Sheriff s Office Barn, associated driveways/parking areas, and limited landscaping, collectively known as the Old Waldo County Jail. The buildings have been vacant and/or have seen limited use, since the new Waldo County Emergency Operations Center was constructed adjacent to the Old Waldo County Jail in 2011. Based on available information, the Site reportedly consisted of undeveloped land, prior to circa 1828. In 1828, the Site was developed with the original Waldo County Jail and Jailer s House. The original Waldo County Jail building was demolished and the existing Old Waldo County Jail was constructed in its place circa 1850. The Sheriff s Office and Barn were reportedly constructed at the Site circa 1887, upon demolition of the Jailer s House building, which was reportedly formerly located within the footprint of the current Sheriff s Office Barn. The Old Waldo County Jail served as a jailhouse, until the new/existing Waldo County Jail was constructed immediately to the south of the Old Waldo County Jail building in 1976. Since 1976, the Old Waldo County Jail has been utilized for evidence and miscellaneous storage purposes by Waldo County. Until the 1970s/1980s, the Sheriff s Office was utilized as the Sheriff s House and Office and the building was solely utilized for office use, until the sheriff s office relocated to the new Waldo County Emergency Operations Center in 2011. The barn has reportedly been utilized for miscellaneous storage purposes, since its construction.

Below Poverty Number: 408
Below Poverty Percent: 22.7
Meidan Income: 3080
Meidan Income Number: 772
Meidan Income Percent: 42.96
Vacant Housing Number: 114
Vacant Housing Percent: 11.66

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OLD WALDO COUNTY JAIL (Continued)

1016457001

Unemployed Number: 42
Unemployed Percent: 2.34

FINDS:

Registry ID: 110057202735

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES) is an federal online database for Brownfields Grantees to electronically submit data directly to EPA. ME-EFIS (Maine - Environmental Facility Information System) integrates information on environmental facilities, permits, violations, enforcement actions, and compliance activities needed to support regulatory requirements and target environmental quality improvements for the water, air, solid waste, and hazardous waste program areas.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

P73
ESE
1/4-1/2
0.484 mi.
2557 ft.

Relative:
Lower

Actual:
189 ft.

WALDO COUNTY JAIL
45 CONGRESS STREET
BELFAST, ME

Site 2 of 3 in cluster P

ME LAST S113904029
ME LUST N/A

LAST:

Event:

Name: WALDO COUNTY JAIL
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME
Spill Number: A-18-2019
Inc Tank Code: A
Inc Tank: Above Ground Tank(s) Involved
Removal Flag: False
UST registered flag: False
AST inside flag: True
Create Date: 02/26/2019
Create By: EIJWOODA
Modify Date: 03/30/2020
Modify By: 03/30/2020
Report Status Code: FR
Report Status: Final Report
Spill Datetime: Not reported
Spill Date Unknown: True
Spill Time Unknown: True
Number of wells at risk: 0
Number of wells impacted: 0
DTREE completed flag: False
MCD Value: 27010
Further response action: False
Spill Type Code: 0
Spill Type: Oil Incident
Reporter Type Code: 2
Reporter Type: Subject/Spiller
Detection Method Code: L
Detection Method: Visual Product

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALDO COUNTY JAIL (Continued)

S113904029

Inc Location Code: LC
Inc Location: Government - Local
Inc Source Code: TA
Inc Source: Storage Unit - Aboveground Storage Tank
Spill Cause Code: 17
Spill Cause: Accident - Human Error
Material Disposal Info: Oily snow and sorbent materials were collected and disposed of by Maritime Energy employees.
Last Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Status change from DR to DRV
Date Change: 03/26/2020
Changed By: EINCAPUT

Description: Report Status change from DRV to DQA
Date Change: 03/27/2020
Changed By: EIJWOODA

Description: Report Status change from DQA to FR
Date Change: 03/30/2020
Changed By: EIRKROUT

Description: Report Created with Report Status = DR
Date Change: 02/26/2019
Changed By: EIJWOODA

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: MARITIME ENERGY
Address: 234 PARK ST.
City,State: ROCKLAND,ME
Country: USA
Zipcode: 04841
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: NINA M CAPUTO

Media Affected:

Medium: Land

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 18
Spill Year: 2019
Create Date: 02/26/2019
Created By: EIJWOODA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALDO COUNTY JAIL (Continued)

S113904029

Modify Date: 03/26/2020
Modify By: EINCAPUT
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 01/22/2019
Log Rep Prod Cd: 02
Log Rep Prod: #2 FUEL OIL
Log Emp Name: NINA M CAPUTO
Location: 45 Congress Street, Belfast, ME 04915 Waldo County Jail
Log Location Town: BELFAST
Log Tank Involved: Above Ground Tank(s) Involved
Notes: Overfilled AST, spill to snow & black top.

Material Recovered:

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: Not reported
Material Amt Qualifier: UNKNOWN

Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 60
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Spill Point:

Recovery Method: Sorbents

Recovery Method: Excavation

Product:

Product Code: #2 FUEL OIL
Product Other: Not reported
Product Amt: 5
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

LUST:

Event:

Name: WALDO COUNTY JAIL
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME
Spill Number: A-419-2000
Spill Cause: Corrosion - Tank
Spill Type: Oil Incident
Inc Tank: Underground Tank(s) Involved
Removal Flag: False
UST Registered Flag: False
MCD Value: 27010
Create Date: 12/07/2001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALDO COUNTY JAIL (Continued)

S113904029

Create By: SPILLS
Modify Date: 08/28/2013
Modify By: EIJWOODA
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Number Wells At Risk: 1
Number Wells Impacted: 0
Dtree Completed Flag: False
Further Response Action: False
Reporter Type: Contractor/Consultant
Detection Method: Tank and/or Piping Removal
Inc Location: Government - Local
Inc Source: Storage Unit - Underground Storage Tank
Material Disposal Info: Thibodeau's
Lust Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEF&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 12/07/2001
Changed By: SPILLS

Description: Report Status change from DRV to FR
Date Change: 08/28/2013
Changed By: EIJWOODA

Description: Report Status change from DR to DRV
Date Change: 07/26/2013
Changed By: EIDDAVIS

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: Not reported
Title: Not reported
Company: COUNTY OF WALDO
Address: 45 CONGRESS STREET
City,State: BELFAST,ME
Country: Not reported
Zipcode: 04915
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: MARY JAMES

Primary Employee: False
Name: DANIEL DAVIS

Media Affected:

Medium: Land

Medium: Groundwater

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALDO COUNTY JAIL (Continued)

S113904029

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 419
Spill Year: 2000
Create Date: 12/07/2001
Created By: SPILLS
Modify Date: 12/07/2001
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: True
Spill Dt Unknown: True
Log Rep Dt Tm: 07/31/2000
Log Rep Prod Cd: 20
Log Rep Prod: GASOLINE UNSPECIFIED
Log Emp Name: MARY JAMES
Location: Not reported
Log Location Town: BELFAST
Log Tank Involved: Underground Tank(s) Involved
Notes: Not reported

Material Recovered:

Material Recovered Type: CS
Material Recovered: Contaminated Soil
Material Amount: 712
Material Units: tons
Material Amt Qualifier: ESTIMATE

Material Recovered Type: MM
Material Recovered: Mixed Liquid Media
Material Amount: Not reported
Material Units: gals.
Material Amt Qualifier: UNKNOWN

Recovery Method: Pumps

Recovery Method: Excavation

Spill Point:

Date Reported: 7/31/2000 9:53:00 AM
Notes: Not reported
Product: GASOLINE UNSPECIFIED
Product Notes: Not reported
Latitude: 44.422164
Longitude: -69.010119

Product:

Product Code: GASOLINE UNSPECIFIED
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: gals.
Product Amt Qualifier: UNKNOWN
Primary Product: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALDO COUNTY JAIL (Continued)

S113904029

Attachments:

Description: D-Tree
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 07/26/2013

Description: Oil Spill Debris Letter
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 07/26/2013

Description: Thibodeau invoice
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 07/26/2013

P74
ESE
1/4-1/2
0.484 mi.
2557 ft.
WALDO COUNT JAIL COMPLEX
45/45A CONGRESS STREET
BELFAST, ME
Site 3 of 3 in cluster P

ME INST CONTROL
ME VCP
ME BROWNFIELDS
ME ALLSITES
ME TIER 2
S110648081
N/A

Relative:
Lower
Actual:
189 ft.

INST CONTROL:
Name: WALDO COUNTY SHERIFF
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME
Facility ID: REM01986
Facility Status: REMEDIATION STAGE
Program Type: VRAP
Lat/Long: 44.4222 / -69.00977
Institutional Control?: TRUE
Alias: Not reported
Acres: Not reported
Sub Status: Not reported
Status Date: Not reported

Name: WALDO COUNTY SHERIFF
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME
Facility ID: REM01986
Facility Status: REMEDIATION STAGE
Program Type: BROWNFIELDS-104K
Lat/Long: 44.4222 / -69.00977
Institutional Control?: TRUE
Alias: Not reported
Acres: Not reported
Sub Status: Not reported
Status Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALDO COUNT JAIL COMPLEX (Continued)

S110648081

VCP:

Name: WALDO COUNTY SHERIFF
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME
Facility ID: REM01986
Facility status: REMEDIATION STAGE
Program Type: VRAP
Lat/Long: 44.4222 / -69.00977
Institutional Control?: TRUE
Alias: 45 CONGRESS STREET, OLD WALDO COUNTY JAIL
Acres: 3
Sub Status: NEED (AWAITING RESOURCES)
Status Date: 10/15/2015

BROWNFIELDS:

Name: WALDO COUNTY SHERIFF
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME
Facility ID: REM01986
Facility Status: REMEDIATION STAGE
Program Type: BROWNFIELDS-104K
Lat/Long: 44.4222 / -69.00977
Institutional Control?: TRUE
Alias: 45 CONGRESS STREET, OLD WALDO COUNTY JAIL
Acres: 3
Sub Status: NEED (AWAITING RESOURCES)
Status Date: 10/15/2015

ALLSITES:

Name: WALDO COUNTY SHERIFF
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME
Status: REMEDIATION STAGE
Program Type: VRAP
Lat/Long: 44.4222 / -69.00977
Institutional Control?: TRUE
Alias: 45 CONGRESS STREET, OLD WALDO COUNTY JAIL
Acres: 3
Sub Status: NEED (AWAITING RESOURCES)
Status Date: 10/15/2015

Name: WALDO COUNTY SHERIFF
Address: 45 CONGRESS STREET
City,State,Zip: BELFAST, ME
Status: REMEDIATION STAGE
Program Type: BROWNFIELDS-104K
Lat/Long: 44.4222 / -69.00977
Institutional Control?: TRUE
Alias: 45 CONGRESS STREET, OLD WALDO COUNTY JAIL
Acres: 3
Sub Status: NEED (AWAITING RESOURCES)
Status Date: 10/15/2015

TIER 2:

Name: WALDO COUNT JAIL COMPLEX

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WALDO COUNT JAIL COMPLEX (Continued)

S110648081

Address: 45/45A CONGRESS STREET
City,State,Zip: BELFAST, ME
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
Facility Mailing Country: Not reported
Report Year: 2014
Submitted By: Keith Nealley, Facilities Manager
Acute/Chronic: Not reported
Average Amount: Not reported
Record ID: Not reported
Facility Router Record ID: Not reported
Chemical Inventory Record ID: Not reported
Chemical Same As Last Year: T
Chronic: Not reported
CICAS: Not reported
CI EHS Chemical: Not reported
CI Last Modified: Not reported
MSDS Number For Chemical: Not reported
CI Notes: Not reported
Days On Site: Not reported
Entered Chemical Name: Not reported
Fire: Not reported
Gas: Not reported
Liquid: Not reported
Maximum Amount: Not reported
Maximum Amount Code: Not reported
Maximum Amount Container: Not reported
Mixture: Not reported
Pressure: Not reported
Pure: Not reported
Reactive: Not reported
Solid: Not reported
Date Signed: 1/12/2015
Date TierII Received: Not reported
Facility Dept: County of Waldo
Facility ID: FATR2014AEZ80L002V0Y
Failed Validation: Not reported
Facility Date Modified: 11/10/2015
Facility Mail Address: Not reported
Mail City: Not reported
Mail State: Not reported
Mail Zip: Not reported
Mail Country: Not reported
Lat/Long Location Descr: Not reported
Lat/Long Method: Not reported
Notes: Not reported

Validation Report: Not reported
Latitude: 44.42276
Longitude: -69.00939

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

75
East
1/2-1
0.562 mi.
2970 ft.

EM BEE CLEANERS
126 CHURCH STREET
BELFAST, ME 04915

ME SHWS **S106464599**
ME VCP **N/A**
ME ALLSITES
ME DRYCLEANERS

Relative:
Lower

Actual:
102 ft.

SHWS:

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Facility ID: REM01891
Facility Status: INVESTIGATION STAGE
Program Type: UNCONTROLLED SITES
Lat/Long: 44.42576 / -69.00798
IC: FALSE
Alias: Not reported
Acres: 0
Sub Status: ONGOING
Status Date: 12/29/2021

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Facility ID: REM01891
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: UNCONTROLLED SITES
Lat/Long: 44.42576 / -69.00798
IC: FALSE
Alias: Not reported
Acres: 0
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 12/29/2021

VCP:

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Facility ID: REM01891
Facility status: INVESTIGATION STAGE
Program Type: VRAP
Lat/Long: 44.42576 / -69.00798
Institutional Control?: FALSE
Alias: Not reported
Acres: 0
Sub Status: ONGOING
Status Date: 12/29/2021

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Facility ID: REM01891
Facility status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.42576 / -69.00798
Institutional Control?: FALSE
Alias: Not reported
Acres: 0
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 12/29/2021

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EM BEE CLEANERS (Continued)

S106464599

ALLSITES:

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Status: INVESTIGATION STAGE
Program Type: RCRA
Lat/Long: 44.42576 / -69.00798
Institutional Control?: FALSE
Alias: Not reported
Acres: 0
Sub Status: ONGOING
Status Date: 12/29/2021

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: RCRA
Lat/Long: 44.42576 / -69.00798
Institutional Control?: FALSE
Alias: Not reported
Acres: 0
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 12/29/2021

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Status: INVESTIGATION STAGE
Program Type: VRAP
Lat/Long: 44.42576 / -69.00798
Institutional Control?: FALSE
Alias: Not reported
Acres: 0
Sub Status: ONGOING
Status Date: 12/29/2021

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.42576 / -69.00798
Institutional Control?: FALSE
Alias: Not reported
Acres: 0
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 12/29/2021

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Status: INVESTIGATION STAGE
Program Type: UNCONTROLLED SITES
Lat/Long: 44.42576 / -69.00798
Institutional Control?: FALSE
Alias: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EM BEE CLEANERS (Continued)

S106464599

Acres: 0
Sub Status: ONGOING
Status Date: 12/29/2021

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: UNCONTROLLED SITES
Lat/Long: 44.42576 / -69.00798
Institutional Control?: FALSE
Alias: Not reported
Acres: 0
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 12/29/2021

DRYCLEANERS:

Name: EM BEE CLEANERS
Address: 126 CHURCH STREET
City,State,Zip: BELFAST, ME 04915
Facility ID: 20
Facility Telephone: 2073382120
Facility Contact: Connie L. Sarnacki
Mailing Address: 126 CHURCH STREET
Mailing City,St,Zip: BELFAST, ME 04915
1991 Perc: 500
1993 Perc: 800
1994 Perc: 525
1996 Perc: 250
1997 Perc: 100
1998 Perc: 0
1999 Perc: 45
2000 Perc: 180
2001 Perc: 75
2002 Perc: 55
2003 Perc: 90
2006 Perc: 90
2007 Perc: 90
2008 Perc: 85
2009 Perc: 60
2010 Perc: 25
2011 Perc: Not reported
2012 Perc: Not reported
Mach Number: 1
Brand: BUTLER
Type: TRANSFER
Brand 2: Not reported
Type 2: Not reported
Capacity: 70
Capacity2: Not reported
Continuation of 1991-2003: 80
Continuation of 1991-2003: 80
Registration Number: Not reported
Registration Owner: Not reported
Registration Year: Not reported
Perc Gal: Not reported
Registration Received: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

EM BEE CLEANERS (Continued)

S106464599

Usage (gal): Not reported
Usage (lb): Not reported
Waste (lb): Not reported
Notes: Not reported

76
ENE
1/2-1
0.577 mi.
3049 ft.

Relative:
Lower

Actual:
15 ft.

FSS, INC.
101 FRONT ST
BELFAST, ME 04915

SHWS:

Name: STINSON CANNING CO
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Facility ID: REM00447
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: UNCONTROLLED SITES
Lat/Long: 44.4297 / -69.0095
IC: TRUE
Alias: COMBINES WITH 45 FRONT STREET
Acres: 4
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 11/29/2013

ME SHWS
ME INST CONTROL
ME VCP
ME BROWNFIELDS
ME ALLSITES
ME SPILLS
ME AIRS

S107026729
N/A

INST CONTROL:

Name: STINSON CANNING CO
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Facility ID: REM00447
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.4297 / -69.0095
Institutional Control?: TRUE
Alias: Not reported
Acres: Not reported
Sub Status: Not reported
Status Date: Not reported

Name: STINSON CANNING CO
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Facility ID: REM00447
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: UNCONTROLLED SITES
Lat/Long: 44.4297 / -69.0095
Institutional Control?: TRUE
Alias: Not reported
Acres: Not reported
Sub Status: Not reported
Status Date: Not reported

Name: STINSON CANNING CO
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Facility ID: REM00447
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: BROWNFIELDS
Lat/Long: 44.4297 / -69.0095
Institutional Control?: TRUE
Alias: Not reported
Acres: Not reported
Sub Status: Not reported
Status Date: Not reported

VCP:

Name: STINSON CANNING CO
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Facility ID: REM00447
Facility status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.4297 / -69.0095
Institutional Control?: TRUE
Alias: COMBINES WITH 45 FRONT STREET
Acres: 4
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 11/29/2013

BROWNFIELDS:

Name: STINSON CANNING CO
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Facility ID: REM00447
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: BROWNFIELDS
Lat/Long: 44.4297 / -69.0095
Institutional Control?: TRUE
Alias: COMBINES WITH 45 FRONT STREET
Acres: 4
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 11/29/2013

ALLSITES:

Name: STINSON CANNING CO
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: VRAP
Lat/Long: 44.4297 / -69.0095
Institutional Control?: TRUE
Alias: COMBINES WITH 45 FRONT STREET
Acres: 4
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 11/29/2013

Name: STINSON CANNING CO
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: UNCONTROLLED SITES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Lat/Long: 44.4297 / -69.0095
Institutional Control?: TRUE
Alias: COMBINES WITH 45 FRONT STREET
Acres: 4
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 11/29/2013

Name: STINSON CANNING CO
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: BROWNFIELDS
Lat/Long: 44.4297 / -69.0095
Institutional Control?: TRUE
Alias: COMBINES WITH 45 FRONT STREET
Acres: 4
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 11/29/2013

SPILLS:

Event:

Name: FRONT STREET BOATYARD
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Spill Number: A-351-2016
Inc Tank Code: N
Inc Tank: None
Removal Flag: False
Ust Registered Flag: True
Ast Inside Flag: False
Create Date: 07/06/2016
Create By: EILDORAN
Modify Date: 12/13/2016
Modify By: EIRSHANN
Report Status: FR
Report Status: Final Report
Actual Spill Datetime: 06/30/2016
Actual Spill Date Unknown: False
Actual Spill Time Unknown: False
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
MCD Value: 27010
Further Response Action: False
Spill Type Code: 0
Spill Type: Oil Incident
Reporter Type Code: 7
Reporter Type: Other Involved Party
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: MR
Inc Location: Transportation - Marine
Inc Source Code: PI
Inc Source: Water Transportation - Pleasure Vessel
Spill Cause Code: 06
Spill Cause: Mechanical Failure - Piping/Hose

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Material Disposal Info: Front Street Shipyard's waste contractor
Spills Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DE&Password=DEPPortal1

Change:

Description: Report Status change from DRV to DQA
Date Change: 08/10/2016
Changed By: EIJWOODA

Description: Report Created with Report Status = DR
Date Change: 07/06/2016
Changed By: EILDORAN

Description: Report Status change from DR to DRV
Date Change: 07/06/2016
Changed By: EILDORAN

Description: Report Status change from DQA to FR
Date Change: 12/13/2016
Changed By: EIRSHANN

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: ANDREW NAYLOR
Title: Not reported
Company: Not reported
Address: 70 POINT AVENUE
City,State: WINTER HARBOR,ME
Country: USA
Zipcode: 04693
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: ROBERT F SHANNON

Primary Employee: False
Name: LINDA M DORAN

Media Affected:

Medium: Coastal Water

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 351
Spill Year: 2016
Create Date: 07/06/2016
Created By: EILDORAN
Modify Date: 07/06/2016
Modify By: EILDORAN
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 06/30/2016
Log Rep Prod Cd: 86
Log Rep Prod: HYDRAULIC OIL
Log Emp Name: ROBERT F SHANNON
Location: Front Street Boatyard
Log Location Town: BELFAST
Log Tank Involved: None
Notes: Not reported

Material Recovered:
Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 25
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Recovery Method: Sorbents

Spill Point:

Product:
Product Code: HYDRAULIC OIL
Product Other: Not reported
Product Amt: 7
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

Attachments:

Description: NRC Report
Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 07/06/2016

Event:

Name: FRONT STREET SHIPYARD
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Spill Number: A-293-2019
Inc Tank Code: N
Inc Tank: None
Removal Flag: False
Ust Registered Flag: True
Ast Inside Flag: False
Create Date: 05/28/2019
Create By: EIJWOODA
Modify Date: 04/26/2021
Modify By: EIJWOODA
Report Status: FR
Report Status: Final Report
Actual Spill Datetime: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Actual Spill Date Unknown: True
Actual Spill Time Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
MCD Value: 27010
Further Response Action: False
Spill Type Code: I
Spill Type: Non-Oil, Non-Hazardous Incident
Reporter Type Code: 5
Reporter Type: Anonymous
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: MA
Inc Location: Terminal - Marina
Inc Source Code: NO
Inc Source: No Source
Spill Cause Code: 00
Spill Cause: Other - No Cause
Material Disposal Info: No refuse or debris was created as a result of this investigation.
Spills Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.I.DEP&Password=DEPPortal1

Change:

Description: Report Status change from DR to DRV
Date Change: 04/20/2021
Changed By: EINCAPUT

Description: Report Status change from DRV to FR
Date Change: 04/26/2021
Changed By: EIJWOODA

Description: Report Created with Report Status = DR
Date Change: 05/28/2019
Changed By: EIJWOODA

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: NOT APPLICABLE
Title: Not reported
Company: Not reported
Address: Not reported
City,State: ,
Country: Not reported
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Primary Employee:

Primary Employee: True
Name: NINA M CAPUTO

Media Affected:

Medium: None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Log:

Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 293
Spill Year: 2019
Create Date: 05/28/2019
Created By: EIJWOODA
Modify Date: 04/20/2021
Modify By: EINCAPUT
Log Spill Type: Non-Oil, Non-Hazardous Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 05/23/2019
Log Rep Prod Cd: 00
Log Rep Prod: NONE
Log Emp Name: NINA M CAPUTO
Location: 101 Front Street, Belfast, ME 04915 Front Street Shipyard
Log Location Town: BELFAST
Log Tank Involved: None
Notes: Suspected oil discharge, pollen.

Material Recovered:

Material Recovered Type: NO
Material Recovered: None
Material Amount: 0
Material Units: gals.
Material Amt Qualifier: ESTIMATE

Recovery Method: None

Spill Point:

Product:

Product Code: NONE
Product Other: Not reported
Product Amt: 0
Product Amt Unit: oz.
Product Amt Qualifier: ACTUAL
Primary Product: True

Event:

Name: FRONT STREET SHIPYARD
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Spill Number: A-43-2021
Inc Tank Code: N
Inc Tank: None
Removal Flag: False
Ust Registered Flag: True
Ast Inside Flag: False
Create Date: 02/05/2021
Create By: EINCAPUT
Modify Date: 06/14/2022
Modify By: SPILLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Report Status: FR
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Actual Spill Time Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
MCD Value: 27010
Further Response Action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 4
Reporter Type: Public Official
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: MA
Inc Location: Terminal - Marina
Inc Source Code: PI
Inc Source: Water Transportation - Pleasure Vessel
Spill Cause Code: 30
Spill Cause: Other - Known Cause
Material Disposal Info: Deployed boom was collected by the United States Coast Guard and disposed of thru their waste stream,
Spills Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEPP&Password=DEPPortal1

Change:

Description: Report Created with Report Status = DR
Date Change: 02/05/2021
Changed By: EINCAPUT

Description: Report Status change from DR to DRV
Date Change: 02/05/2021
Changed By: EINCAPUT

Description: Report Status change from DRV to DR
Date Change: 04/20/2021
Changed By: EIJWOODA

Description: Report Status change from DR to DRV
Date Change: 05/26/2022
Changed By: SOM\\Nina.M.Caputo

Description: Report Status change from DRV to FR
Date Change: 06/14/2022
Changed By: SOM\\Jon.L.Woodard

Contact:

Contact Type: Subject/Spiller
Potential RP: True
Name: ERWIN KONESNI
Title: Not reported
Company: Not reported
Address: Not reported
City,State: ,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Country: Not reported
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: NINA M CAPUTO

Media Affected:
Medium: Coastal Water

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 43
Spill Year: 2021
Create Date: 02/05/2021
Created By: EINCAPUT
Modify Date: 05/26/2022
Modify By: SPILLS
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 02/04/2021
Log Rep Prod Cd: 29
Log Rep Prod: DIESEL
Log Emp Name: NINA M CAPUTO
Location: 101 FRONT STREET
Log Location Town: BELFAST
Log Tank Involved: None
Notes: Sunken sailboat, estimated 3 gallons on-board

Material Recovered:
Material Recovered Type: OM
Material Recovered: Other Material
Material Amount: 20
Material Units: lbs.
Material Amt Qualifier: ESTIMATE

Recovery Method: Sorbents

Spill Point:

Product:
Product Code: DIESEL
Product Other: Not reported
Product Amt: 3
Product Amt Unit: gals.
Product Amt Qualifier: ESTIMATE
Primary Product: True

Attachments:
Description: NRC Report

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Attach Type: Paper Attach
File Name: Not reported
File Code: Not reported
File Size: Not reported
File Modify Date: 02/05/2021

Event:

Name: FRONT STREET SHIPYARD
Address: 101 FRONT STREET
City,State,Zip: BELFAST, ME
Spill Number: A-37-2020
Inc Tank Code: N
Inc Tank: None
Removal Flag: False
Ust Registered Flag: True
Ast Inside Flag: False
Create Date: 01/31/2020
Create By: EIJWOODA
Modify Date: 08/07/2020
Modify By: EIRKROUT
Report Status: FR
Report Status: Final Report
Actual Spill Datetime: Not reported
Actual Spill Date Unknown: True
Actual Spill Time Unknown: True
Number Wells At Risk: 0
Number Wells Impacted: 0
Dtree Completed Flag: False
MCD Value: 27010
Further Response Action: False
Spill Type Code: O
Spill Type: Oil Incident
Reporter Type Code: 3
Reporter Type: Citizen Complaint
Detection Method Code: L
Detection Method: Visual Product
Inc Location Code: CM
Inc Location: Business - Commercial
Inc Source Code: NS
Inc Source: No Source Found By Responder
Spill Cause Code: 18
Spill Cause: Other - Unknown
Material Disposal Info: not applicable
Spills Document Search: https://fortisport.maine.gov/fortisportal/dddisplayqueryprompts.aspx?Database=OfficeDocs&Query=DEP_Spills&QuerySet=Portal_Queries&User=Portal.DEPPortal1

Change:

Description: Report Status change from DQA to FR
Date Change: 08/07/2020
Changed By: EIRKROUT

Description: Report Status change from DR to DRV
Date Change: 06/26/2020
Changed By: EINTHOMP

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Description: Report Created with Report Status = DR
Date Change: 01/31/2020
Changed By: EIJWOODA

Description: Report Status change from DRV to DQA
Date Change: 07/02/2020
Changed By: EIJWOODA

Contact:
Contact Type: Subject/Spiller
Potential RP: True
Name: UNKNOWN
Title: Not reported
Company: Not reported
Address: Not reported
City,State: ,
Country: Not reported
Zipcode: Not reported
Phone/Ext: /
Comments: Not reported

Primary Employee:
Primary Employee: True
Name: NATHAN THOMPSON

Media Affected:
Medium: Coastal Water

Log:
Spill Void Flag: False
Spill Office: Augusta
Spill Off Sequence: 37
Spill Year: 2020
Create Date: 01/31/2020
Created By: EIJWOODA
Modify Date: 01/31/2020
Modify By: EIJWOODA
Log Spill Type: Oil Incident
Log Spill Datetime: Not reported
Spill Time Unk: False
Spill Dt Unknown: False
Log Rep Dt Tm: 01/25/2020
Log Rep Prod Cd: 80
Log Rep Prod: UNSPECIFIED OIL
Log Emp Name: NATHAN THOMPSON
Location: Main St. & Front St.
Log Location Town: BELFAST
Log Tank Involved: None
Notes: sheen in water

Material Recovered:
Material Recovered Type: SP
Material Recovered: Spilled Product
Material Amount: 0
Material Units: gals.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Material Amt Qualifier: ACTUAL

Recovery Method: None

Spill Point:

Product:

Product Code: UNSPECIFIED OIL
Product Other: Not reported
Product Amt: Not reported
Product Amt Unit: Not reported
Product Amt Qualifier: UNKNOWN
Primary Product: True

AIRS:

Name: FSS, INC.
Address: 101 FRONT ST
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: 2018
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: Not reported
Lead: Not reported
Permit Issued Date: 10/18/2012
Permit Expiration Date: 10/18/2022
Facility Category: Synthetic Minor
Lead: Not reported

Name: FSS, INC.
Address: 101 FRONT ST
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: 2015
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: Not reported
Lead: Not reported
Permit Issued Date: Not reported
Permit Expiration Date: Not reported
Facility Category: Not reported
Lead: Not reported

Name: FSS, INC.
Address: 101 FRONT ST
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: Not reported
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: Not reported
Lead: Not reported
Permit Issued Date: 10/18/2012
Permit Expiration Date: 10/18/2022
Facility Category: Synthetic Minor
Lead: Not reported

Name: FSS, INC.
Address: 101 FRONT ST
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: 2012
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: n/a

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FSS, INC. (Continued)

S107026729

Lead: Not reported
Permit Issued Date: Not reported
Permit Expiration Date: Not reported
Facility Category: Not reported
Lead: Not reported

Name: FSS, INC.
Address: 101 FRONT ST
City,State,Zip: BELFAST, ME 04915
Facility ID: Not reported
Year: 2011
NH3: Not reported
CO: Not reported
NO2: Not reported
PM10: Not reported
PM2.5: Not reported
SO2: Not reported
VOC: Not reported
VOC1: Not reported
Total Non_Methane Organic: Not reported
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Lat/Long: Not reported
SIC: Not reported
NAICS: Not reported
EDR ID: n/a
Lead: Not reported
Permit Issued Date: Not reported
Permit Expiration Date: Not reported
Facility Category: Not reported
Lead: Not reported

77
ENE
1/2-1
0.591 mi.
3120 ft.

**BELFAST GAS LIGHT CO
MARKET STREET
BELFAST, ME 04915**

**EDR MGP 1008408906
N/A**

**Relative:
Lower
Actual:
48 ft.**

Manufactured Gas Plants:
Alternate Name: BELFAST ILLUMINATING CO; BELFAST LIGHT AND POWER; PENOBSCOT BAY
ELECTRIC CO. No additional information available

78
ENE
1/2-1
0.624 mi.
3297 ft.

**BELFAST-MOOSEHEAD RAILROAD
11 WATER STREET
BELFAST, ME**

**ME SHWS 1000227886
ME ALLSITES N/A**

**Relative:
Lower
Actual:
14 ft.**

SHWS:
Name: BELFAST-MOOSEHEAD RAILROAD
Address: 11 WATER STREET
City,State,Zip: BELFAST, ME
Facility ID: REM00445
Facility Status: REMEDY IN PLACE: CLOSED
Program Type: UNCONTROLLED SITES
Lat/Long: 44.42821 / -69.00729
IC: FALSE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BELFAST-MOOSEHEAD RAILROAD (Continued)

1000227886

Alias: Not reported
Acres: 0
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 07/10/2008

ALLSITES:

Name: BELFAST-MOOSEHEAD RAILROAD
Address: 11 WATER STREET
City,State,Zip: BELFAST, ME
Status: REMEDY IN PLACE: CLOSED
Program Type: UNCONTROLLED SITES
Lat/Long: 44.42821 / -69.00729
Institutional Control?: FALSE
Alias: Not reported
Acres: 0
Sub Status: UNDERTAKING POST-CLOSURE OBLIGATIONS
Status Date: 07/10/2008

Count: 4 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BELFAST	S106789099	CHRISTIES SERVICE STATION	RT 1 - SEARSPORT AVE		ME LUST
BELFAST	S106788918	SAMPSON SUPERMARKET BELFAST PLAZA	MAIN ST		ME LUST
BELFAST	S111789756	MARITIME FARMS 51	MAIN STREET		ME LUST
BELFAST	S118561357	BELFAST ARMORY	U. S. ROUTE 1		ME LAST

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 01/25/2023	Source: EPA
Date Data Arrived at EDR: 02/03/2023	Telephone: N/A
Date Made Active in Reports: 02/28/2023	Last EDR Contact: 03/01/2023
Number of Days to Update: 25	Next Scheduled EDR Contact: 04/10/2023
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 01/25/2023	Source: EPA
Date Data Arrived at EDR: 02/02/2023	Telephone: N/A
Date Made Active in Reports: 02/28/2023	Last EDR Contact: 03/01/2023
Number of Days to Update: 26	Next Scheduled EDR Contact: 04/10/2023
	Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

Lists of Federal Delisted NPL sites

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 01/25/2023
Date Data Arrived at EDR: 02/02/2023
Date Made Active in Reports: 02/28/2023
Number of Days to Update: 26

Source: EPA
Telephone: N/A
Last EDR Contact: 03/01/2023
Next Scheduled EDR Contact: 04/10/2023
Data Release Frequency: Quarterly

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 08/25/2022
Date Data Arrived at EDR: 09/06/2022
Date Made Active in Reports: 12/05/2022
Number of Days to Update: 90

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 12/21/2022
Next Scheduled EDR Contact: 04/10/2023
Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly known as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 01/25/2023
Date Data Arrived at EDR: 02/02/2023
Date Made Active in Reports: 02/28/2023
Number of Days to Update: 26

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 03/01/2023
Next Scheduled EDR Contact: 04/24/2023
Data Release Frequency: Quarterly

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 01/25/2023	Source: EPA
Date Data Arrived at EDR: 02/02/2023	Telephone: 800-424-9346
Date Made Active in Reports: 02/28/2023	Last EDR Contact: 03/01/2023
Number of Days to Update: 26	Next Scheduled EDR Contact: 04/24/2023
	Data Release Frequency: Quarterly

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 11/21/2022	Source: EPA
Date Data Arrived at EDR: 11/21/2022	Telephone: 800-424-9346
Date Made Active in Reports: 12/05/2022	Last EDR Contact: 12/21/2022
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/03/2023
	Data Release Frequency: Quarterly

Lists of Federal RCRA TSD facilities

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 11/21/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/21/2022	Telephone: (888) 372-7341
Date Made Active in Reports: 12/05/2022	Last EDR Contact: 12/21/2022
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/03/2023
	Data Release Frequency: Quarterly

Lists of Federal RCRA generators

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 11/21/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/21/2022	Telephone: (888) 372-7341
Date Made Active in Reports: 12/05/2022	Last EDR Contact: 12/21/2022
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/03/2023
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 11/21/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/21/2022	Telephone: (888) 372-7341
Date Made Active in Reports: 12/05/2022	Last EDR Contact: 12/21/2022
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/03/2023
	Data Release Frequency: Quarterly

RCRA-VSQG: RCRA - Very Small Quantity Generators (Formerly Conditionally Exempt Small Quantity Generators)

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 11/21/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/21/2022	Telephone: (888) 372-7341
Date Made Active in Reports: 12/05/2022	Last EDR Contact: 12/21/2022
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/03/2023
	Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 11/02/2022	Source: Department of the Navy
Date Data Arrived at EDR: 11/08/2022	Telephone: 843-820-7326
Date Made Active in Reports: 01/10/2023	Last EDR Contact: 02/03/2023
Number of Days to Update: 63	Next Scheduled EDR Contact: 05/22/2023
	Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 10/27/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/16/2022	Telephone: 703-603-0695
Date Made Active in Reports: 02/09/2023	Last EDR Contact: 02/21/2023
Number of Days to Update: 85	Next Scheduled EDR Contact: 06/05/2023
	Data Release Frequency: Varies

US INST CONTROLS: Institutional Controls Sites List

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 10/27/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/16/2022	Telephone: 703-603-0695
Date Made Active in Reports: 02/09/2023	Last EDR Contact: 02/21/2023
Number of Days to Update: 85	Next Scheduled EDR Contact: 06/05/2023
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 12/12/2022

Date Data Arrived at EDR: 12/14/2022

Date Made Active in Reports: 12/19/2022

Number of Days to Update: 5

Source: National Response Center, United States Coast Guard

Telephone: 202-267-2180

Last EDR Contact: 12/14/2022

Next Scheduled EDR Contact: 04/03/2023

Data Release Frequency: Quarterly

Lists of state- and tribal hazardous waste facilities

SHWS: Remediation Sites List

Uncontrolled Sites locations included in the Remediation Sites List.

Date of Government Version: 10/10/2022

Date Data Arrived at EDR: 10/10/2022

Date Made Active in Reports: 12/28/2022

Number of Days to Update: 79

Source: Department of Environmental Protection

Telephone: 207-287-7688

Last EDR Contact: 01/11/2023

Next Scheduled EDR Contact: 04/24/2023

Data Release Frequency: Semi-Annually

Lists of state and tribal landfills and solid waste disposal facilities

SWF/LF: Solid Waste Facility List

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 10/27/2022

Date Data Arrived at EDR: 10/28/2022

Date Made Active in Reports: 01/11/2023

Number of Days to Update: 75

Source: Department of Environmental Protection

Telephone: 207-287-2651

Last EDR Contact: 01/30/2023

Next Scheduled EDR Contact: 05/15/2023

Data Release Frequency: Quarterly

LCP: Municipal Landfill Closure Database

The Municipal Landfill Closure and Remediation Program was established in 1988 to assist nearly 400 municipalities with the closure of their unlicensed municipal solid waste landfills. Project managers in this program have conducted site investigations and provided technical engineering assistance to aid municipalities in this process. Funding to accomplish this goal was provided by the state, utilizing several bonds that supported a 75% state cost sharing reimbursement process.

Date of Government Version: 11/14/2011

Date Data Arrived at EDR: 11/15/2011

Date Made Active in Reports: 11/30/2011

Number of Days to Update: 15

Source: Department of Environmental Protection

Telephone: 207-287-8552

Last EDR Contact: 01/30/2023

Next Scheduled EDR Contact: 05/15/2023

Data Release Frequency: No Update Planned

Lists of state and tribal leaking storage tanks

LAST: HOSS Database

A listing of leaking aboveground storage tanks.

Date of Government Version: 10/22/2022

Date Data Arrived at EDR: 10/24/2022

Date Made Active in Reports: 01/11/2023

Number of Days to Update: 79

Source: Department of Environmental Protection

Telephone: 207-287-2651

Last EDR Contact: 01/24/2023

Next Scheduled EDR Contact: 05/08/2023

Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

LUST: Hazardous Material and Oil Spill System Database (H.O.S.S.)

Leaking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage tank incidents. Not all states maintain these records, and the information stored varies by state.

Date of Government Version: 10/22/2022	Source: Department of Environmental Protection
Date Data Arrived at EDR: 10/24/2022	Telephone: 207-287-2651
Date Made Active in Reports: 01/11/2023	Last EDR Contact: 01/24/2023
Number of Days to Update: 79	Next Scheduled EDR Contact: 05/08/2023
	Data Release Frequency: Quarterly

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 10/14/2022	Source: EPA Region 7
Date Data Arrived at EDR: 12/06/2022	Telephone: 913-551-7003
Date Made Active in Reports: 03/03/2023	Last EDR Contact: 01/17/2023
Number of Days to Update: 87	Next Scheduled EDR Contact: 05/01/2023
	Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 11/23/2022	Source: EPA Region 8
Date Data Arrived at EDR: 12/06/2022	Telephone: 303-312-6271
Date Made Active in Reports: 03/03/2023	Last EDR Contact: 01/17/2023
Number of Days to Update: 87	Next Scheduled EDR Contact: 05/01/2023
	Data Release Frequency: Varies

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 11/23/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 12/06/2022	Telephone: 415-972-3372
Date Made Active in Reports: 03/03/2023	Last EDR Contact: 01/17/2023
Number of Days to Update: 87	Next Scheduled EDR Contact: 05/01/2023
	Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 11/26/2022	Source: EPA Region 4
Date Data Arrived at EDR: 12/06/2022	Telephone: 404-562-8677
Date Made Active in Reports: 03/03/2023	Last EDR Contact: 01/17/2023
Number of Days to Update: 87	Next Scheduled EDR Contact: 05/01/2023
	Data Release Frequency: Varies

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 10/14/2022	Source: EPA, Region 5
Date Data Arrived at EDR: 12/06/2022	Telephone: 312-886-7439
Date Made Active in Reports: 03/03/2023	Last EDR Contact: 01/17/2023
Number of Days to Update: 87	Next Scheduled EDR Contact: 05/01/2023
	Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 04/20/2022	Source: EPA Region 10
Date Data Arrived at EDR: 06/13/2022	Telephone: 206-553-2857
Date Made Active in Reports: 08/16/2022	Last EDR Contact: 01/17/2023
Number of Days to Update: 64	Next Scheduled EDR Contact: 05/01/2023
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 11/23/2022	Source: EPA Region 6
Date Data Arrived at EDR: 12/06/2022	Telephone: 214-665-6597
Date Made Active in Reports: 03/03/2023	Last EDR Contact: 01/17/2023
Number of Days to Update: 87	Next Scheduled EDR Contact: 05/01/2023
	Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 10/19/2022	Source: EPA Region 1
Date Data Arrived at EDR: 12/06/2022	Telephone: 617-918-1313
Date Made Active in Reports: 03/03/2023	Last EDR Contact: 01/17/2023
Number of Days to Update: 87	Next Scheduled EDR Contact: 05/01/2023
	Data Release Frequency: Varies

Lists of state and tribal registered storage tanks

FEMA UST: Underground Storage Tank Listing
A listing of all FEMA owned underground storage tanks.

Date of Government Version: 10/14/2021	Source: FEMA
Date Data Arrived at EDR: 11/05/2021	Telephone: 202-646-5797
Date Made Active in Reports: 02/01/2022	Last EDR Contact: 12/28/2022
Number of Days to Update: 88	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

UST: Underground Storage Tank Database
Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA) and must be registered with the state department responsible for administering the UST program. Available information varies by state program.

Date of Government Version: 11/01/2022	Source: Department of Environmental Protection
Date Data Arrived at EDR: 11/03/2022	Telephone: 207-287-2651
Date Made Active in Reports: 01/24/2023	Last EDR Contact: 02/07/2023
Number of Days to Update: 82	Next Scheduled EDR Contact: 05/22/2023
	Data Release Frequency: Quarterly

AST 2: Registered Petroleum Tanks Database
Aboveground storage tank site locations registered with the Bureau of Remediation and Waste Management.

Date of Government Version: 09/26/2022	Source: Department of Environmental Protection
Date Data Arrived at EDR: 09/27/2022	Telephone: 207-287-2651
Date Made Active in Reports: 12/13/2022	Last EDR Contact: 12/22/2022
Number of Days to Update: 77	Next Scheduled EDR Contact: 03/20/2023
	Data Release Frequency: Quarterly

AST: Aboveground Storage Tanks
Registered Aboveground Storage Tanks.

Date of Government Version: 12/31/2021	Source: Maine Emergency Management Agency
Date Data Arrived at EDR: 09/07/2022	Telephone: 207-626-4503
Date Made Active in Reports: 11/22/2022	Last EDR Contact: 03/02/2023
Number of Days to Update: 76	Next Scheduled EDR Contact: 06/19/2023
	Data Release Frequency: Annually

INDIAN UST R4: Underground Storage Tanks on Indian Land
The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 11/23/2022
Date Data Arrived at EDR: 12/06/2022
Date Made Active in Reports: 03/03/2023
Number of Days to Update: 87

Source: EPA Region 4
Telephone: 404-562-9424
Last EDR Contact: 01/17/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 11/23/2022
Date Data Arrived at EDR: 12/06/2022
Date Made Active in Reports: 03/03/2023
Number of Days to Update: 87

Source: EPA Region 8
Telephone: 303-312-6137
Last EDR Contact: 01/17/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 10/14/2022
Date Data Arrived at EDR: 12/06/2022
Date Made Active in Reports: 03/03/2023
Number of Days to Update: 87

Source: EPA Region 7
Telephone: 913-551-7003
Last EDR Contact: 01/17/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 04/20/2022
Date Data Arrived at EDR: 06/13/2022
Date Made Active in Reports: 08/16/2022
Number of Days to Update: 64

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 01/17/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 10/19/2022
Date Data Arrived at EDR: 12/06/2022
Date Made Active in Reports: 03/03/2023
Number of Days to Update: 87

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 01/17/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 10/14/2022
Date Data Arrived at EDR: 12/06/2022
Date Made Active in Reports: 03/03/2023
Number of Days to Update: 87

Source: EPA Region 5
Telephone: 312-886-6136
Last EDR Contact: 01/17/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 11/23/2022
Date Data Arrived at EDR: 12/06/2022
Date Made Active in Reports: 03/03/2023
Number of Days to Update: 87

Source: EPA Region 6
Telephone: 214-665-7591
Last EDR Contact: 01/17/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 11/23/2022
Date Data Arrived at EDR: 12/06/2022
Date Made Active in Reports: 03/03/2023
Number of Days to Update: 87

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 01/17/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Varies

State and tribal institutional control / engineering control registries

INST CONTROL: Remediation Sites List

Sites with Institutional Controls in place included in the Remediation Sites List. Institutional Controls are legally enforceable site use restrictions recorded on the property deed and therefore operate in perpetuity regardless of change in site ownership.

Date of Government Version: 10/10/2022
Date Data Arrived at EDR: 10/10/2022
Date Made Active in Reports: 12/28/2022
Number of Days to Update: 79

Source: Department of Environmental Protection
Telephone: 207-287-7688
Last EDR Contact: 01/11/2023
Next Scheduled EDR Contact: 04/24/2023
Data Release Frequency: Semi-Annually

Lists of state and tribal voluntary cleanup sites

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015
Date Data Arrived at EDR: 09/29/2015
Date Made Active in Reports: 02/18/2016
Number of Days to Update: 142

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 12/13/2022
Next Scheduled EDR Contact: 04/03/2023
Data Release Frequency: Varies

VCP: Remediation Sites List

Voluntary Response Action Program sites included in the Remediation Sites List. VRAP promotes the investigation, remediation and redevelopment of contaminated properties by offering liability assurances/protections from state enforcement actions for applicants to the program.

Date of Government Version: 10/10/2022
Date Data Arrived at EDR: 10/10/2022
Date Made Active in Reports: 12/28/2022
Number of Days to Update: 79

Source: Department of Environmental Protection
Telephone: 207-287-7688
Last EDR Contact: 01/11/2023
Next Scheduled EDR Contact: 04/24/2023
Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 07/08/2021
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

Lists of state and tribal brownfield sites

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

BROWNFIELDS: Remediation Sites List

Brownfields site locations included in the Remediation Sites List. Brownfields are "Real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant".

Date of Government Version: 10/10/2022
Date Data Arrived at EDR: 10/10/2022
Date Made Active in Reports: 12/28/2022
Number of Days to Update: 79

Source: Department of Environmental Protection
Telephone: 207-287-7688
Last EDR Contact: 01/11/2023
Next Scheduled EDR Contact: 04/24/2023
Data Release Frequency: Varies

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 02/23/2022
Date Data Arrived at EDR: 03/10/2022
Date Made Active in Reports: 03/10/2022
Number of Days to Update: 0

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 12/07/2022
Next Scheduled EDR Contact: 03/27/2023
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

SWRCY: Recycling Facilities

A listing of municipal collection sites for electronic waste and mercury-added products.

Date of Government Version: 03/04/2022
Date Data Arrived at EDR: 03/30/2022
Date Made Active in Reports: 06/27/2022
Number of Days to Update: 89

Source: Department of Environmental Protection
Telephone: 207-287-2651
Last EDR Contact: 12/29/2022
Next Scheduled EDR Contact: 04/10/2023
Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 01/20/2023
Next Scheduled EDR Contact: 05/08/2023
Data Release Frequency: Varies

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 01/13/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land

A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 04/01/2014
Date Data Arrived at EDR: 08/06/2014
Date Made Active in Reports: 01/29/2015
Number of Days to Update: 176

Source: Department of Health & Human Services, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 01/27/2023
Next Scheduled EDR Contact: 05/08/2023
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 01/06/2023
Date Data Arrived at EDR: 02/02/2023
Date Made Active in Reports: 02/10/2023
Number of Days to Update: 8

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 02/02/2023
Next Scheduled EDR Contact: 06/05/2023
Data Release Frequency: No Update Planned

ALLSITES: Remediation Sites List

The Sites List Database is the public record of information regarding properties that have been, are now, or are planned to be addressed by the Division of Remediation of the Bureau of Remediation and Waste Management. This database is not intended to be a comprehensive, all-inclusive source of information regarding the properties listed therein.

Date of Government Version: 10/10/2022
Date Data Arrived at EDR: 10/10/2022
Date Made Active in Reports: 12/28/2022
Number of Days to Update: 79

Source: Department of Environmental Protection
Telephone: 207-287-7688
Last EDR Contact: 01/11/2023
Next Scheduled EDR Contact: 04/24/2023
Data Release Frequency: Quarterly

DEL HWS: Sites Removed from the Uncontrolled Sites List

Sites are removed from the List once it is determined that they are not "worthy of listing". This term is used as there are a number of reasons to remove a site from the List, including: no file exists, the site was reported as an oil spill, there is no evidence of a hazardous substance release or based on an investigation the site is referred to another program unrelated to hazardous substance or hazardous waste. Sites are removed on a case by case basis. The USP intends this to be an on-going process, as time and resources allow.

Date of Government Version: 10/10/2022
Date Data Arrived at EDR: 10/10/2022
Date Made Active in Reports: 12/28/2022
Number of Days to Update: 79

Source: Department of Environmental Protection
Telephone: 207-287-7688
Last EDR Contact: 01/11/2023
Next Scheduled EDR Contact: 04/24/2023
Data Release Frequency: Semi-Annually

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 01/06/2023
Date Data Arrived at EDR: 02/02/2023
Date Made Active in Reports: 02/10/2023
Number of Days to Update: 8

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 02/02/2023
Next Scheduled EDR Contact: 06/05/2023
Data Release Frequency: Quarterly

Local Land Records

LIENS: Environmental Liens Information Listing

An Environmental Lien is a charge, security, or encumbrance upon title to a property to secure the payment of a cost, damage, debt, obligation, or duty arising out of response actions, cleanup, or other remediation of hazardous substances or petroleum products upon a property, including (but not limited to) liens imposed pursuant to CERCLA 42 USC 9607(1) and similar state or local laws. In other words: a lien placed upon a property's title due to an environmental condition

Date of Government Version: 10/26/2022
Date Data Arrived at EDR: 10/26/2022
Date Made Active in Reports: 01/11/2023
Number of Days to Update: 77

Source: Department of Environmental Protection
Telephone: 207-287-2651
Last EDR Contact: 01/23/2023
Next Scheduled EDR Contact: 05/08/2023
Data Release Frequency: Varies

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 01/25/2023
Date Data Arrived at EDR: 02/02/2023
Date Made Active in Reports: 02/28/2023
Number of Days to Update: 26

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 03/01/2023
Next Scheduled EDR Contact: 04/10/2023
Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 09/19/2022
Date Data Arrived at EDR: 09/19/2022
Date Made Active in Reports: 09/30/2022
Number of Days to Update: 11

Source: U.S. Department of Transportation
Telephone: 202-366-4555
Last EDR Contact: 12/14/2022
Next Scheduled EDR Contact: 04/03/2023
Data Release Frequency: Quarterly

SPILLS: Hazardous Material and Oil Spill System Database

The database contains surface, groundwater and hazardous material spills.

Date of Government Version: 10/22/2022
Date Data Arrived at EDR: 10/24/2022
Date Made Active in Reports: 01/11/2023
Number of Days to Update: 79

Source: Department of Environmental Protection
Telephone: 207-287-2651
Last EDR Contact: 01/24/2023
Next Scheduled EDR Contact: 05/08/2023
Data Release Frequency: Quarterly

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 11/05/2012
Date Data Arrived at EDR: 01/03/2013
Date Made Active in Reports: 01/25/2013
Number of Days to Update: 22

Source: FirstSearch
Telephone: N/A
Last EDR Contact: 01/03/2013
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 06/07/2001	Source: FirstSearch
Date Data Arrived at EDR: 01/03/2013	Telephone: N/A
Date Made Active in Reports: 03/06/2013	Last EDR Contact: 01/03/2013
Number of Days to Update: 62	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 11/21/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/21/2022	Telephone: (888) 372-7341
Date Made Active in Reports: 12/05/2022	Last EDR Contact: 12/21/2022
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/03/2023
	Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 11/01/2022	Source: U.S. Army Corps of Engineers
Date Data Arrived at EDR: 11/10/2022	Telephone: 202-528-4285
Date Made Active in Reports: 02/09/2023	Last EDR Contact: 02/14/2023
Number of Days to Update: 91	Next Scheduled EDR Contact: 05/29/2023
	Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 06/07/2021	Source: USGS
Date Data Arrived at EDR: 07/13/2021	Telephone: 888-275-8747
Date Made Active in Reports: 03/09/2022	Last EDR Contact: 01/13/2023
Number of Days to Update: 239	Next Scheduled EDR Contact: 04/24/2023
	Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 04/02/2018	Source: U.S. Geological Survey
Date Data Arrived at EDR: 04/11/2018	Telephone: 888-275-8747
Date Made Active in Reports: 11/06/2019	Last EDR Contact: 01/03/2023
Number of Days to Update: 574	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 07/30/2021
Date Data Arrived at EDR: 02/03/2023
Date Made Active in Reports: 02/10/2023
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 02/02/2023
Next Scheduled EDR Contact: 05/22/2023
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 09/19/2022
Date Data Arrived at EDR: 09/20/2022
Date Made Active in Reports: 12/22/2022
Number of Days to Update: 93

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 12/14/2022
Next Scheduled EDR Contact: 04/03/2023
Data Release Frequency: Quarterly

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013
Date Data Arrived at EDR: 03/21/2014
Date Made Active in Reports: 06/17/2014
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 01/30/2023
Next Scheduled EDR Contact: 05/15/2023
Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017
Date Data Arrived at EDR: 05/08/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 73

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 02/03/2023
Next Scheduled EDR Contact: 05/15/2023
Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 06/17/2020
Date Made Active in Reports: 09/10/2020
Number of Days to Update: 85

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 12/12/2022
Next Scheduled EDR Contact: 03/27/2023
Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/31/2021
Date Data Arrived at EDR: 11/01/2022
Date Made Active in Reports: 02/09/2023
Number of Days to Update: 100

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 02/16/2023
Next Scheduled EDR Contact: 05/29/2023
Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 10/17/2022
Date Data Arrived at EDR: 10/18/2022
Date Made Active in Reports: 01/10/2023
Number of Days to Update: 84

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 01/18/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 01/25/2023
Date Data Arrived at EDR: 02/02/2023
Date Made Active in Reports: 02/28/2023
Number of Days to Update: 26

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 03/01/2023
Next Scheduled EDR Contact: 06/12/2023
Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 04/27/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 05/10/2022
Number of Days to Update: 6

Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 01/17/2023
Next Scheduled EDR Contact: 05/01/2023
Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 10/27/2022	Source: EPA
Date Data Arrived at EDR: 11/01/2022	Telephone: 202-564-6023
Date Made Active in Reports: 11/15/2022	Last EDR Contact: 03/01/2023
Number of Days to Update: 14	Next Scheduled EDR Contact: 05/15/2023
	Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 01/20/2022	Source: EPA
Date Data Arrived at EDR: 01/20/2022	Telephone: 202-566-0500
Date Made Active in Reports: 03/25/2022	Last EDR Contact: 01/04/2023
Number of Days to Update: 64	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/23/2016	Telephone: 202-564-2501
Date Made Active in Reports: 02/10/2017	Last EDR Contact: 12/28/2022
Number of Days to Update: 79	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Quarterly

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009	Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 08/18/2017
Number of Days to Update: 25	Next Scheduled EDR Contact: 12/04/2017
	Data Release Frequency: No Update Planned

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009	Source: EPA
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 08/18/2017
Number of Days to Update: 25	Next Scheduled EDR Contact: 12/04/2017
	Data Release Frequency: No Update Planned

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 10/26/2022	Source: Nuclear Regulatory Commission
Date Data Arrived at EDR: 11/22/2022	Telephone: 301-415-7169
Date Made Active in Reports: 12/05/2022	Last EDR Contact: 01/17/2023
Number of Days to Update: 13	Next Scheduled EDR Contact: 05/01/2023
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

COAL ASH DOE: Steam-Electric Plant Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2020	Source: Department of Energy
Date Data Arrived at EDR: 11/30/2021	Telephone: 202-586-8719
Date Made Active in Reports: 02/22/2022	Last EDR Contact: 03/03/2023
Number of Days to Update: 84	Next Scheduled EDR Contact: 06/12/2023
	Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 01/12/2017	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/05/2019	Telephone: N/A
Date Made Active in Reports: 11/11/2019	Last EDR Contact: 02/27/2023
Number of Days to Update: 251	Next Scheduled EDR Contact: 06/12/2023
	Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 09/13/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/06/2019	Telephone: 202-566-0517
Date Made Active in Reports: 02/10/2020	Last EDR Contact: 02/03/2023
Number of Days to Update: 96	Next Scheduled EDR Contact: 05/15/2023
	Data Release Frequency: Varies

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 07/01/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 07/01/2019	Telephone: 202-343-9775
Date Made Active in Reports: 09/23/2019	Last EDR Contact: 12/20/2022
Number of Days to Update: 84	Next Scheduled EDR Contact: 04/10/2023
	Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2007
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/02/2020
Date Data Arrived at EDR: 01/28/2020
Date Made Active in Reports: 04/17/2020
Number of Days to Update: 80

Source: Department of Transportation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 01/24/2023
Next Scheduled EDR Contact: 05/08/2023
Data Release Frequency: Quarterly

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 09/30/2022
Date Data Arrived at EDR: 10/21/2022
Date Made Active in Reports: 01/10/2023
Number of Days to Update: 81

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 01/03/2023
Next Scheduled EDR Contact: 04/17/2023
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2019
Date Data Arrived at EDR: 03/02/2022
Date Made Active in Reports: 03/25/2022
Number of Days to Update: 23

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 12/21/2022
Next Scheduled EDR Contact: 04/03/2023
Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 01/06/2023
Next Scheduled EDR Contact: 04/17/2023
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 07/26/2021
Date Data Arrived at EDR: 07/27/2021
Date Made Active in Reports: 10/22/2021
Number of Days to Update: 87

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 01/30/2023
Next Scheduled EDR Contact: 05/15/2023
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 08/30/2019
Date Data Arrived at EDR: 11/15/2019
Date Made Active in Reports: 01/28/2020
Number of Days to Update: 74

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 02/13/2023
Next Scheduled EDR Contact: 05/29/2023
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 01/25/2023
Date Data Arrived at EDR: 02/02/2023
Date Made Active in Reports: 02/28/2023
Number of Days to Update: 26

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 03/01/2023
Next Scheduled EDR Contact: 04/10/2023
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931 and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust.

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data

A listing of minor source facilities.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

MINES VIOLATIONS: MSHA Violation Assessment Data

Mines violation and assessment information. Department of Labor, Mine Safety & Health Administration.

Date of Government Version: 11/29/2022
Date Data Arrived at EDR: 11/30/2022
Date Made Active in Reports: 12/22/2022
Number of Days to Update: 22

Source: DOL, Mine Safety & Health Administration
Telephone: 202-693-9424
Last EDR Contact: 02/23/2023
Next Scheduled EDR Contact: 06/12/2023
Data Release Frequency: Quarterly

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 11/07/2022
Date Data Arrived at EDR: 11/17/2022
Date Made Active in Reports: 02/10/2023
Number of Days to Update: 85

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 02/22/2023
Next Scheduled EDR Contact: 06/05/2023
Data Release Frequency: Semi-Annually

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 05/06/2020
Date Data Arrived at EDR: 05/27/2020
Date Made Active in Reports: 08/13/2020
Number of Days to Update: 78

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 02/24/2023
Next Scheduled EDR Contact: 06/05/2023
Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 02/24/2023
Next Scheduled EDR Contact: 06/05/2023
Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 09/13/2022
Date Data Arrived at EDR: 09/14/2022
Date Made Active in Reports: 12/05/2022
Number of Days to Update: 82

Source: Department of Interior
Telephone: 202-208-2609
Last EDR Contact: 03/01/2023
Next Scheduled EDR Contact: 06/19/2023
Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 08/03/2022
Date Data Arrived at EDR: 08/25/2022
Date Made Active in Reports: 10/24/2022
Number of Days to Update: 60

Source: EPA
Telephone: (617) 918-1111
Last EDR Contact: 02/28/2023
Next Scheduled EDR Contact: 06/12/2023
Data Release Frequency: Quarterly

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 09/25/2022
Date Data Arrived at EDR: 09/30/2022
Date Made Active in Reports: 12/22/2022
Number of Days to Update: 83

Source: Environmental Protection Agency
Telephone: 202-564-2280
Last EDR Contact: 01/04/2023
Next Scheduled EDR Contact: 04/17/2023
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 11/09/2021	Source: Department of Defense
Date Data Arrived at EDR: 10/20/2022	Telephone: 703-704-1564
Date Made Active in Reports: 01/10/2023	Last EDR Contact: 01/09/2023
Number of Days to Update: 82	Next Scheduled EDR Contact: 04/24/2023
	Data Release Frequency: Varies

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 05/06/2021	Source: Environmental Protection Agency
Date Data Arrived at EDR: 05/21/2021	Telephone: 202-564-0527
Date Made Active in Reports: 08/11/2021	Last EDR Contact: 02/24/2023
Number of Days to Update: 82	Next Scheduled EDR Contact: 06/05/2023
	Data Release Frequency: Varies

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 11/10/2022	Source: EPA
Date Data Arrived at EDR: 11/10/2022	Telephone: 800-385-6164
Date Made Active in Reports: 02/09/2023	Last EDR Contact: 02/14/2023
Number of Days to Update: 91	Next Scheduled EDR Contact: 05/29/2023
	Data Release Frequency: Quarterly

PFAS NPL: Superfund Sites with PFAS Detections Information

EPA's Office of Land and Emergency Management and EPA Regional Offices maintain data describing what is known about site investigations, contamination, and remedial actions under the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) where PFAS is present in the environment.

Date of Government Version: 02/23/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 07/08/2022	Telephone: 703-603-8895
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/10/2023
Number of Days to Update: 123	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

PFAS FEDERAL SITES: Federal Sites PFAS Information

Several federal entities, such as the federal Superfund program, Department of Defense, National Aeronautics and Space Administration, Department of Transportation, and Department of Energy provided information for sites with known or suspected detections at federal facilities.

Date of Government Version: 02/23/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/31/2022	Telephone: 202-272-0167
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/05/2023
Number of Days to Update: 222	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

PFAS TSCA: PFAS Manufacture and Imports Information

EPA issued the Chemical Data Reporting (CDR) Rule under the Toxic Substances Control Act (TSCA) and requires chemical manufacturers and facilities that manufacture or import chemical substances to report data to EPA. EPA publishes non-confidential business information (non-CBI) and includes descriptive information about each site, corporate parent, production volume, other manufacturing information, and processing and use information.

Date of Government Version: 01/03/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/31/2022	Telephone: 202-272-0167
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/05/2023
Number of Days to Update: 222	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PFAS RCRA MANIFEST: PFAS Transfers Identified In the RCRA Database Listing

To work around the lack of PFAS waste codes in the RCRA database, EPA developed the PFAS Transfers dataset by mining e-Manifest records containing at least one of these common PFAS keywords: PFAS, PFOA, PFOS, PERFL, AFFF, GENX, GEN-X (plus the VT waste codes). These keywords were searched for in the following text fields: Manifest handling instructions (MANIFEST_HANDLING_INSTR), Non-hazardous waste description (NON_HAZ_WASTE_DESCRIPTION), DOT printed information (DOT_PRINTED_INFORMATION), Waste line handling instructions (WASTE_LINE_HANDLING_INSTR), Waste residue comments (WASTE_RESIDUE_COMMENTS).

Date of Government Version: 01/03/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/31/2022	Telephone: 202-272-0167
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/05/2023
Number of Days to Update: 222	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

PFAS ATSDR: PFAS Contamination Site Location Listing

PFAS contamination site locations from the Department of Health & Human Services, Center for Disease Control & Prevention. ATSDR is involved at a number of PFAS-related sites, either directly or through assisting state and federal partners. As of now, most sites are related to drinking water contamination connected with PFAS production facilities or fire training areas where aqueous film-forming firefighting foam (AFFF) was regularly used.

Date of Government Version: 06/24/2020	Source: Department of Health & Human Services
Date Data Arrived at EDR: 03/17/2021	Telephone: 202-741-5770
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/23/2023
Number of Days to Update: 601	Next Scheduled EDR Contact: 05/08/2023
	Data Release Frequency: Varies

PFAS WQP: Ambient Environmental Sampling for PFAS

The Water Quality Portal (WQP) is a part of a modernized repository storing ambient sampling data for all environmental media and tissue samples. A wide range of federal, state, tribal and local governments, academic and non-governmental organizations and individuals submit project details and sampling results to this public repository. The information is commonly used for research and assessments of environmental quality.

Date of Government Version: 01/03/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/31/2022	Telephone: 202-272-0167
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/05/2023
Number of Days to Update: 222	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

PFAS NPDES: Clean Water Act Discharge Monitoring Information

Any discharger of pollutants to waters of the United States from a point source must have a National Pollutant Discharge Elimination System (NPDES) permit. The process for obtaining limits involves the regulated entity (permittee) disclosing releases in a NPDES permit application and the permitting authority (typically the state but sometimes EPA) deciding whether to require monitoring or monitoring with limits.

Date of Government Version: 01/03/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/31/2022	Telephone: 202-272-0167
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/05/2023
Number of Days to Update: 222	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

PFAS ECHO: Facilities in Industries that May Be Handling PFAS Listing

Regulators and the public have expressed interest in knowing which regulated entities may be using PFAS. EPA has developed a dataset from various sources that show which industries may be handling PFAS. Approximately 120,000 facilities subject to federal environmental programs have operated or currently operate in industry sectors with processes that may involve handling and/or release of PFAS.

Date of Government Version: 01/03/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/31/2022	Telephone: 202-272-0167
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/05/2023
Number of Days to Update: 222	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PFAS ECHO FIRE TRAINING: Facilities in Industries that May Be Handling PFAS Listing

A list of fire training sites was added to the Industry Sectors dataset using a keyword search on the permitted facility's name to identify sites where fire-fighting foam may have been used in training exercises. Additionally, you may view an example spreadsheet of the subset of fire training facility data, as well as the keywords used in selecting or deselecting a facility for the subset. as well as the keywords used in selecting or deselecting a facility for the subset. These keywords were tested to maximize accuracy in selecting facilities that may use fire-fighting foam in training exercises, however, due to the lack of a required reporting field in the data systems for designating fire training sites, this methodology may not identify all fire training sites or may potentially misidentify them.

Date of Government Version: 08/22/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/31/2022	Telephone: 202-272-0167
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/05/2023
Number of Days to Update: 222	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

PFAS PART 139 AIRPORT: All Certified Part 139 Airports PFAS Information Listing

Since July 1, 2006, all certified part 139 airports are required to have fire-fighting foam onsite that meet military specifications (MIL-F-24385) (14 CFR 139.317). To date, these military specification fire-fighting foams are fluorinated and have been historically used for training and extinguishing. The 2018 FAA Reauthorization Act has a provision stating that no later than October 2021, FAA shall not require the use of fluorinated AFFF. This provision does not prohibit the use of fluorinated AFFF at Part 139 civilian airports; it only prohibits FAA from mandating its use. The Federal Aviation Administration's document AC 150/5210-6D - Aircraft Fire Extinguishing Agents provides guidance on Aircraft Fire Extinguishing Agents, which includes Aqueous Film Forming Foam (AFFF).

Date of Government Version: 08/22/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 10/26/2022	Telephone: 202-272-0167
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/05/2023
Number of Days to Update: 13	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

AQUEOUS FOAM NRC: Aqueous Foam Related Incidents Listing

The National Response Center (NRC) serves as an emergency call center that fields initial reports for pollution and railroad incidents and forwards that information to appropriate federal/state agencies for response. The spreadsheets posted to the NRC website contain initial incident data that has not been validated or investigated by a federal/state response agency. Response center calls from 1990 to the most recent complete calendar year where there was indication of Aqueous Film Forming Foam (AFFF) usage are included in this dataset. NRC calls may reference AFFF usage in the ?Material Involved? or ?Incident Description? fields.

Date of Government Version: 02/23/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/31/2022	Telephone: 202-272-0167
Date Made Active in Reports: 11/08/2022	Last EDR Contact: 01/05/2023
Number of Days to Update: 222	Next Scheduled EDR Contact: 04/17/2023
	Data Release Frequency: Varies

PFAS: PFAS Contamination Site Location Listing

PFOS and PFOA stand for perfluorooctane sulfonate and perfluorooctanoic acid, respectively. Both are fluorinated organic chemicals, part of a larger family of compounds referred to as perfluoroalkyl substances (PFASs).

Date of Government Version: 09/30/2022	Source: Department of Environmental Protection
Date Data Arrived at EDR: 09/30/2022	Telephone: 207-287-4305
Date Made Active in Reports: 11/04/2022	Last EDR Contact: 12/28/2022
Number of Days to Update: 35	Next Scheduled EDR Contact: 04/03/2023
	Data Release Frequency: Varies

AIRS: Emissions Inventory Data

Point Source Criteria Pollutant Emissions Inventory data. Criteria air pollutant emissions, expressed in tons, by facility and pollutant.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 06/05/2022
Date Data Arrived at EDR: 06/08/2022
Date Made Active in Reports: 08/24/2022
Number of Days to Update: 77

Source: Department of Environmental Protection
Telephone: 207-287-7036
Last EDR Contact: 03/02/2023
Next Scheduled EDR Contact: 06/19/2023
Data Release Frequency: Annually

DRYCLEANERS: Drycleaner Facilities

A listing of drycleaning facilities that use perchloroethylene.

Date of Government Version: 08/30/2022
Date Data Arrived at EDR: 08/30/2022
Date Made Active in Reports: 11/17/2022
Number of Days to Update: 79

Source: Department of Environmental Protection
Telephone: 207-287-7030
Last EDR Contact: 02/09/2023
Next Scheduled EDR Contact: 05/15/2023
Data Release Frequency: Varies

MANIFEST: Hazardous Waste Manifest Information Listing

Hazardous waste manifest information

Date of Government Version: 06/30/2018
Date Data Arrived at EDR: 06/14/2019
Date Made Active in Reports: 08/29/2019
Number of Days to Update: 76

Source: Department of Environmental Protection
Telephone: 207-287-7882
Last EDR Contact: 03/02/2023
Next Scheduled EDR Contact: 06/19/2023
Data Release Frequency: Annually

NPDES: Wastewater Facilities Listing

A listing of wastewater facility locations.

Date of Government Version: 09/19/2022
Date Data Arrived at EDR: 09/20/2022
Date Made Active in Reports: 12/07/2022
Number of Days to Update: 78

Source: Department of Environmental Protection
Telephone: 207-287-3901
Last EDR Contact: 12/22/2022
Next Scheduled EDR Contact: 04/03/2023
Data Release Frequency: Varies

TIER 2: Tier 2 Information Listing

A listing of facilities which store or manufacture hazardous materials and submit a chemical inventory report.

Date of Government Version: 12/31/2021
Date Data Arrived at EDR: 09/07/2022
Date Made Active in Reports: 11/22/2022
Number of Days to Update: 76

Source: Maine Emergency Management Agency
Telephone: 207-624-4441
Last EDR Contact: 03/02/2023
Next Scheduled EDR Contact: 12/19/2022
Data Release Frequency: Annually

UIC: Underground Injection Control

An injection well is any bored, drilled or driven shaft, or dug hole whose depth is greater than its largest surface dimension; an improved sinkhole; or a subsurface distribution system used to discharge fluids underground. These wells range from deep, highly technical, and more frequently monitored wells to shallow on-site drainage systems, such as septic systems, cesspools, and storm water drainage wells.

Date of Government Version: 11/08/2022
Date Data Arrived at EDR: 11/08/2022
Date Made Active in Reports: 01/24/2023
Number of Days to Update: 77

Source: Department of Environmental Protection
Telephone: 207-791-8110
Last EDR Contact: 02/03/2023
Next Scheduled EDR Contact: 05/22/2023
Data Release Frequency: Varies

PCS: Permit Compliance System

PCS is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 07/14/2011
Date Data Arrived at EDR: 08/05/2011
Date Made Active in Reports: 09/29/2011
Number of Days to Update: 55

Source: EPA, Office of Water
Telephone: 202-564-2496
Last EDR Contact: 12/28/2022
Next Scheduled EDR Contact: 04/17/2023
Data Release Frequency: Semi-Annually

MINES MRDS: Mineral Resources Data System Mineral Resources Data System

Date of Government Version: 08/23/2022
Date Data Arrived at EDR: 11/22/2022
Date Made Active in Reports: 02/28/2023
Number of Days to Update: 98

Source: USGS
Telephone: 703-648-6533
Last EDR Contact: 02/24/2023
Next Scheduled EDR Contact: 06/05/2023
Data Release Frequency: Varies

PCS ENF: Enforcement data No description is available for this data

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 02/05/2015
Date Made Active in Reports: 03/06/2015
Number of Days to Update: 29

Source: EPA
Telephone: 202-564-2497
Last EDR Contact: 12/28/2022
Next Scheduled EDR Contact: 04/17/2023
Data Release Frequency: Varies

PCS INACTIVE: Listing of Inactive PCS Permits An inactive permit is a facility that has shut down or is no longer discharging.

Date of Government Version: 11/05/2014
Date Data Arrived at EDR: 01/06/2015
Date Made Active in Reports: 05/06/2015
Number of Days to Update: 120

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 12/28/2022
Next Scheduled EDR Contact: 04/17/2023
Data Release Frequency: Semi-Annually

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Protection in Maine.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/08/2014
Number of Days to Update: 191

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Protection in Maine.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/17/2014
Number of Days to Update: 200

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LUST: Recovered Government Archive Leaking Underground Storage Tank

The EDR Recovered Government Archive Leaking Underground Storage Tank database provides a list of LUST incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Protection in Maine.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/10/2014
Number of Days to Update: 193

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 11/16/2022
Date Data Arrived at EDR: 11/16/2022
Date Made Active in Reports: 02/06/2023
Number of Days to Update: 82

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 02/10/2023
Next Scheduled EDR Contact: 05/22/2023
Data Release Frequency: No Update Planned

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 04/10/2019
Date Made Active in Reports: 05/16/2019
Number of Days to Update: 36

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 12/28/2022
Next Scheduled EDR Contact: 04/17/2023
Data Release Frequency: Annually

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 10/29/2021
Date Made Active in Reports: 01/19/2022
Number of Days to Update: 82

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 01/27/2023
Next Scheduled EDR Contact: 05/08/2023
Data Release Frequency: Quarterly

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 06/30/2018
Date Data Arrived at EDR: 07/19/2019
Date Made Active in Reports: 09/10/2019
Number of Days to Update: 53

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 01/06/2023
Next Scheduled EDR Contact: 04/24/2023
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 11/30/2021
Date Made Active in Reports: 02/18/2022
Number of Days to Update: 80

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 02/13/2022
Next Scheduled EDR Contact: 05/29/2023
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data

Hazardous waste manifest information.

Date of Government Version: 10/28/2019
Date Data Arrived at EDR: 10/29/2019
Date Made Active in Reports: 01/09/2020
Number of Days to Update: 72

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 01/06/2023
Next Scheduled EDR Contact: 04/24/2023
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Oil/Gas Pipelines

Source: Endeavor Business Media

Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Electric Power Transmission Line Data

Source: Endeavor Business Media

This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Child Care Listing

Source: Department of Human Services

Telephone: 207-287-5060

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005, 2010 and 2015 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory

Source: MEGIS

Telephone: 207-287-6144

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK[®] - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

EMDC BELFAST FIRE STA
273 MAIN STREET
BELFAST, ME 04915

TARGET PROPERTY COORDINATES

Latitude (North):	44.424651 - 44° 25' 28.74"
Longitude (West):	69.019758 - 69° 1' 11.13"
Universal Transverse Mercator:	Zone 19
UTM X (Meters):	498427.2
UTM Y (Meters):	4918823.0
Elevation:	192 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	11711344 BELFAST, ME
Version Date:	2018
East Map:	11700249 SEARSPORT, ME
Version Date:	2018

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General NNW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

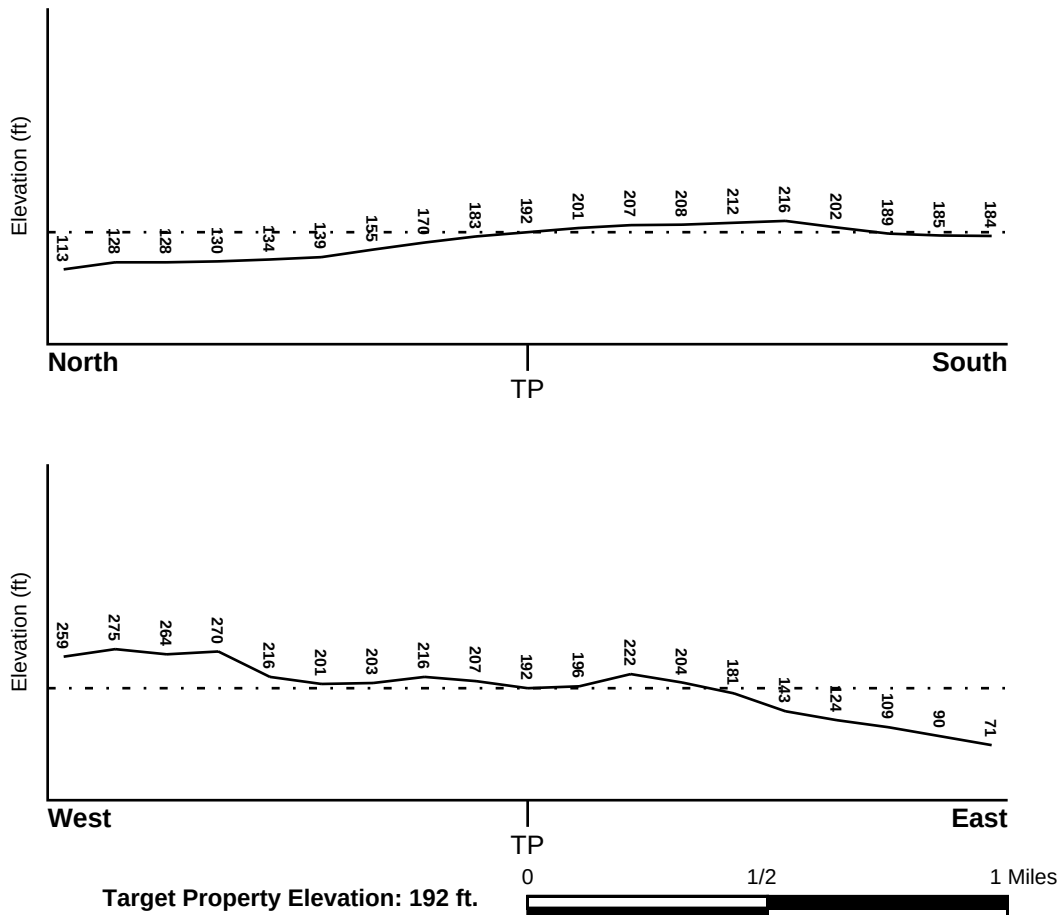

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

<u>Flood Plain Panel at Target Property</u>	<u>FEMA Source Type</u>
23027C0442E	FEMA FIRM Flood data
<u>Additional Panels in search area:</u>	<u>FEMA Source Type</u>
23027C0434E	FEMA FIRM Flood data
23027C0445E	FEMA FIRM Flood data
23027C0461E	FEMA FIRM Flood data

NATIONAL WETLAND INVENTORY

<u>NWI Quad at Target Property</u>	<u>NWI Electronic Data Coverage</u>
BELFAST	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT


Era:	Paleozoic
System:	Ordovician
Series:	Ordovician
Code:	Oe (<i>decoded above as Era, System & Series</i>)

GEOLOGIC AGE IDENTIFICATION

Category: Eugeosynclinal Deposits

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 7273839.2s

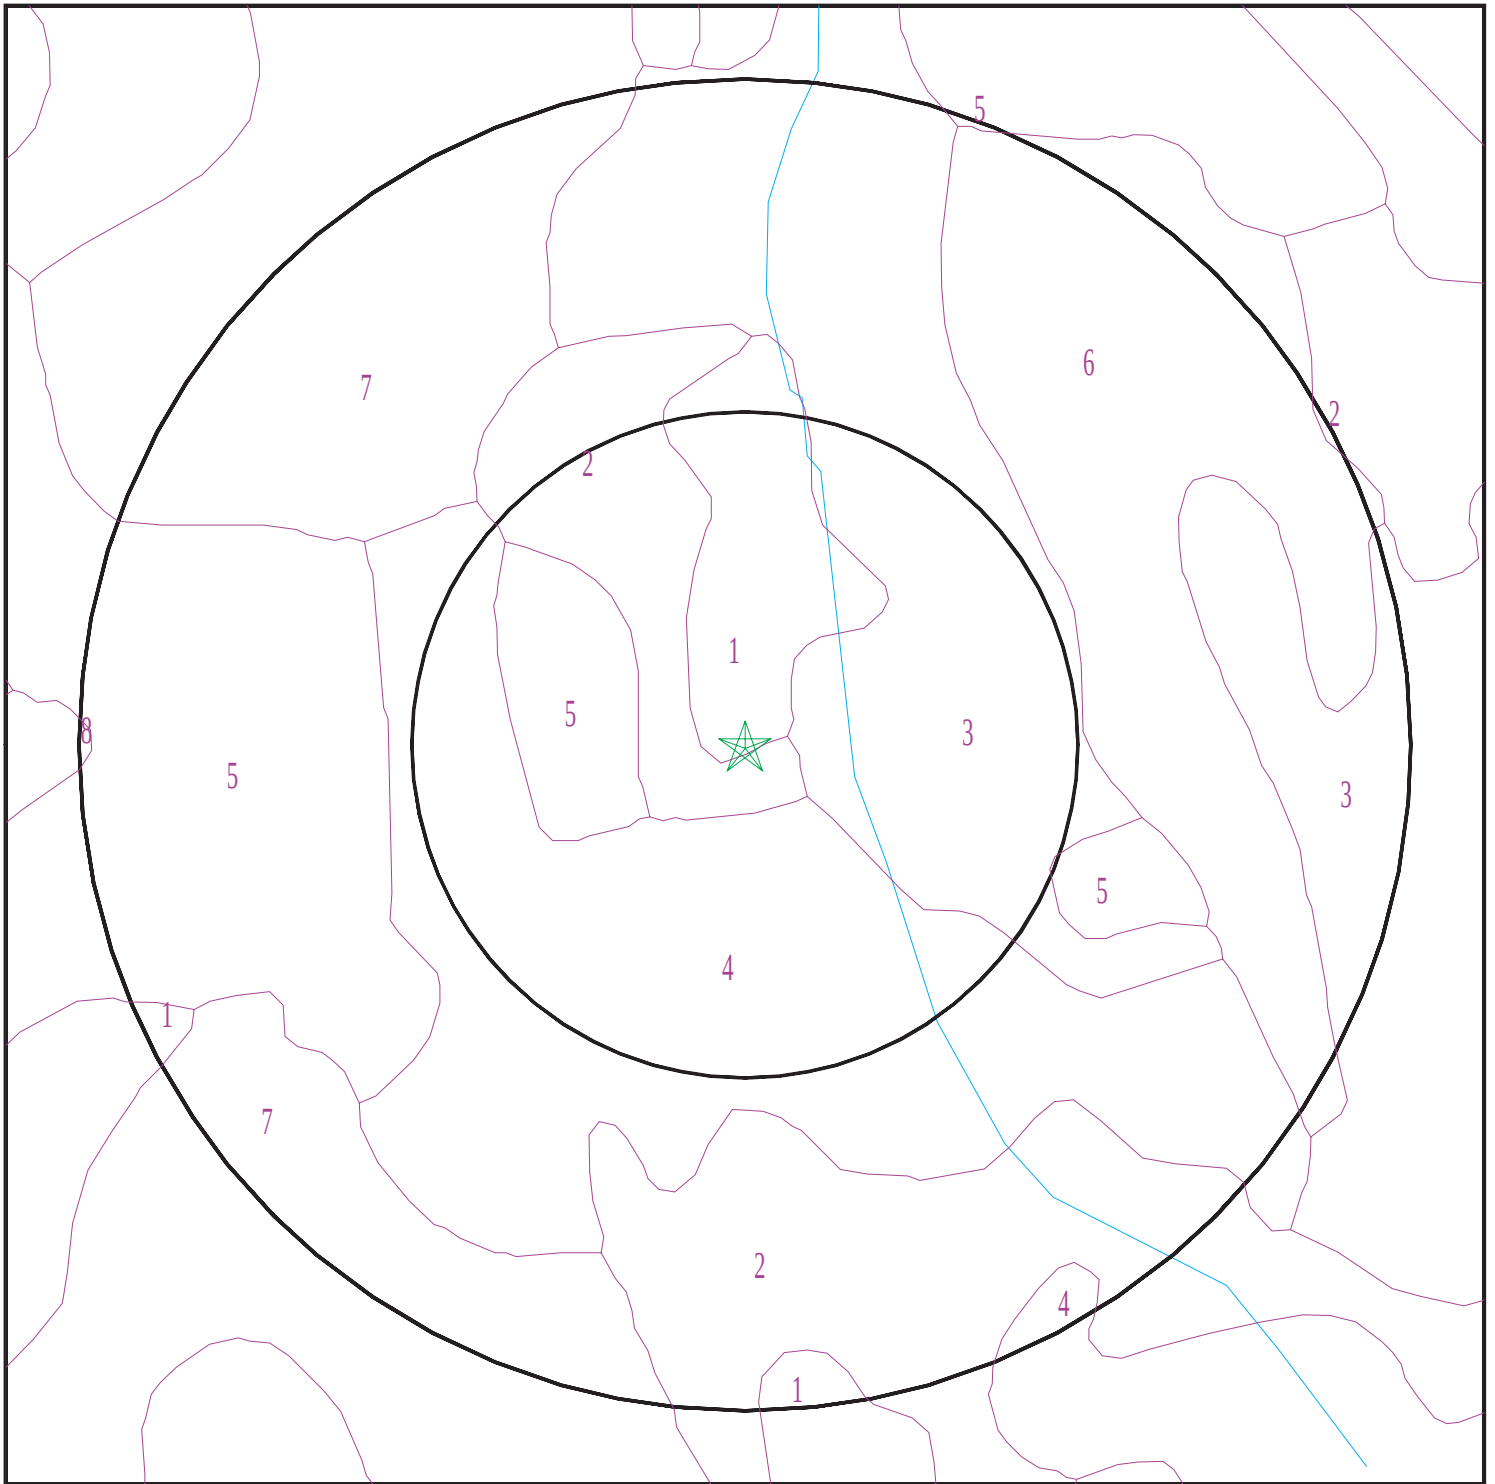

- ★ Target Property
- SSURGO Soil
- Water



SITE NAME: EMDC Belfast Fire Sta
ADDRESS: 273 Main Street
Belfast ME 04915
LAT/LONG: 44.424651 / 69.019758

CLIENT: Campbell Environmental Group
CONTACT: Danica Kay
INQUIRY #: 7273839.2s
DATE: March 08, 2023 1:38 pm

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: SWANVILLE

Soil Surface Texture: silt loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Poorly drained

Hydric Status: All hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 15 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	5 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6
2	5 inches	22 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6
3	22 inches	59 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 2

Soil Component Name: BRAYTON

Soil Surface Texture: very stony fine sandy loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Poorly drained

Hydric Status: All hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 15 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	3 inches	very stony fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6
2	3 inches	18 inches	gravelly sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6
3	18 inches	59 inches	gravelly fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 3

Soil Component Name: PERU

Soil Surface Texture: fine sandy loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 61 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	7 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 6 Min: 3.6
2	7 inches	16 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 6 Min: 3.6
3	16 inches	59 inches	gravelly sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 6 Min: 3.6

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 4

Soil Component Name: BRAYTON

Soil Surface Texture: fine sandy loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Poorly drained

Hydric Status: All hydric

Corrosion Potential - Uncoated Steel: High

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 15 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	7 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6
2	7 inches	18 inches	gravelly sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6
3	18 inches	59 inches	gravelly fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Map ID: 5

Soil Component Name: UDORTHENTS

Soil Surface Texture: very gravelly sandy loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 84 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	59 inches	very gravelly sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Gravels, Gravels with fines, Silty Gravel	Max: 141.14 Min: 0.42	Max: 7.8 Min: 4.5

Soil Map ID: 6

Soil Component Name: PERU

Soil Surface Texture: fine sandy loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 61 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	7 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 6 Min: 3.6
2	7 inches	16 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 6 Min: 3.6
3	16 inches	59 inches	gravelly sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 6 Min: 3.6

Soil Map ID: 7

Soil Component Name: PERU

Soil Surface Texture: very stony fine sandy loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Moderately well drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 61 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	5 inches	very stony fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 6 Min: 3.6
2	5 inches	16 inches	fine sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 6 Min: 3.6
3	16 inches	59 inches	gravelly sandy loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	COARSE-GRAINED SOILS, Sands, Sands with fines, Clayey sand. COARSE-GRAINED SOILS, Sands, Sands with fines, Silty Sand.	Max: 4.23 Min: 0.42	Max: 6 Min: 3.6

Soil Map ID: 8

Soil Component Name: BOOTHBAY

Soil Surface Texture: silt loam

Hydrologic Group: Class C - Slow infiltration rates. Soils with layers impeding downward movement of water, or soils with moderately fine or fine textures.

Soil Drainage Class: Somewhat poorly drained

Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Moderate

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 46 inches

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	5 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6
2	5 inches	22 inches	silt loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6
3	22 inches	59 inches	silty clay loam	Silt-Clay Materials (more than 35 pct. passing No. 200), Silty Soils.	FINE-GRAINED SOILS, Silts and Clays (liquid limit less than 50%), Lean Clay	Max: 4.23 Min: 0.42	Max: 7.3 Min: 5.6

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION


MAP ID	WELL ID	LOCATION FROM TP
9	ME0005144	1/2 - 1 Mile East

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

MAP ID	WELL ID	LOCATION FROM TP
1	MEMGS2000016591	1/8 - 1/4 Mile West
2	MEMGS2000016590	1/4 - 1/2 Mile West
A3	MEMGS2000016092	1/4 - 1/2 Mile South
A4	MEMGS2000060152	1/4 - 1/2 Mile SSE
5	MEMGS2000016123	1/4 - 1/2 Mile NNE
6	MEMGS2000053240	1/2 - 1 Mile North
7	MEMGS2000016122	1/2 - 1 Mile ENE
8	MEMGS2000016804	1/2 - 1 Mile WSW
10	MEMGS2000032173	1/2 - 1 Mile ENE
11	MEMGS2000016121	1/2 - 1 Mile West
12	MEMGS2000016124	1/2 - 1 Mile NNW
13	MEMGS2000016120	1/2 - 1 Mile West
14	MEMGS2000016119	1/2 - 1 Mile West
B15	MEMGS2000016661	1/2 - 1 Mile NNW
B16	MEMGS2000016125	1/2 - 1 Mile NNW
B17	MEMGS2000016126	1/2 - 1 Mile NNW
18	MEMGS2000016135	1/2 - 1 Mile NNW
19	MEMGS2000016136	1/2 - 1 Mile NNW

PHYSICAL SETTING SOURCE MAP - 7273839.2s

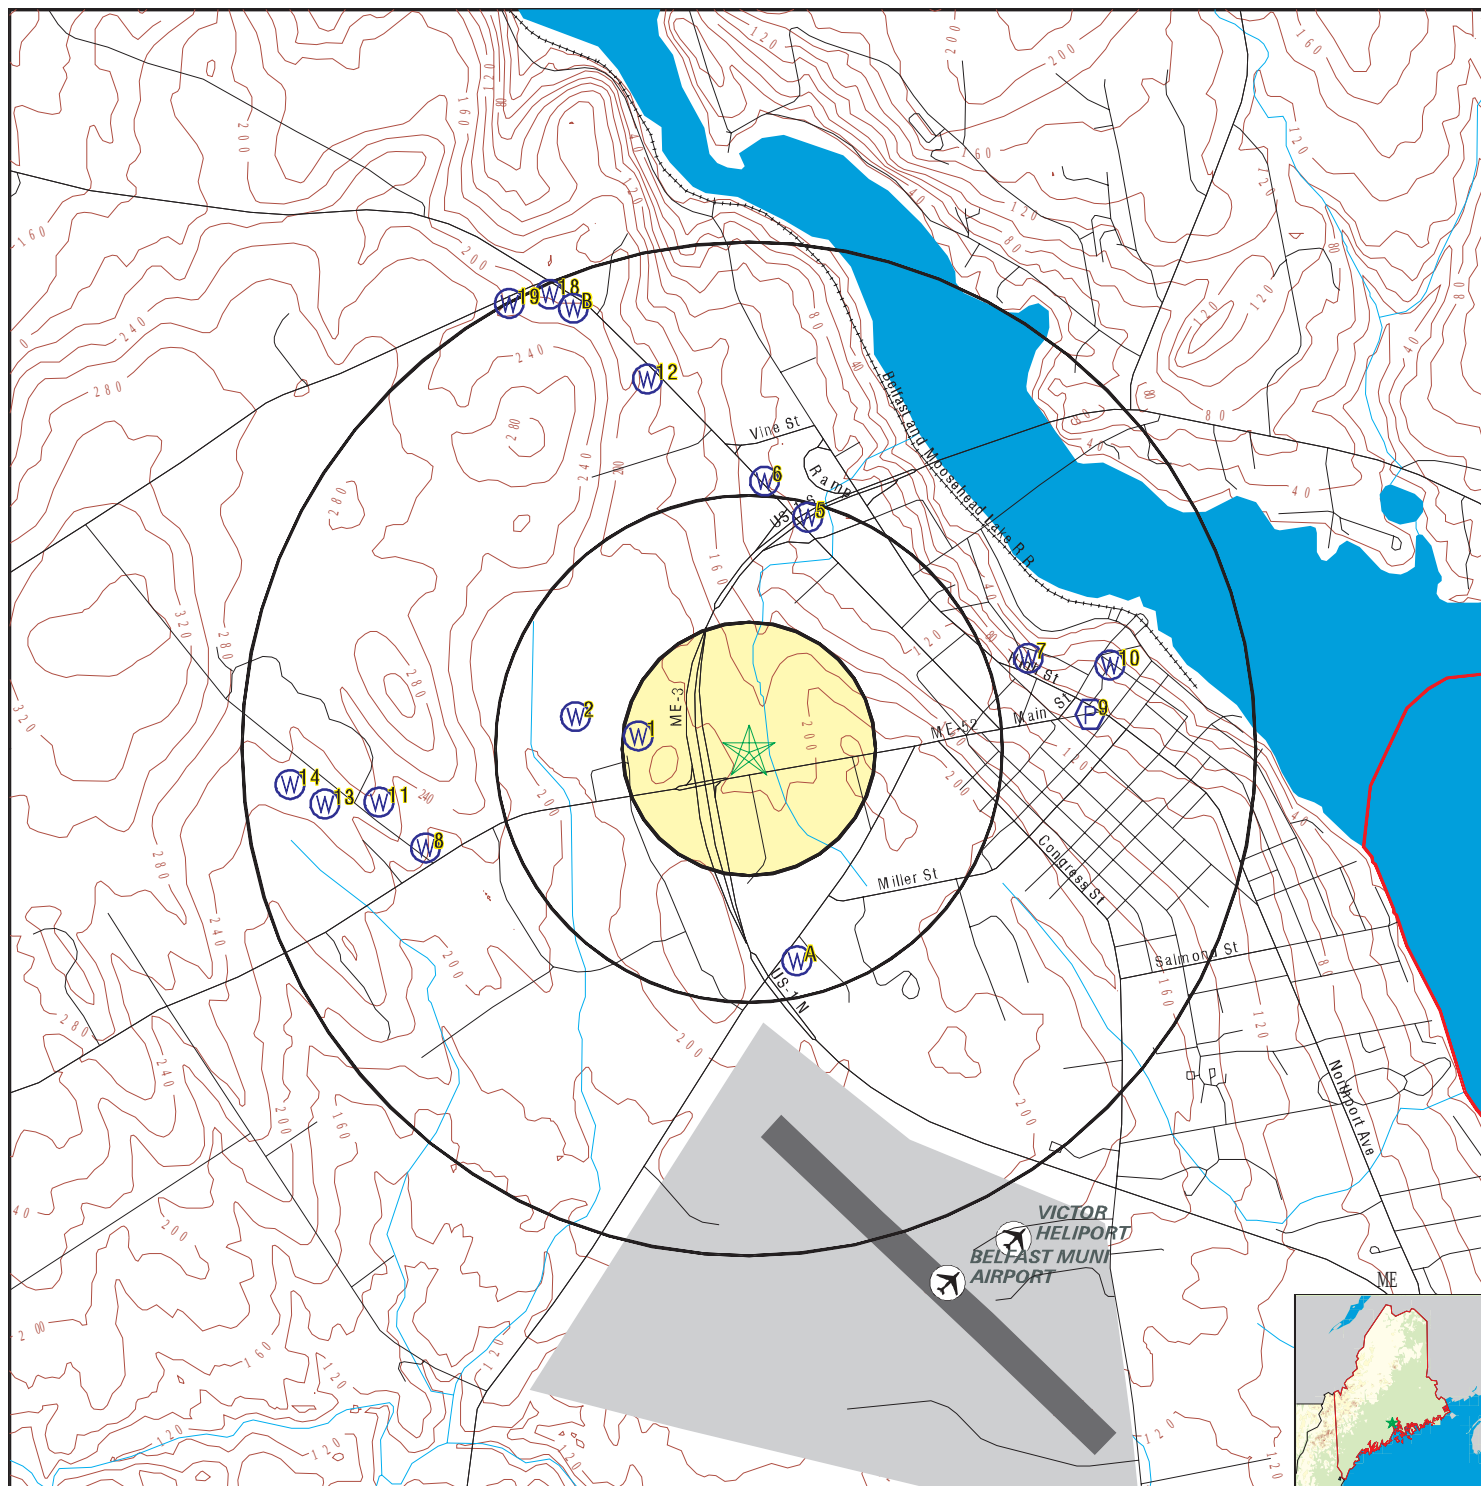

- County Boundary
- Major Roads
- Contour Lines
- Airports
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons

- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location

SITE NAME: EMDC Belfast Fire Sta
 ADDRESS: 273 Main Street
 Belfast ME 04915
 LAT/LONG: 44.424651 / 69.019758

CLIENT: Campbell Environmental Group
 CONTACT: Danica Kay
 INQUIRY #: 7273839.2s
 DATE: March 08, 2023 1:38 pm

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

1

West
1/8 - 1/4 Mile
Higher

ME WELLS MEMGS2000016591

Well #:	27234	Drill Date:	01-JAN-63
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	0	Overburden Thickness:	0
Well Depth:	265	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	SE - 215'HYI
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=27234		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=27234		

2

West
1/4 - 1/2 Mile
Higher

ME WELLS MEMGS2000016590

Well #:	27233	Drill Date:	01-JAN-63
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	COMMERCIAL	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	0	Overburden Thickness:	0
Well Depth:	180	Well Yield (GPM):	>
Yield Date:	Not Reported	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	SE - 205', HYI
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=27233		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=27233		

A3

South
1/4 - 1/2 Mile
Higher

ME WELLS MEMGS2000016092

Well #:	26735	Drill Date:	01-JAN-65
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	39	Overburden Thickness:	34
Well Depth:	115	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26735		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26735		

A4 SSE 1/4 - 1/2 Mile Higher

ME WELLS MEMGS2000060152

Well #:	121109	Drill Date:	01-MAR-17
Drill Date Estimated:	NO	Drilling Company:	H2O WELL DRILLING
Well Use:	COMMERCIAL	Well Type:	BEDROCK
Well Construction:	Not Reported	Flow Improved By:	NONE
Casing Length (ft):	60	Overburden Thickness:	15
Well Depth:	180	Well Yield (GPM):	>
Yield Date:	01-MAR-17	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	85
Vein Yield:	3	Vein 2 Depth:	170
Vein 2 Yield:	20	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	NO
Geothermal Well:	Not Reported		
Comments:	TOTAL YIELD LISTED AS 20+ EVEN THOUGH VEINS INDICATE IT SHOULD BE 23+.		
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=121109		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=121109		

5 NNE 1/4 - 1/2 Mile Lower

ME WELLS MEMGS2000016123

Well #:	26766	Drill Date:	01-JAN-66
Drill Date Estimated:	Not Reported	Drilling Company:	DRINKWATER
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	9	Overburden Thickness:	4
Well Depth:	165	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	SE - 120' ; BRE - 116'
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26766		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26766		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

6
North
1/2 - 1 Mile
Lower

ME WELLS MEMGS2000053240

Well #:	109150	Drill Date:	05-JUN-08
Drill Date Estimated:	Not Reported	Drilling Company:	HATCH WELL DRILLERS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	Not Reported	Flow Improved By:	Not Reported
Casing Length (ft):	48	Overburden Thickness:	40
Well Depth:	260	Well Yield (GPM):	Not Reported
Yield Date:	05-JUN-08	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=109150		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=109150		

7
ENE
1/2 - 1 Mile
Lower

ME WELLS MEMGS2000016122

Well #:	26765	Drill Date:	01-JAN-68
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	40	Overburden Thickness:	0
Well Depth:	45	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26765		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26765		

8
WSW
1/2 - 1 Mile
Higher

ME WELLS MEMGS2000016804

Well #:	27649	Drill Date:	19-SEP-90
Drill Date Estimated:	Not Reported	Drilling Company:	BRACKETT & SONS, INC.
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	Not Reported	Flow Improved By:	Not Reported
Casing Length (ft):	60	Overburden Thickness:	45
Well Depth:	210	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	25

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=27649		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=27649		

9
East
1/2 - 1 Mile
Lower

FRDS PWS ME0005144

Epa region:	01	State:	ME
Pwsid:	ME0005144	Pwsname:	TEMPLE HEIGHTS SPIRITUAL CAMP
Cityserved:	Not Reported	Stateserved:	ME
Zipserved:	Not Reported	Fipscounty:	23027
Status:	Closed	Retpopsrwd:	18
Pwssvconn:	1	Psource longname:	Groundwater
Pwstype:	TNCWS	Owner:	Private
Contact:	TEMPLE HEIGHTS, TREASURER	Contactorgname:	TEMPLE HEIGHTS, TREASURER
Contactphone:	Not Reported	Contactaddress1:	PO BOX 311
Contactaddress2:	Not Reported	Contactcity:	LINCOLNVILLE
Contactstate:	ME	Contactzip:	04849
Pwsactivitycode:	N		
PWS ID:	ME0005144	PWS type:	Not Reported
PWS name:	Not Reported	PWS address:	Not Reported
PWS city:	Not Reported	PWS state:	Not Reported
PWS zip:	Not Reported	PWS ID:	ME0005144
Activity status:	Active	Date system activated:	7701
Date system deactivated:	Not Reported	Retail population:	00000040
System name:	NICKAWA LODGE	System address:	TEMPLE HEIGHTS SPIRITUAL CORP
System address:	PO BOX 64 - CYRIL HOPPER	System city:	LINCOLNVILLE
System state:	ME	System zip:	04849
County FIPS:	Not Reported	City served:	MOSCOW
Population served:	Under 101 Persons	Treatment:	Untreated
Latitude:	442532	Longitude:	0690024
Violation id:	36502	Orig code:	S
State:	ME	Violation Year:	2002
Contamination code:	3100	Contamination Name:	Coliform (TCR)
Violation code:	22	Violation name:	MCL, Monthly (TCR)
Rule code:	110	Rule name:	TCR
Violation measur:	Not Reported	Unit of measure:	Not Reported
State mcl:	Not Reported	Cmp bdt:	07/01/2002
Cmp edt:	07/31/2002		
Violation id:	36602	Orig code:	S
State:	ME	Violation Year:	2002
Contamination code:	3100	Contamination Name:	Coliform (TCR)
Violation code:	22	Violation name:	MCL, Monthly (TCR)
Rule code:	110	Rule name:	TCR
Violation measur:	Not Reported	Unit of measure:	Not Reported
State mcl:	Not Reported	Cmp bdt:	08/01/2002

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Cmp edt:	08/31/2002		
Violation id:	36803	Orig code:	S
State:	ME	Violation Year:	2002
Contamination code:	7500	Contamination Name:	Public Notice
Violation code:	75	Violation name:	PN Violation for NPDWR Violation
Rule code:	410	Rule name:	PN rule
Violation measur:	Not Reported	Unit of measure:	Not Reported
State mcl:	Not Reported	Cmp bdt:	08/19/2002
Cmp edt:	Not Reported		
Violation id:	36903	Orig code:	S
State:	ME	Violation Year:	2002
Contamination code:	7500	Contamination Name:	Public Notice
Violation code:	75	Violation name:	PN Violation for NPDWR Violation
Rule code:	410	Rule name:	PN rule
Violation measur:	Not Reported	Unit of measure:	Not Reported
State mcl:	Not Reported	Cmp bdt:	09/30/2002
Cmp edt:	Not Reported		
Violation ID:	29398	Orig Code:	S
Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Compliance achieved	Enforcement Category:	Resolving
Violation ID:	29398	Orig Code:	S
Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Public Notif received	Enforcement Category:	Informal
Violation ID:	29498	Orig Code:	S
Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Public Notif received	Enforcement Category:	Informal
Violation ID:	29498	Orig Code:	S
Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Compliance achieved	Enforcement Category:	Resolving
Violation ID:	36299	Orig Code:	S
Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Compliance achieved	Enforcement Category:	Resolving
Violation ID:	36299	Orig Code:	S
Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Public Notif received	Enforcement Category:	Informal
Violation ID:	36502	Orig Code:	S
Enforcemnt FY:	2002	Enforcement Action:	07/19/2002
Enforcement Detail:	St Violation/Reminder Notice		
Enforcement Category:	Informal		
Violation ID:	36502	Orig Code:	S
Enforcemnt FY:	2002	Enforcement Action:	07/19/2002
Enforcement Detail:	St Public Notif requested	Enforcement Category:	Informal
Violation ID:	36502	Orig Code:	S
Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Public Notif received	Enforcement Category:	Informal
Violation ID:	36502	Orig Code:	S
Enforcemnt FY:	2004	Enforcement Action:	10/24/2003
Enforcement Detail:	St Compliance achieved	Enforcement Category:	Resolving
Violation ID:	36602	Orig Code:	S

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Public Notif received	Enforcement Category:	Informal
Violation ID:	36602	Orig Code:	S
Enforcemnt FY:	2002	Enforcement Action:	08/30/2002
Enforcement Detail:	St Public Notif requested	Enforcement Category:	Informal
Violation ID:	36602	Orig Code:	S
Enforcemnt FY:	2004	Enforcement Action:	10/24/2003
Enforcement Detail:	St Compliance achieved	Enforcement Category:	Resolving
Violation ID:	36602	Orig Code:	S
Enforcemnt FY:	2002	Enforcement Action:	08/30/2002
Enforcement Detail:	St Violation/Reminder Notice		
Enforcement Category:	Informal		
Violation ID:	36803	Orig Code:	S
Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Compliance achieved	Enforcement Category:	Resolving
Violation ID:	36903	Orig Code:	S
Enforcemnt FY:	2003	Enforcement Action:	09/04/2003
Enforcement Detail:	St Compliance achieved	Enforcement Category:	Resolving

10
ENE
1/2 - 1 Mile
Lower

ME WELLS MEMGS2000032173

Well #:	59669	Drill Date:	06-NOV-97
Drill Date Estimated:	Not Reported	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	Not Reported	Flow Improved By:	AIR
Casing Length (ft):	20	Overburden Thickness:	10
Well Depth:	250	Well Yield (GPM):	Not Reported
Yield Date:	06-NOV-97	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	250
Vein Yield:	5	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=59669		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=59669		

11
West
1/2 - 1 Mile
Higher

ME WELLS MEMGS2000016121

Well #:	26764	Drill Date:	01-JAN-60
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	50	Overburden Thickness:	45
Well Depth:	130	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	5
SWL Measured:	Not Reported	Vein Depth:	0

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	BUILDING
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26764		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26764		

12 NNW 1/2 - 1 Mile Higher

ME WELLS MEMGS2000016124

Well #:	26767	Drill Date:	01-JAN-68
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	9	Overburden Thickness:	4
Well Depth:	217	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	BUILDING
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26767		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26767		

13 West 1/2 - 1 Mile Higher

ME WELLS MEMGS2000016120

Well #:	26763	Drill Date:	19-JUL-71
Drill Date Estimated:	Not Reported	Drilling Company:	GALLANT'S ARTESIAN WELLS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	0	Overburden Thickness:	0
Well Depth:	100	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	14
SWL Measured:	Not Reported	Vein Depth:	100
Vein Yield:	11	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26763		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26763		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

14
West
1/2 - 1 Mile
Higher

ME WELLS MEMGS2000016119

Well #:	26762	Drill Date:	01-JAN-64
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	24	Overburden Thickness:	19
Well Depth:	168	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	28
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported		
Comments:	THERE IS A JOHN G. & ROSIE AND A JOHN G. & GLORIA		
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26762		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26762		

B15
NNW
1/2 - 1 Mile
Higher

ME WELLS MEMGS2000016661

Well #:	27363	Drill Date:	25-MAR-88
Drill Date Estimated:	Not Reported	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	Not Reported	Flow Improved By:	Not Reported
Casing Length (ft):	20	Overburden Thickness:	20
Well Depth:	180	Well Yield (GPM):	Not Reported
Yield Date:	25-MAR-88	Static Water Level:	15
SWL Measured:	25-MAR-88	Vein Depth:	180
Vein Yield:	7	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=27363		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=27363		

B16
NNW
1/2 - 1 Mile
Higher

ME WELLS MEMGS2000016125

Well #:	26768	Drill Date:	01-JAN-60
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	12	Overburden Thickness:	7
Well Depth:	115	Well Yield (GPM):	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Yield Date:	Not Reported	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26768		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26768		

B17
NNW
1/2 - 1 Mile
Higher

ME WELLS MEMGS2000016126

Well #:	26769	Drill Date:	01-JAN-70
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	21	Overburden Thickness:	16
Well Depth:	365	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	35
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26769		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26769		

18
NNW
1/2 - 1 Mile
Higher

ME WELLS MEMGS2000016135

Well #:	26778	Drill Date:	01-JAN-68
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	15	Overburden Thickness:	10
Well Depth:	100	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	0
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	Not Reported
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26778		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26778		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

19
NNW
1/2 - 1 Mile
Higher

ME WELLS MEMGS2000016136

Well #:	26779	Drill Date:	01-JAN-65
Drill Date Estimated:	YES	Drilling Company:	E. A. CROSS & SONS
Well Use:	DOMESTIC	Well Type:	BEDROCK
Well Construction:	DRILLED	Flow Improved By:	Not Reported
Casing Length (ft):	16	Overburden Thickness:	11
Well Depth:	308	Well Yield (GPM):	Not Reported
Yield Date:	Not Reported	Static Water Level:	18
SWL Measured:	Not Reported	Vein Depth:	0
Vein Yield:	0	Vein 2 Depth:	0
Vein 2 Yield:	0	Vein 3 Depth:	0
Vein 3 Yield:	0	Vein 4 Depth:	0
Vein 4 Yield:	0	Replacement Well:	Not Reported
Geothermal Well:	Not Reported	Comments:	BUILDING
Hydrofracture:	Not Reported		
Well Correction URL:	https://www.mgs-collect.site/mgs-survey/well_correction_view.php?addNew_x=1&wellid=26779		
Well URL:	https://www.mgs-collect.site/mgs-collect/hooks/wells_print_well_card_mapviewer.php?id=26779		

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

RADON

AREA RADON INFORMATION

State Database: ME Radon

Radon Test Results

Zip	City	Floor	Results
04915	BELFAST	B	2.5
04915		F	0.7
04915		F	0.9
04915		B	8.1
04915		B	8.1
04915		F	1.1
04915		B	0.2
04915		B	0.2
04915		B	0.8
04915		B	0.9
04915		B	0.2
04915		B	0.2
04915		B	0.2
04915		B	3.3
04915		F	0.2
04915		B	1.2
04915		B	1.0
04915		B	1.2
04915		B	1.0
04915		B	5.9
04915		B	6.3

Federal EPA Radon Zone for WALDO County: 2

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for Zip Code: 04915

Number of sites tested: 2

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor	1.100 pCi/L	100%	0%	0%
Living Area - 2nd Floor	Not Reported	Not Reported	Not Reported	Not Reported
Basement	3.950 pCi/L	50%	50%	0%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map

Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005, 2010 and 2015 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory

Source: MEGIS

Telephone: 207-287-6144

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

Maine Geological Survey Water Well Database

Source: Maine Geological Survey

Telephone: 207-287-3200

Contains over 50,000 located wells is available for download. This file contains information on all wells in the database which could be geographically located. Data points have been located by GPS, by street address locations, and by using tax maps in combination with air photos so location accuracy varies. The database includes coordinates and descriptive information such as well yield, depth, overburden thickness, well use, and well type.

Public Water Supply Wells Database

Source: Department of Human Services, Drinking Water Program

Telephone: 207-287-6196

There are 3 types of public water systems in Maine: Transient Systems; Community Systems and Non-transient Non-community Systems.

OTHER STATE DATABASE INFORMATION

RADON

Maine Radon Test Results

Source: Department of Human Services

Telephone: 207-287-5698

The state of Maine Radiation Control Program's - Radon/Indoor Air Quality Section's position on radon map, is that they should be used neither to predict the presence of high nor low values in any given geographic or geologic area. The only conclusion that should be drawn from this data is that radon is omnipresent in the soil gasses in the state of Maine, and therefore all residences and buildings that come in contact with the ground should be tested for radon.

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

OTHER

Airport Landing Facilities: Private and public use landing facilities
Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater
Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

STREET AND ADDRESS INFORMATION

Â© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.